





ASC Competition Commercial, Region 7		REQUEST FOR INFORMATION  FOR  <b>Solano County Classroom and Vocational Training Center</b>		R.F.I.. NO: 11.4.1
  <b>HENSEL PHELPS</b> Plan. Bui.d. Manage.				ISSUING ENTITY: Hensel Phelps
		SHEETS: A202.1	DETAILS / SECTIONS: SK-01, SK-02	SPECIFICATIONS REF:
TITLE OR SECTION OF WORK:  Door Swing Revisions Due to ADA Clear Swing Requirements				
PERTENENT PROBLEM SECTION: Section 11: Quality Control			ISSUED BY:  DATE:	
WRITTEN DESCRIPTION OF PROBLEM - ATTACH SKETCHES AS REQUIRED:  Reference A202, A202.1 and Mezzanine Shop Drawing Submittal Submittal 0009-13 49 19-2  The current stair design at 'Mezzanine B' creates conflicts with the doors at the Classrooms and Tool Rooms located below. In order to maintain proper clearance requirements for ADA accessibility, the following items need to be addressed:  1. The mezzanine landing at the tops of the stairs at level 2 require structural columns at each corner of the landing. The current configuration of the double doors to the Classroom B138 would cause the southern leaf of each door to hit the required stair column (SK-01). Please confirm it is acceptable to revise the double doors to be one 4'-0" door. In addition, please confirm it is acceptable to increase the size of the top landings to allow for 18" minimum maneuvering clearance. If acceptable, please provide a revised drawing indicating updated door and landing locations.  2. The current layout of the doors to the tool rooms cause ADA clearance issues due to conflict with stair guardrails. Please confirm it is acceptable to revise the swing of the doors as indicated in SK-02.				
A/E RESPONSE:				
BY: DATE:				
DISTRIBUTION:				

Please confirm it is acceptable to revise to single 4'-0" door and increase stair landing size. Please provide updated landing size to allow for 18" minimum space at pull side.



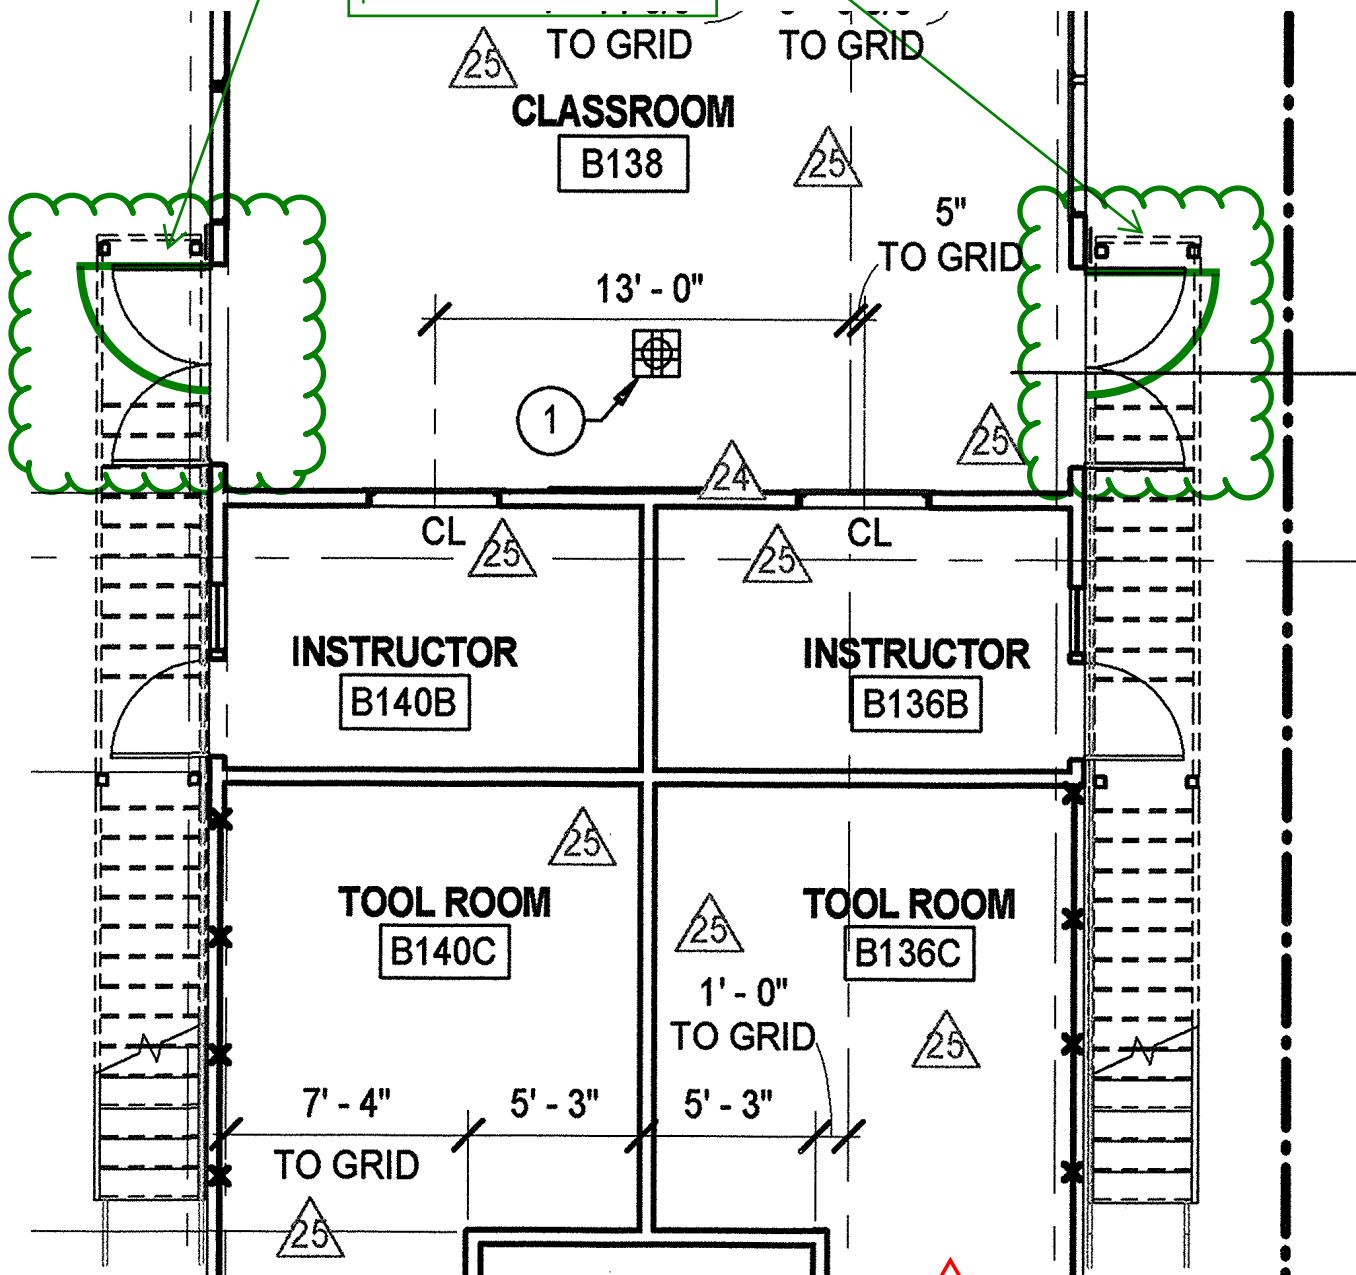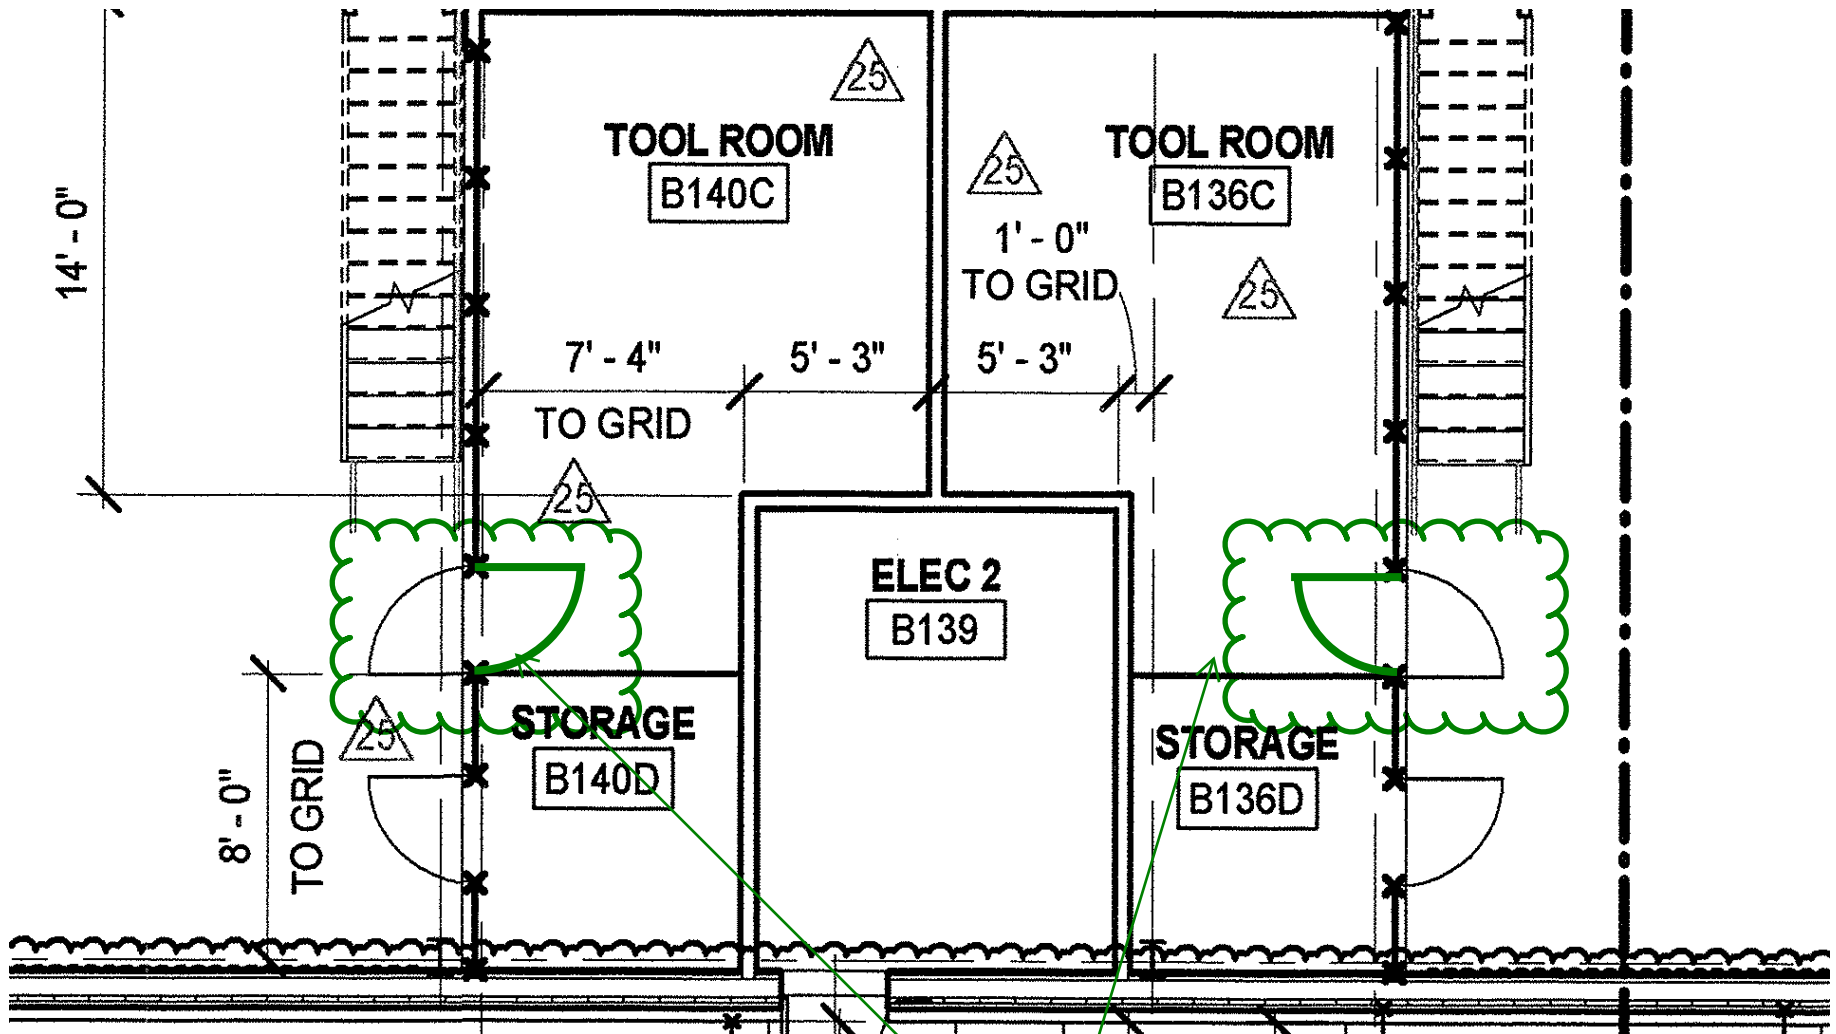

Current layout does not provide minimum 18" clearance at pull side required by ADA due to conflict with stair guardrail. Please confirm it is acceptable to revise the door swing as shown.