


**GENERAL NOTES**

A. TOTAL OCCUPANTS OF NEW AND REMODELED AREAS = 10 (SEE SHEET FLS 08a)

B. TOTAL EXIT CAPACITY AVAILABLE TO OCCUPANTS = 165

- LEGEND**
- HORIZONTAL EXIT
  - EXIT ACCESS
  - EXIT DOOR
  - STAND PIPE (PROVIDE IN EACH REQUIRED STAIR)
  - AREA OF WORK
  - 2-HOUR FIRE BARRIER AT SHAFT/EXIT (106). DUCT PENETRATION: 90 MIN F/S DAMPER. DOOR: 90 MIN F/S AT SHAFT, 90 MIN F AT STAIR
  - 2-HOUR FIRE BARRIER AT HORIZONTAL EXIT (106). DUCT PENETRATION: 90 MIN F DAMPER. DOOR: 90 MIN F RATED
  - 2-HOUR FIRE BARRIER OCCUPANCY/SMOKE COMPARTMENT (106). DUCT: 90 MIN F/S DAMPER. DOOR: 90 MIN F/S RATED
  - 1-HOUR FIRE BARRIER OCCUPANCY SEPARATION. DUCT: 90 MIN F DAMPER. DOOR: 45 MIN F RATED
  - 1-HOUR FIRE BARRIER INCIDENTAL USE SEPARATION (TABLE 508.2). DUCT: 90 MIN F/S DAMPER. DOOR: 45 MIN F/S RATED
  - 1-HOUR SMOKE BARRIER / SMOKE COMPARTMENT (103). DUCT: 90 MIN F/S DAMPER. DOOR: 20 MIN F/S RATED
  - SMOKE PARTITION AT SUITE BOUNDARY (110). DUCT: SEALED AROUND NO DAMPER (110.1). DOOR: NON-RATED (401.3.1)
  - SMOKE PARTITION AT CORRIDOR (110). DUCT: SEALED AROUND NO DAMPER (110.1). DOOR: NON-RATED (401.3.1)
  - INCIDENTAL USE - 1-HOUR (TABLE 508.2) (NFPA 18.3.2.1)
  - INCIDENTAL USE - SMOKE (TABLE 508.2)

**GIFFIN • BOLTE • JURGENS**  
ARCHITECTS  
815 S.W. SECOND AVENUE • PORTLAND, OREGON 97204  
(503) 223-0992 www.gbjarch.com FAX (503) 294-3961

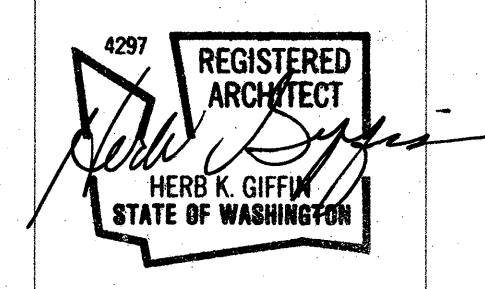

**MultiCare**  
**EMERGENCY DEPARTMENT & CANCER CENTER EXPANSION**  
TACOMA, WASHINGTON

△ CCD 04 12-17-2008  
△ CCD 07 02-20-2009

Date 09-26-2008  
Scale 1" = 20'-0"  
Drawn By JLC  
Job No. 4034

**8th Floor  
Fire & Life Safety**

**FLS  
08**