



4/16/2013 10:13:20 AM  
C:\FA\Revit\Projects\200725 SCFM\Aesse Dzt.rvt


Warning: It is a violation of the law for any person, unless acting under the direction of a licensed architect, to alter an item in any way. If an item in this document is altered, the altering architect, if other than the architect of record, shall affix the item his seal and the notation "altered by" followed by his signature and the date of such alteration, and the specific description of the alteration.

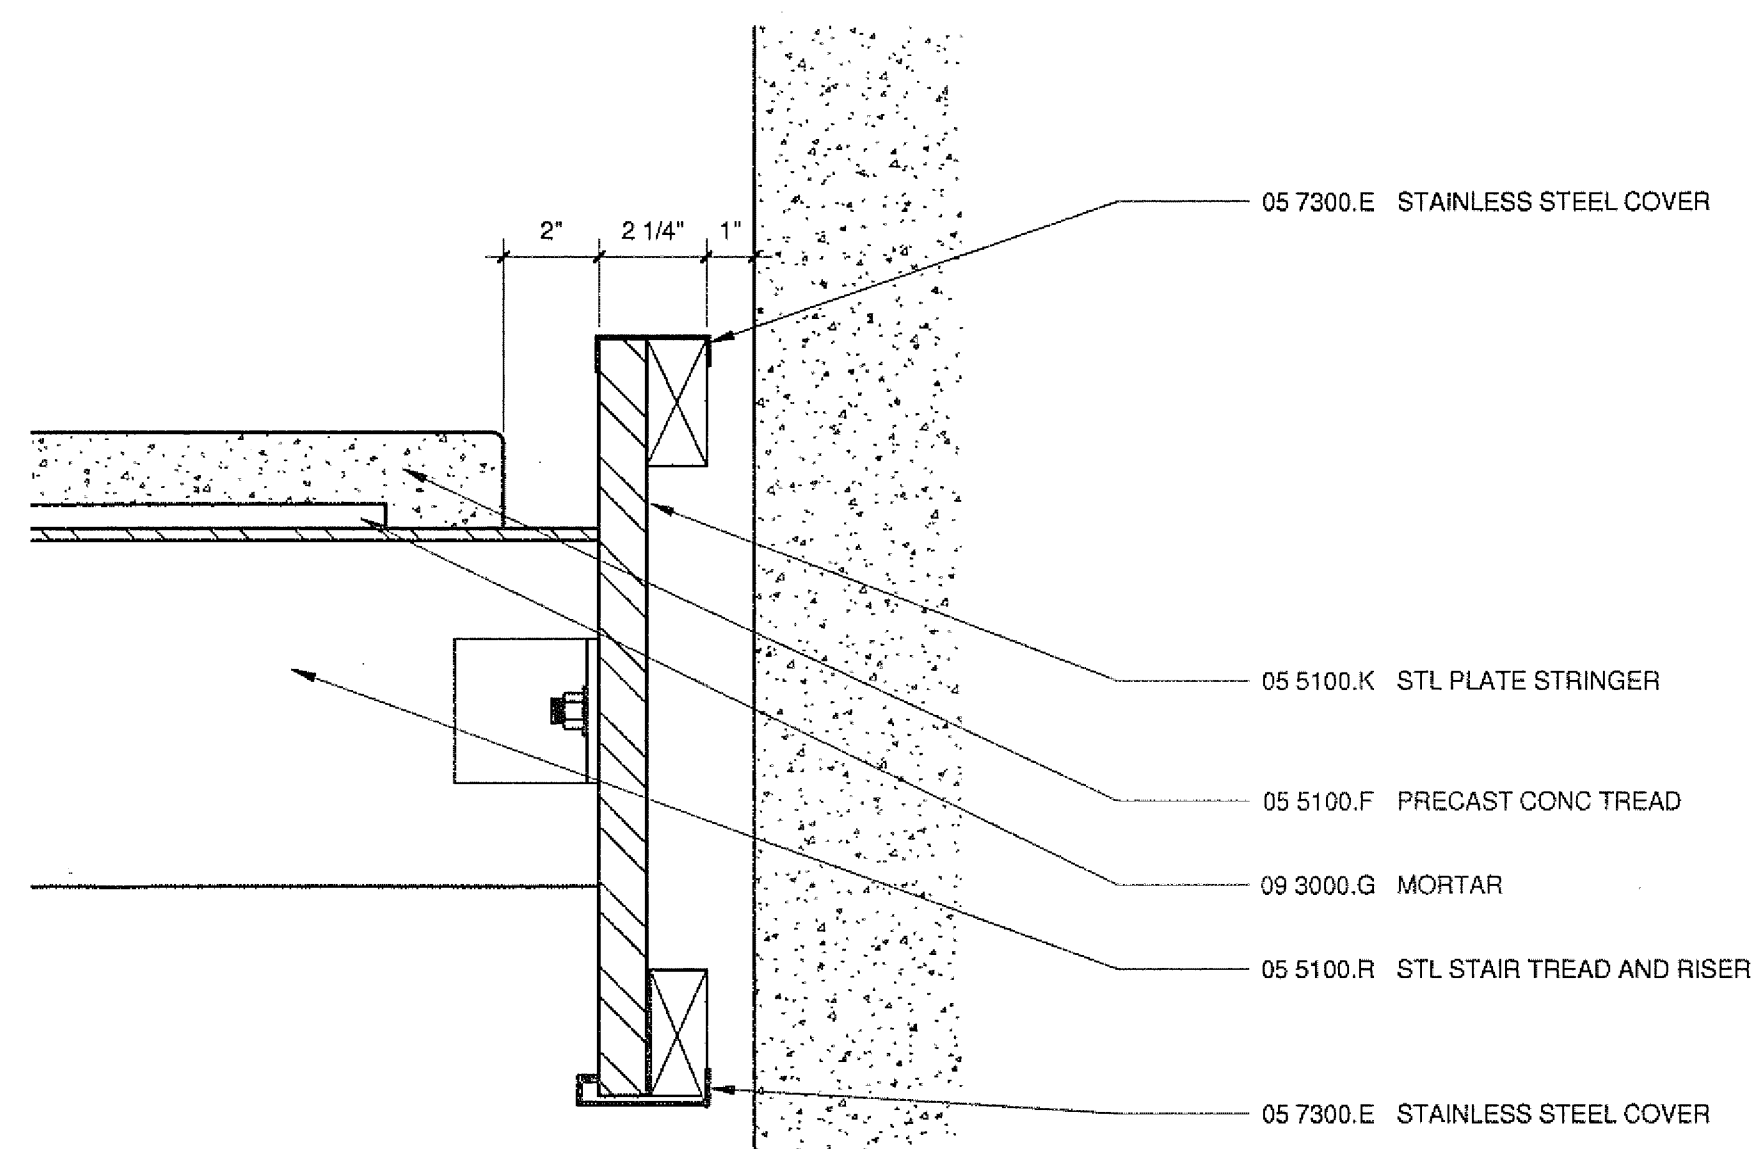


13 SS STRINGER AT CONC WALL  
A2801|A9302 3" = 1'-0"

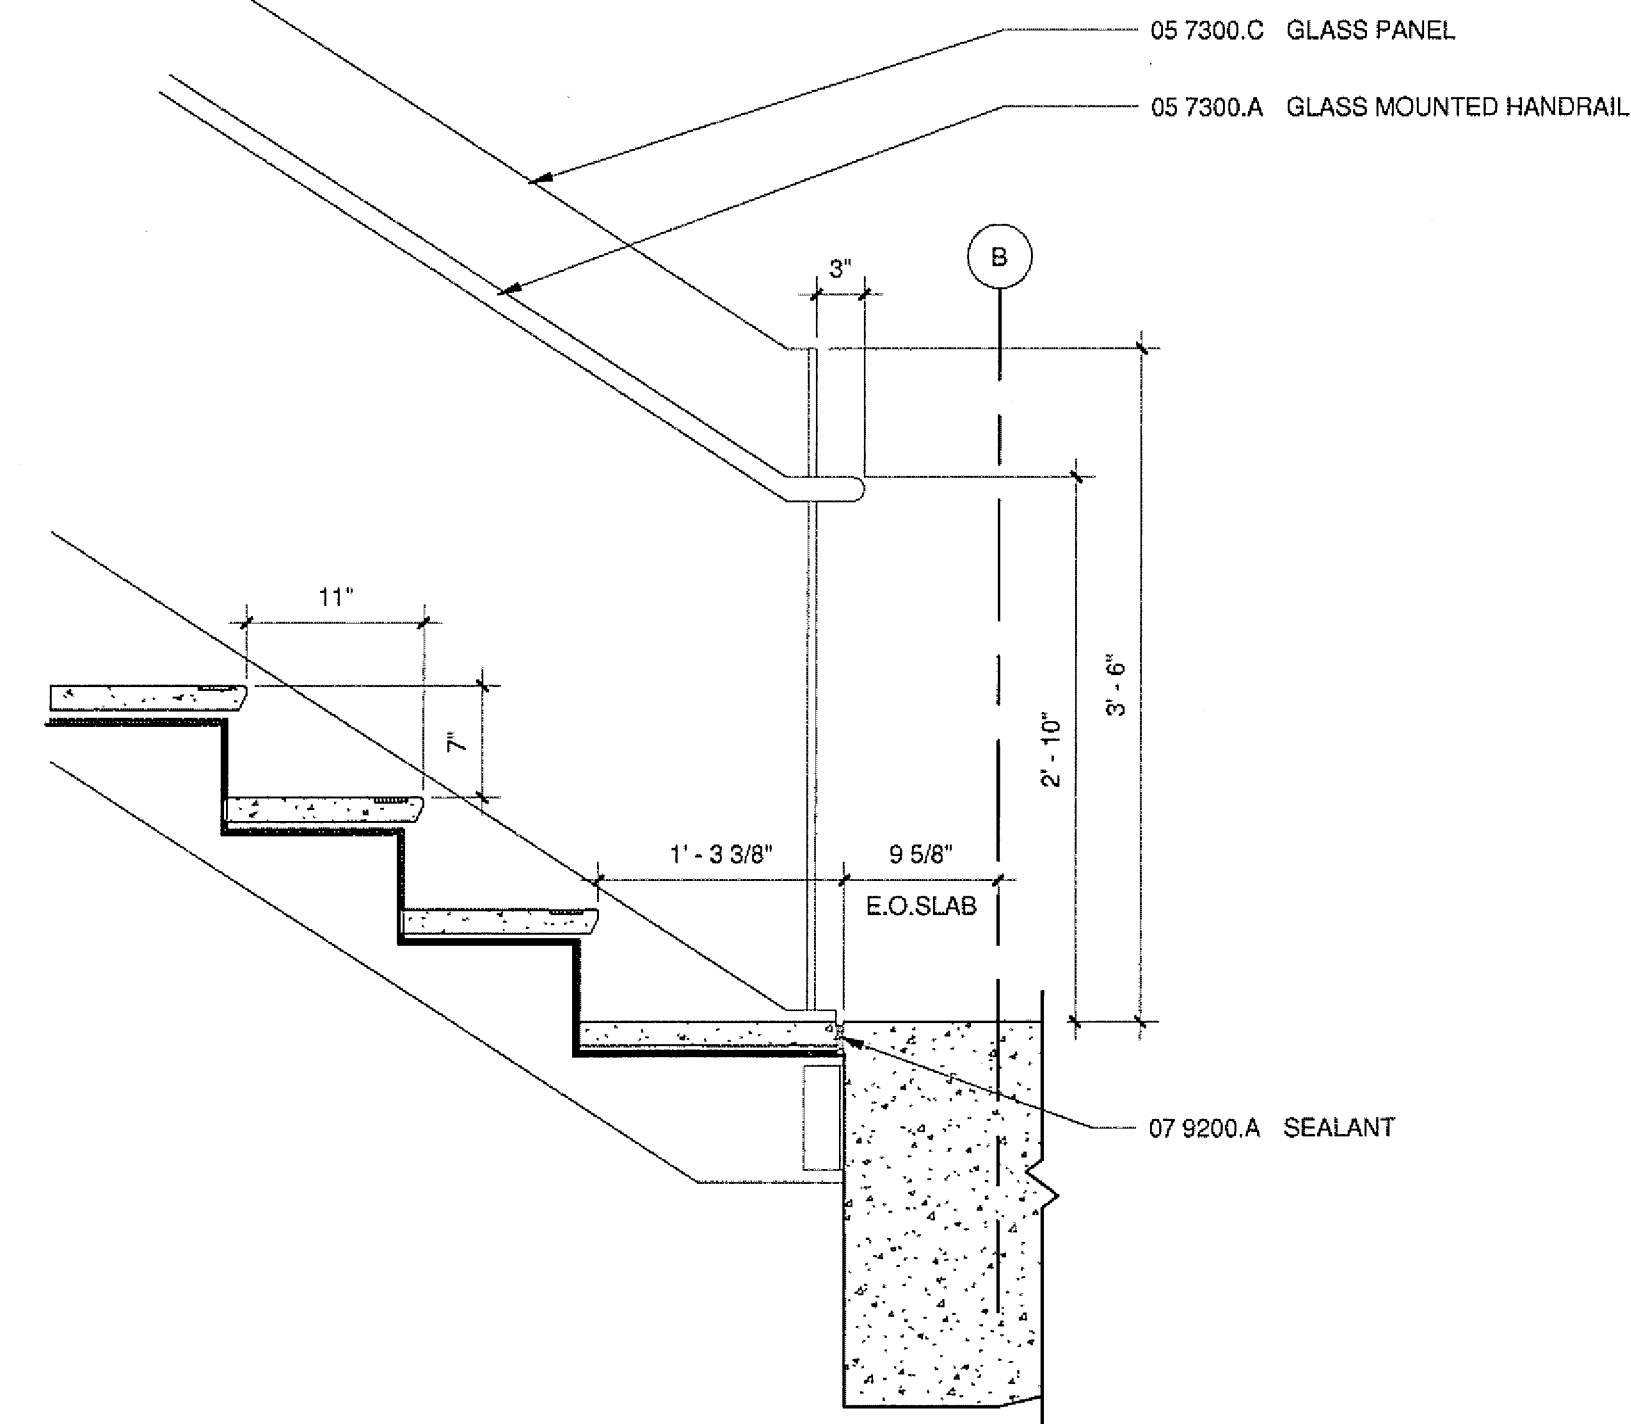


14 LANDING SECTION AT HEAD-NORTH  
A2801|A9302 1" = 1'-0"

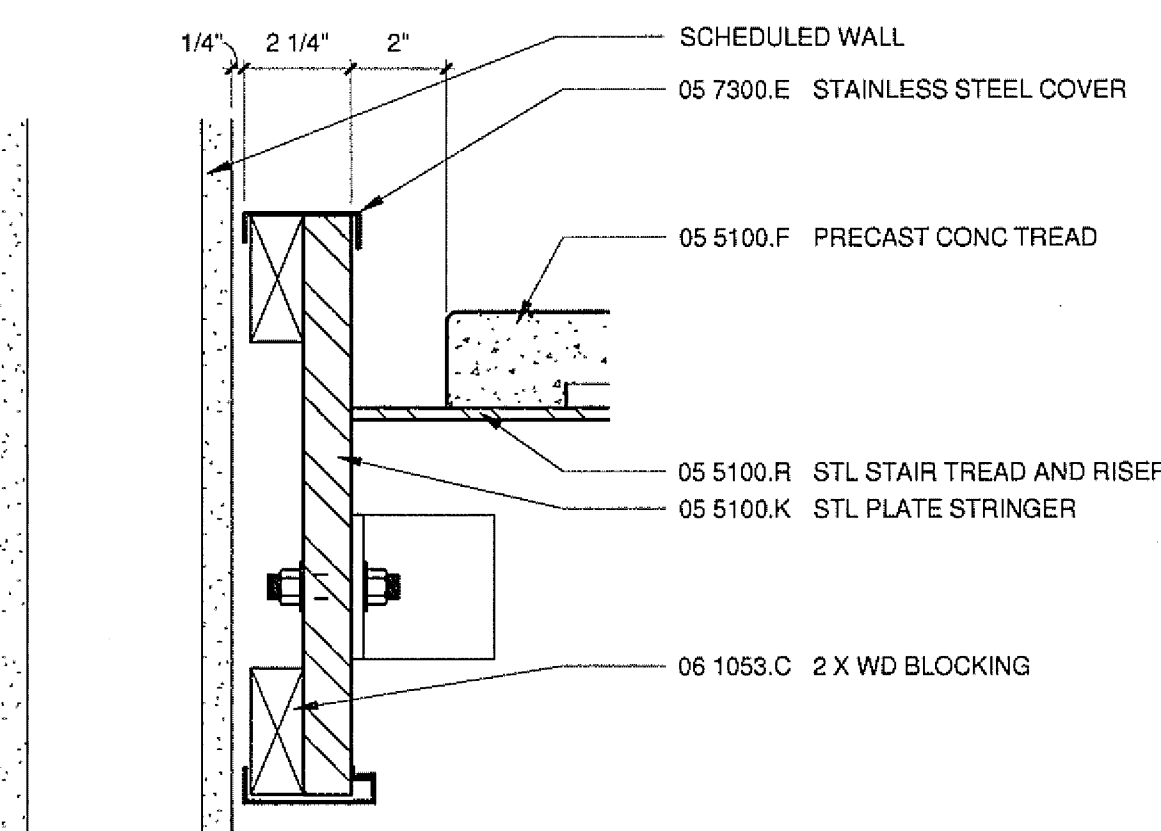


15 STRINGER AT GYP WALL  
A9302|A9302 3" = 1'-0"

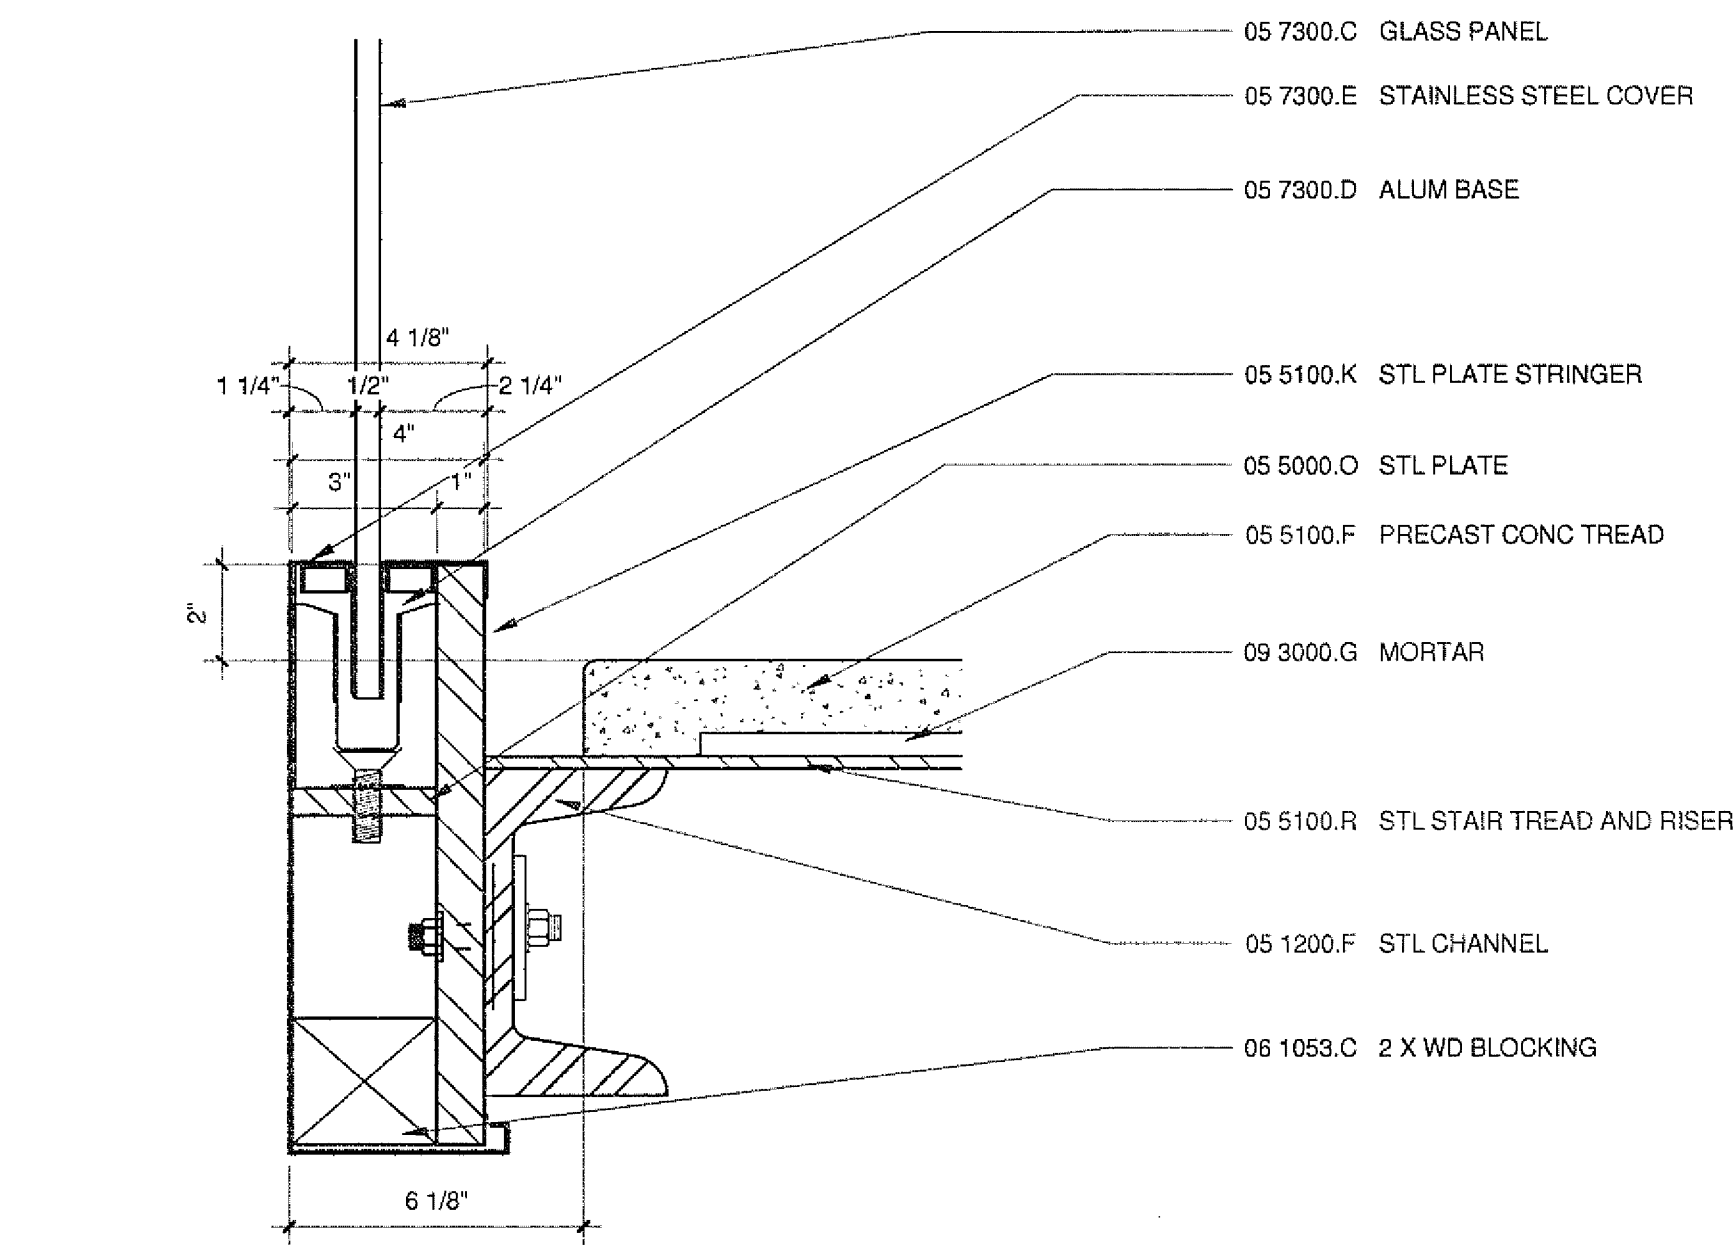

9 GLASS GUARDRAIL @ STAIR LANDING  
A2801|A9302 3" = 1'-0"


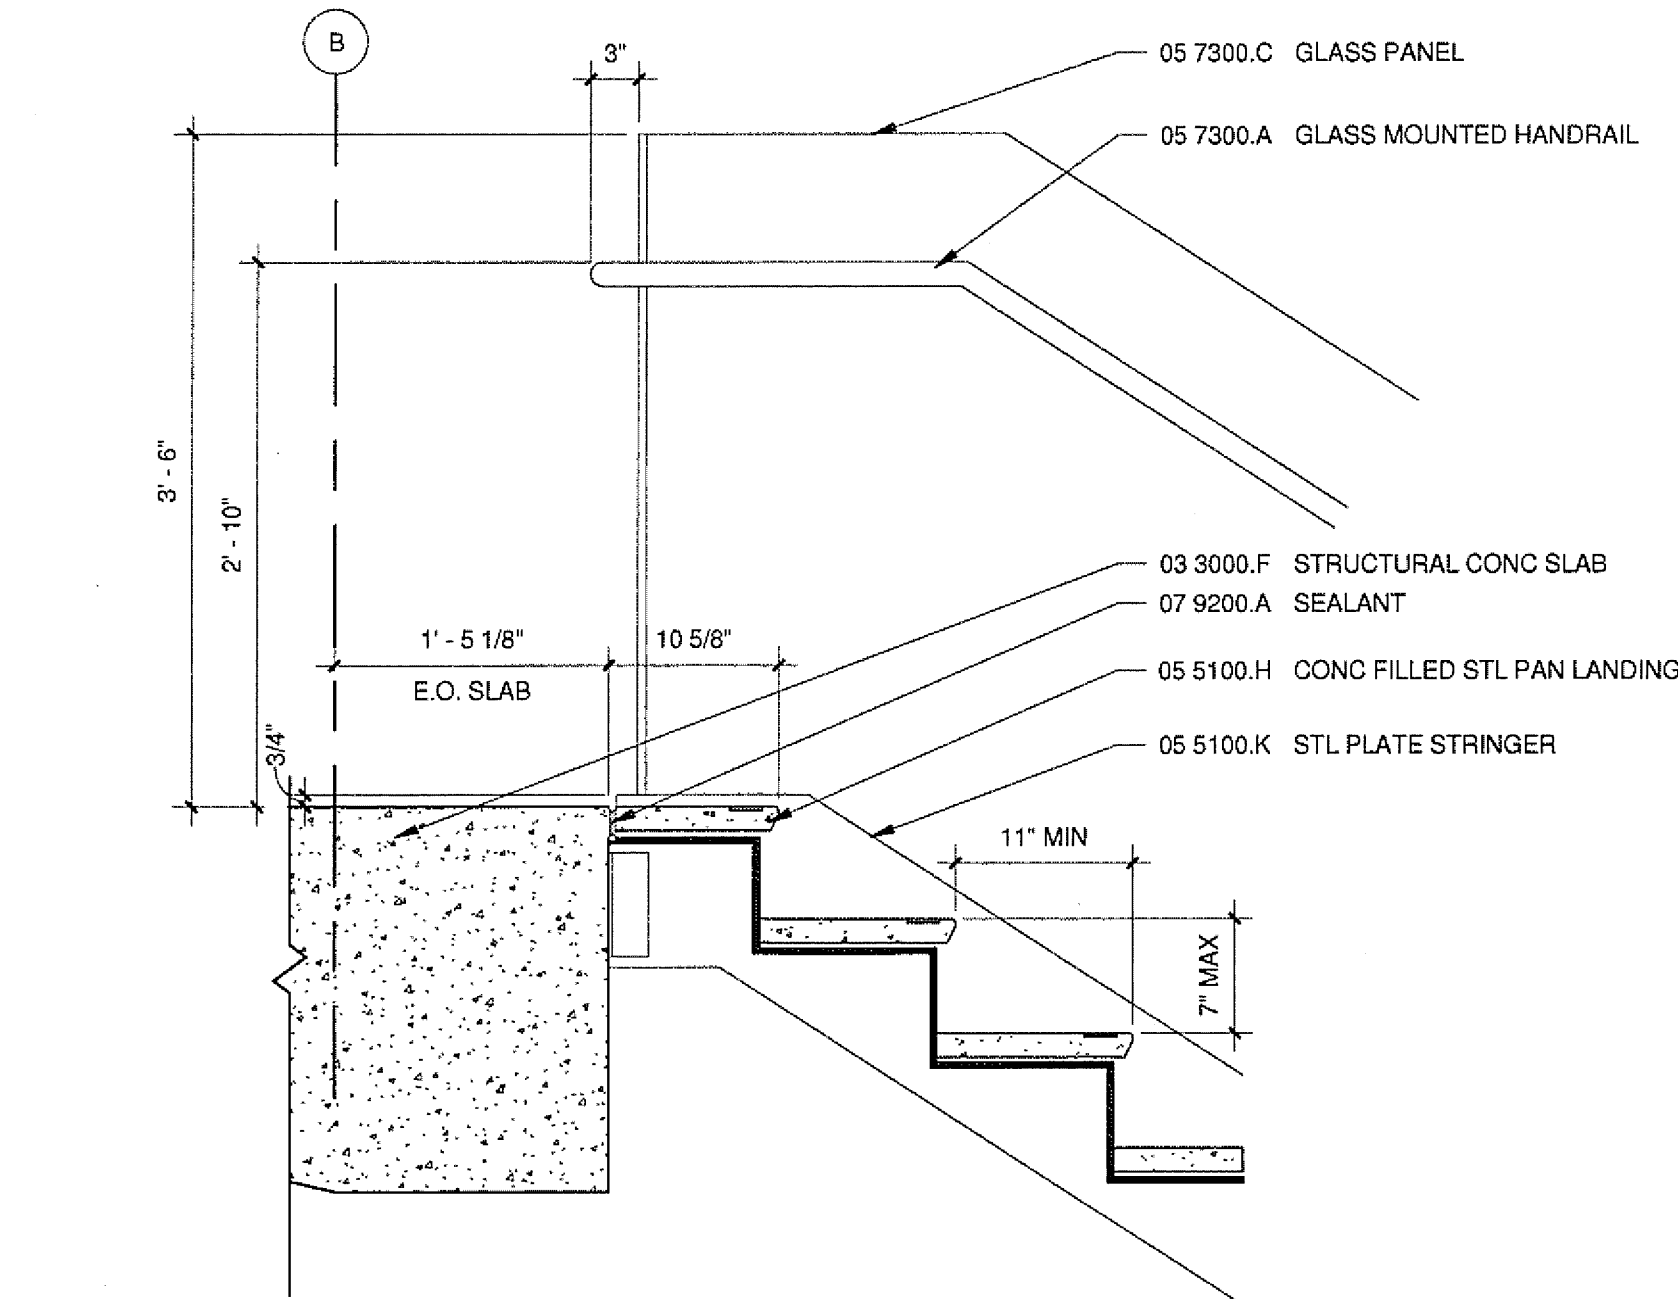


10 LANDING SECTION AT HEAD  
A2801|A9302 1" = 1'-0"

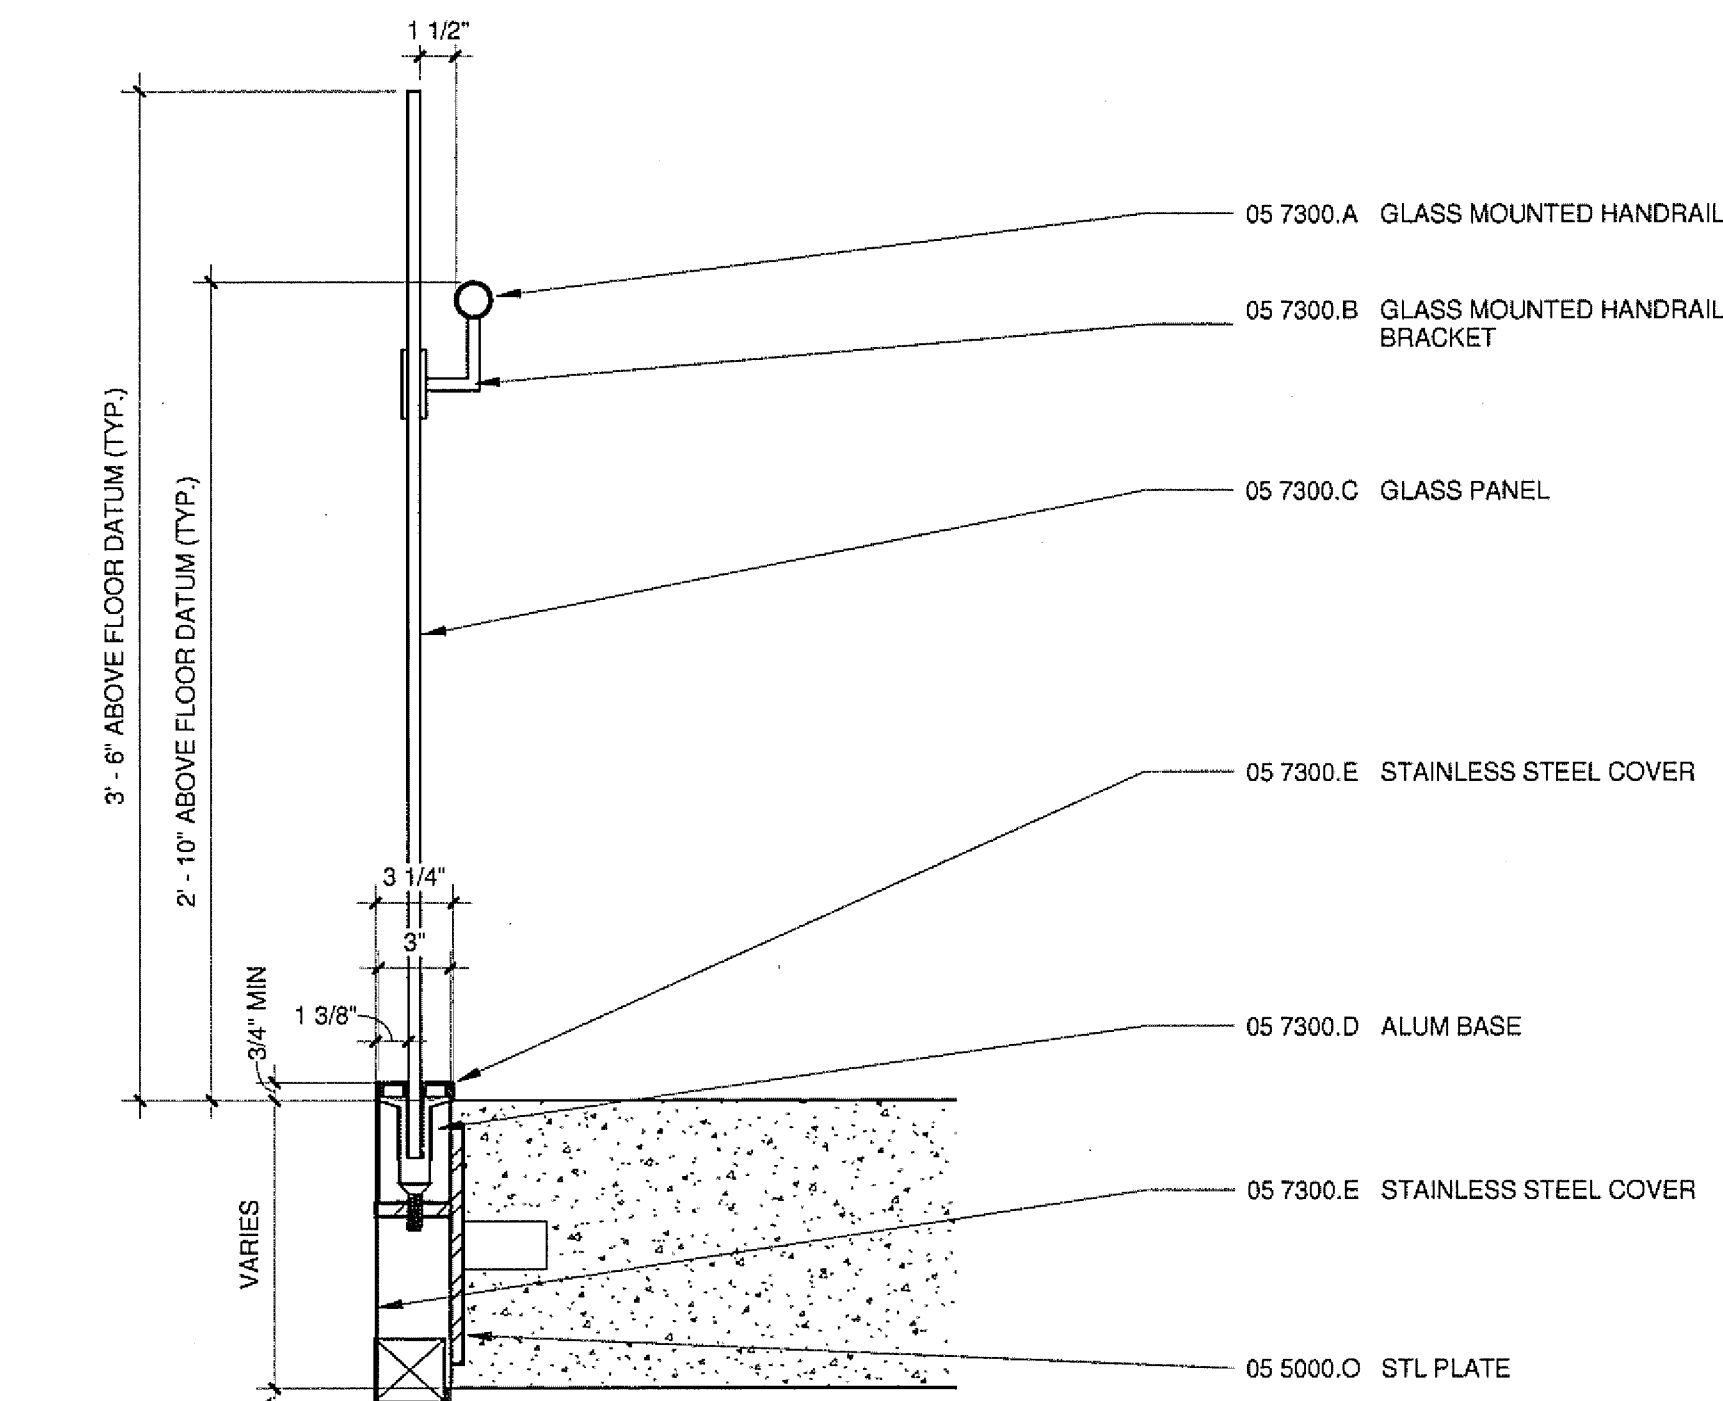


11 GLASS GUARDRAIL @ E.O. CONC.  
A2801|A9302 1 1/2" = 1'-0"


12 LANDING @ COMPOSITE PANEL  
A2801|A9302 1 1/2" = 1'-0"

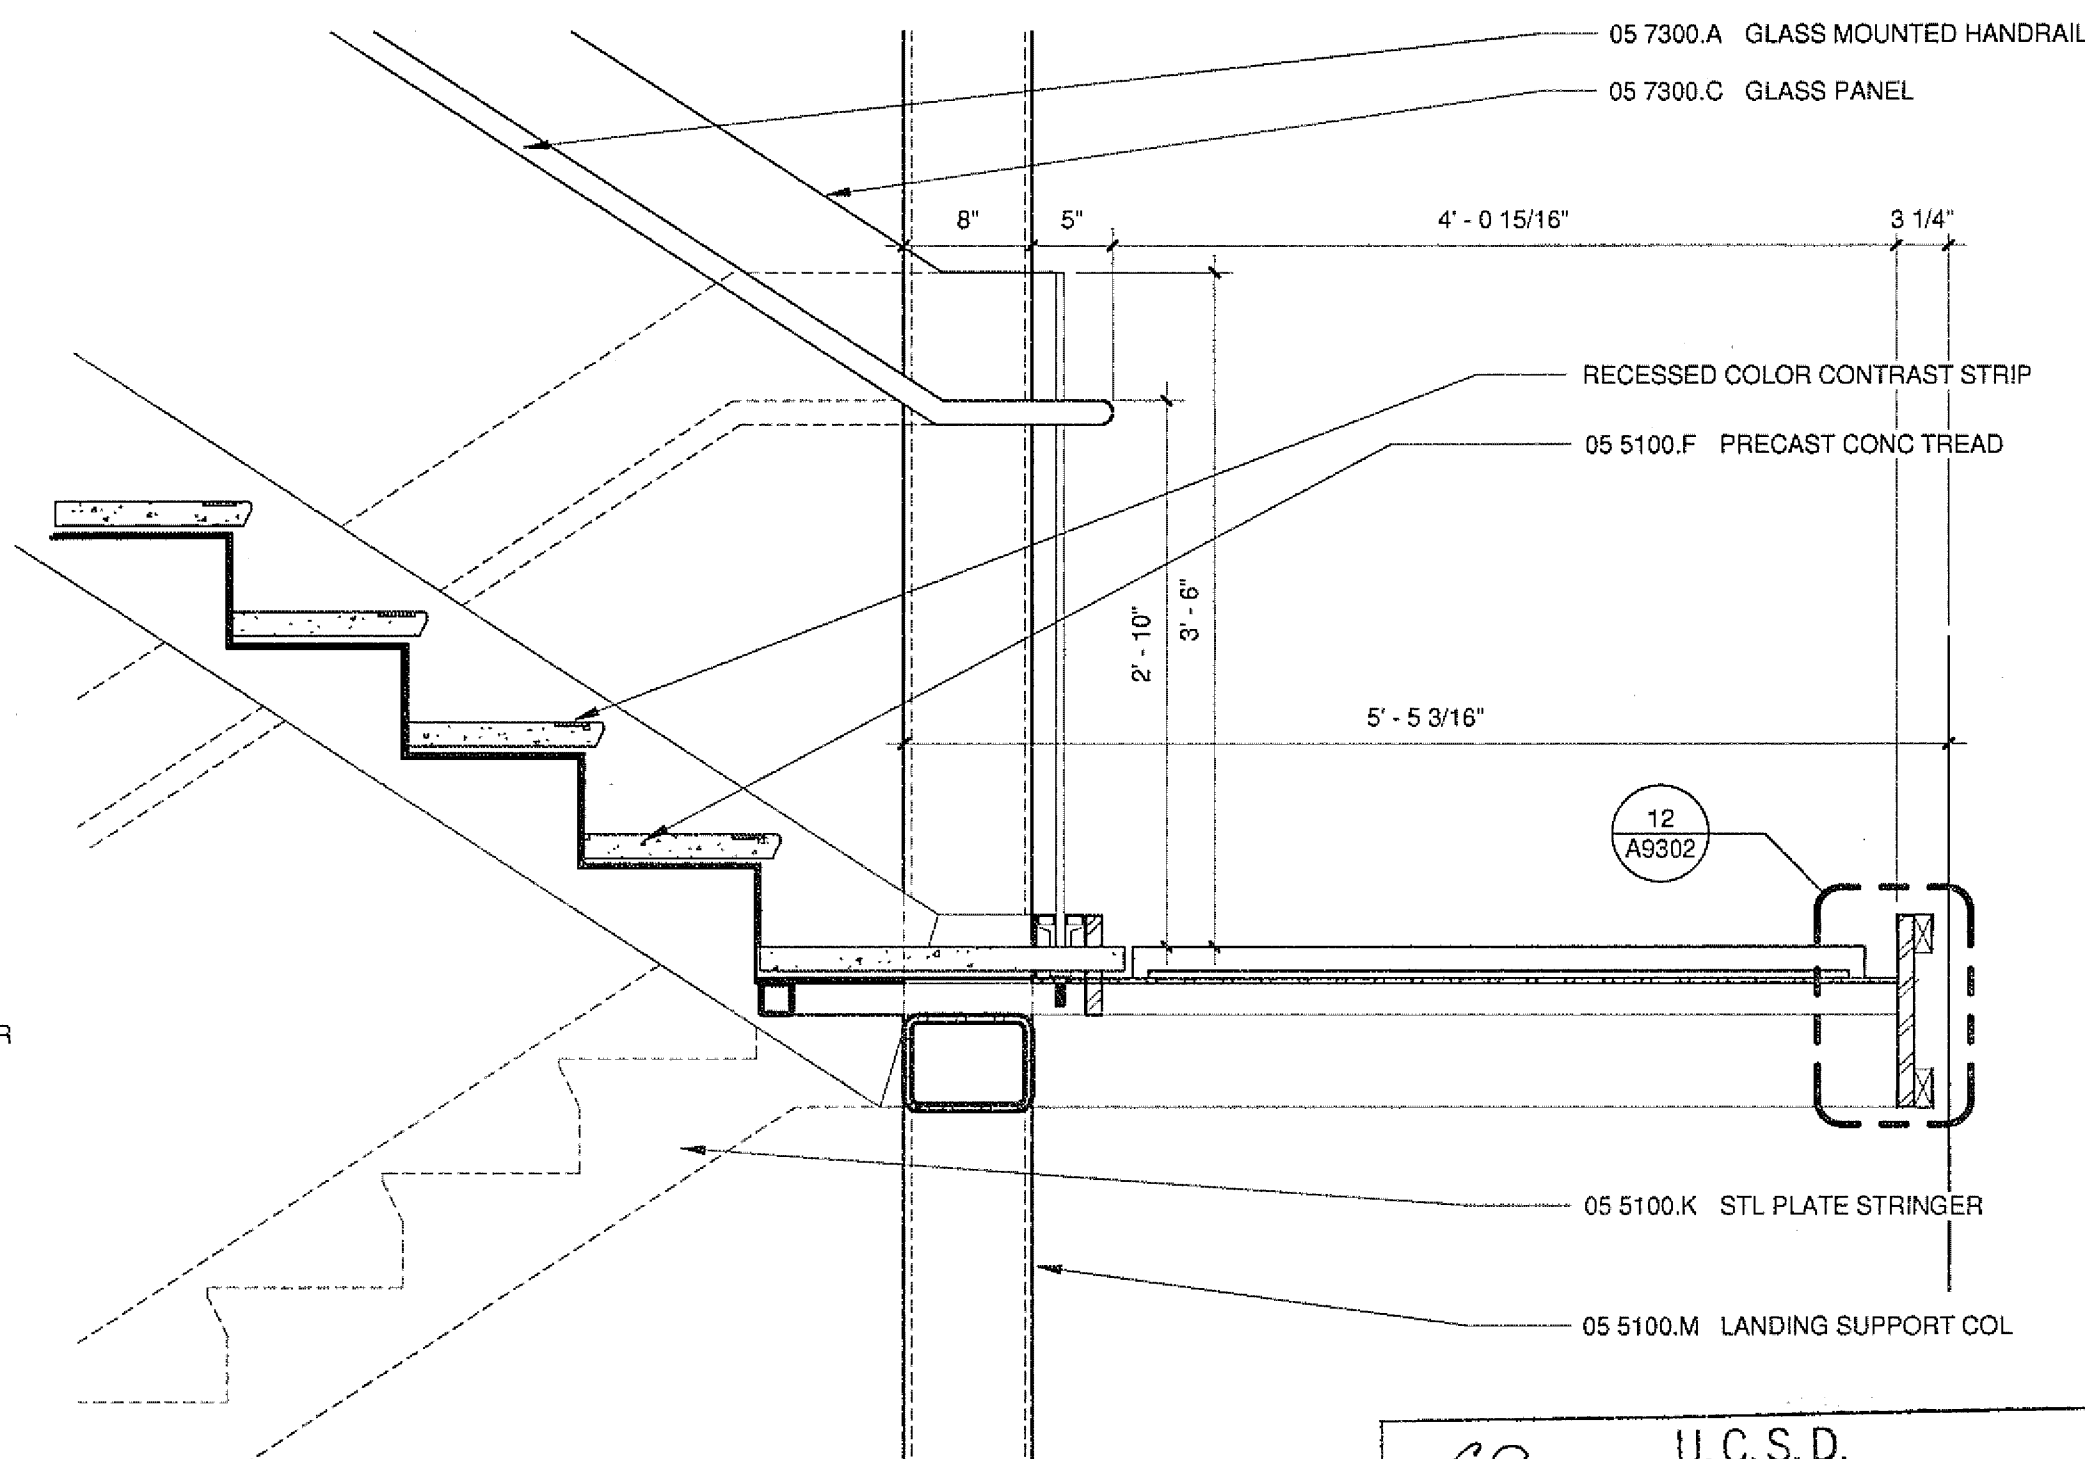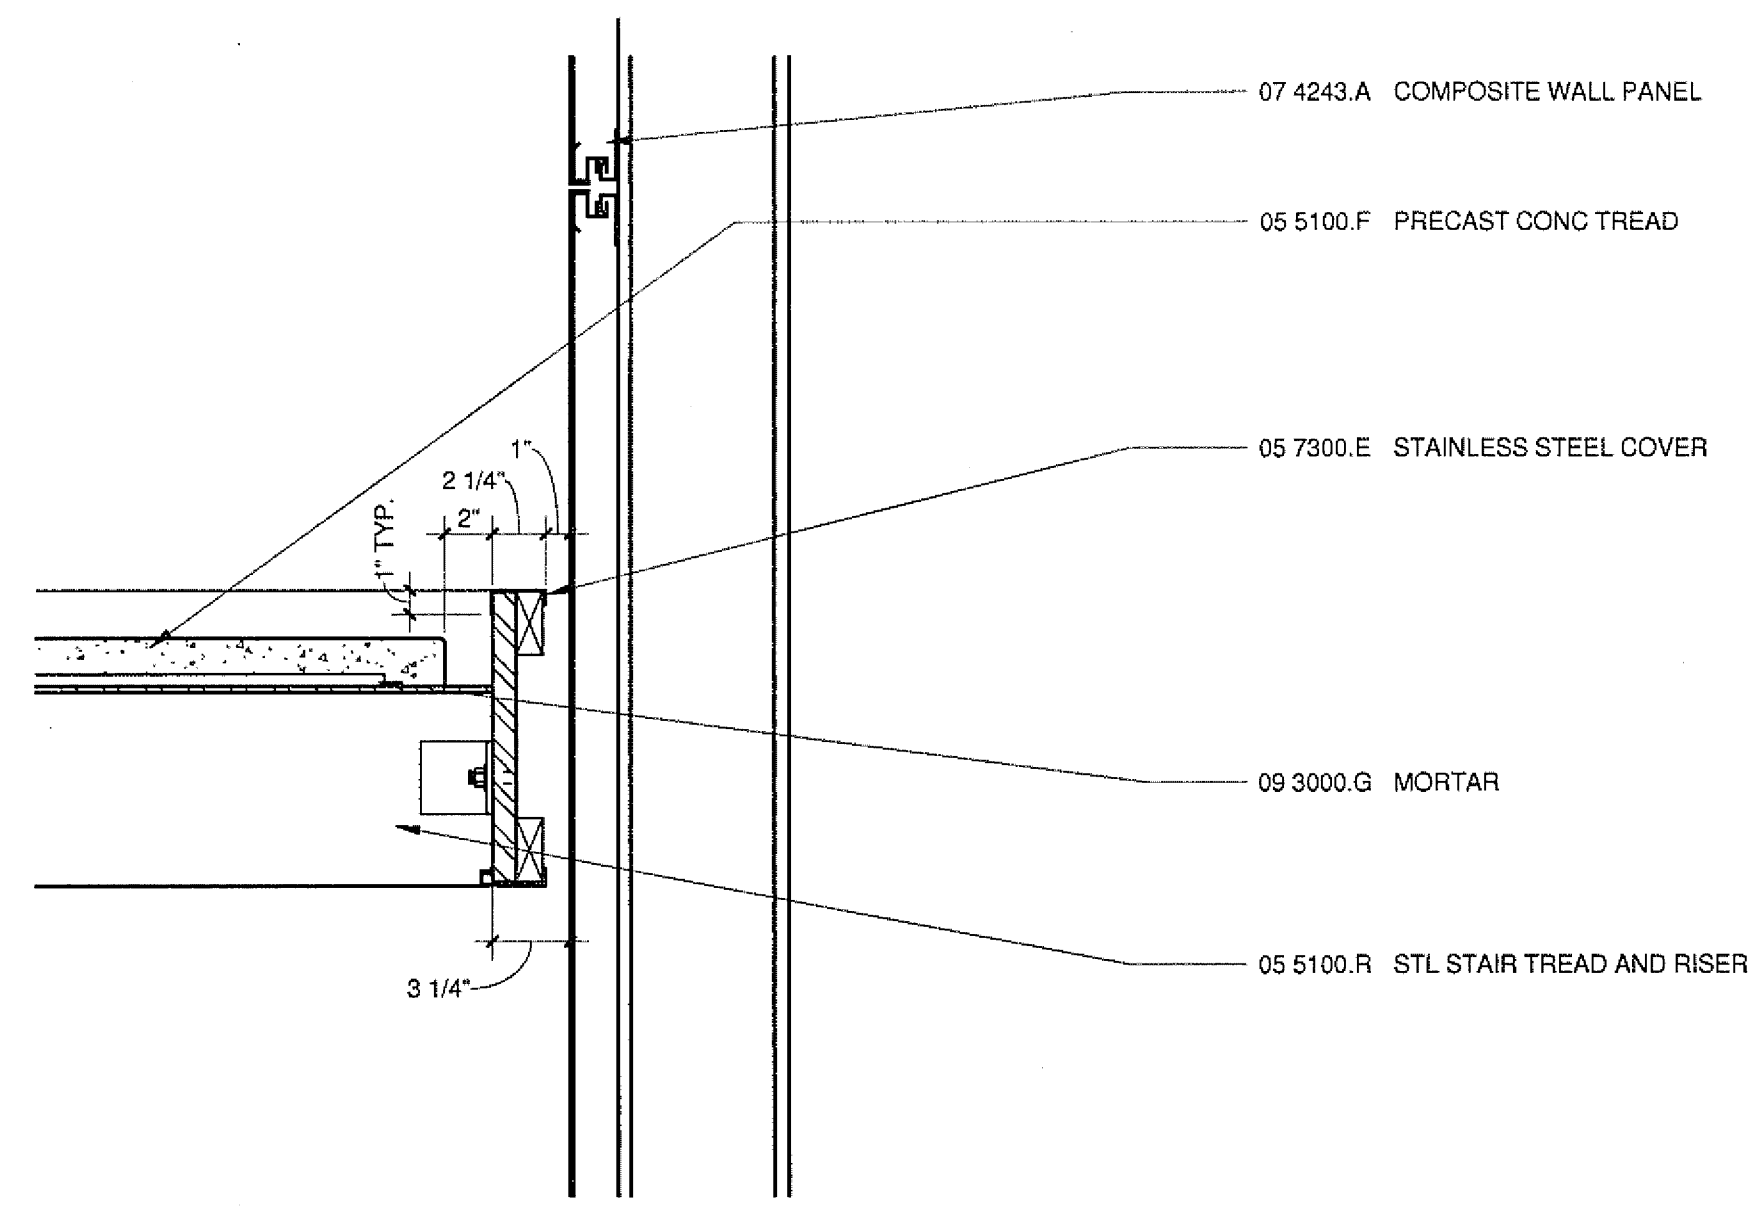

5 STAIR 4 LANDING SECTION  
A2801|A9302 1" = 1'-0"


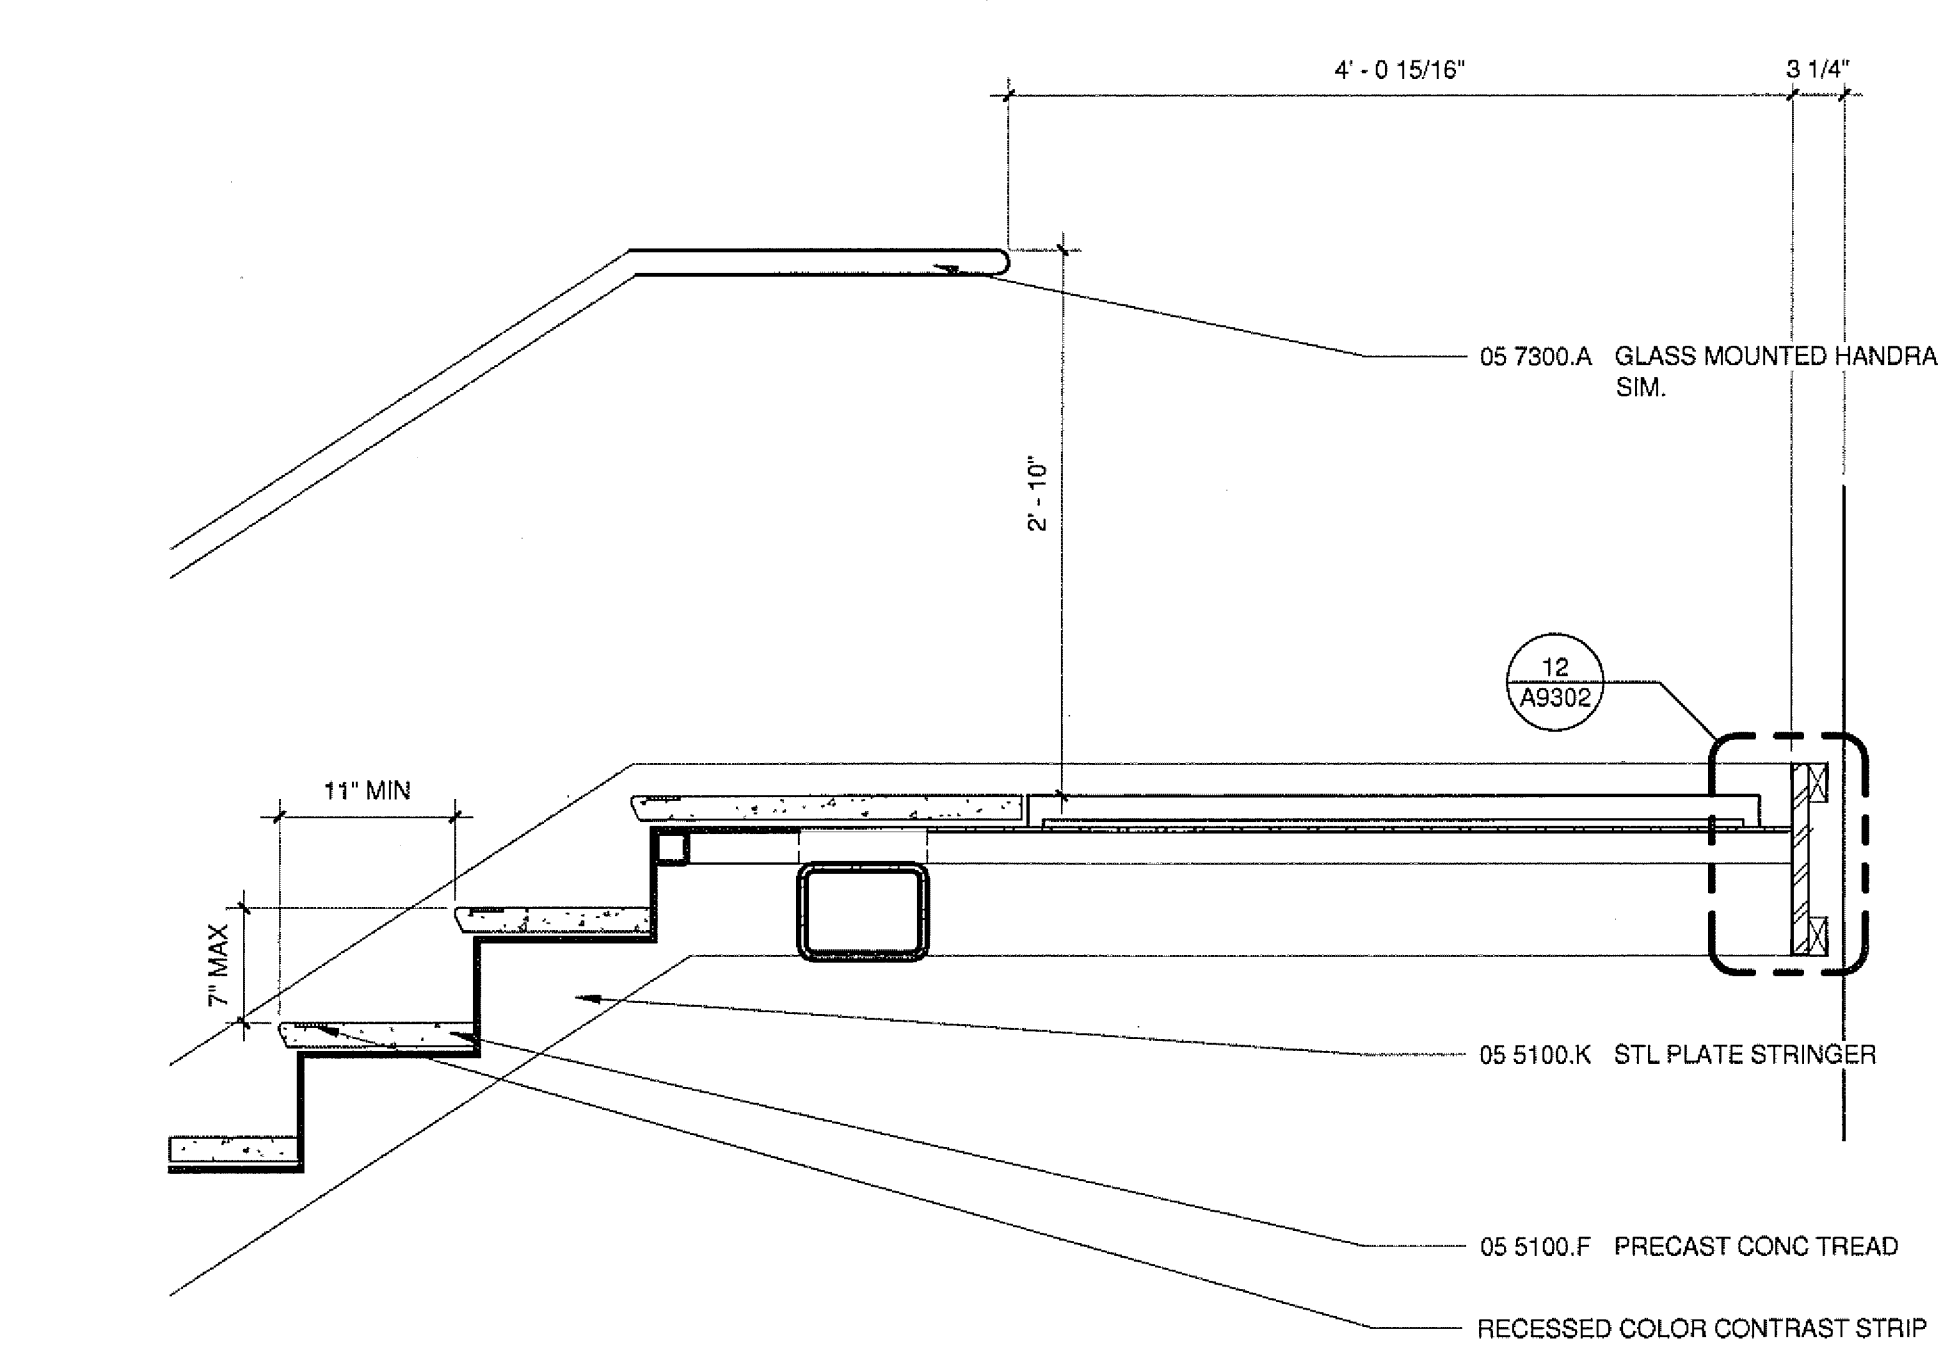


6 STAIR 4 LANDING SECTION-NORTH  
A2801|A9302 1" = 1'-0"

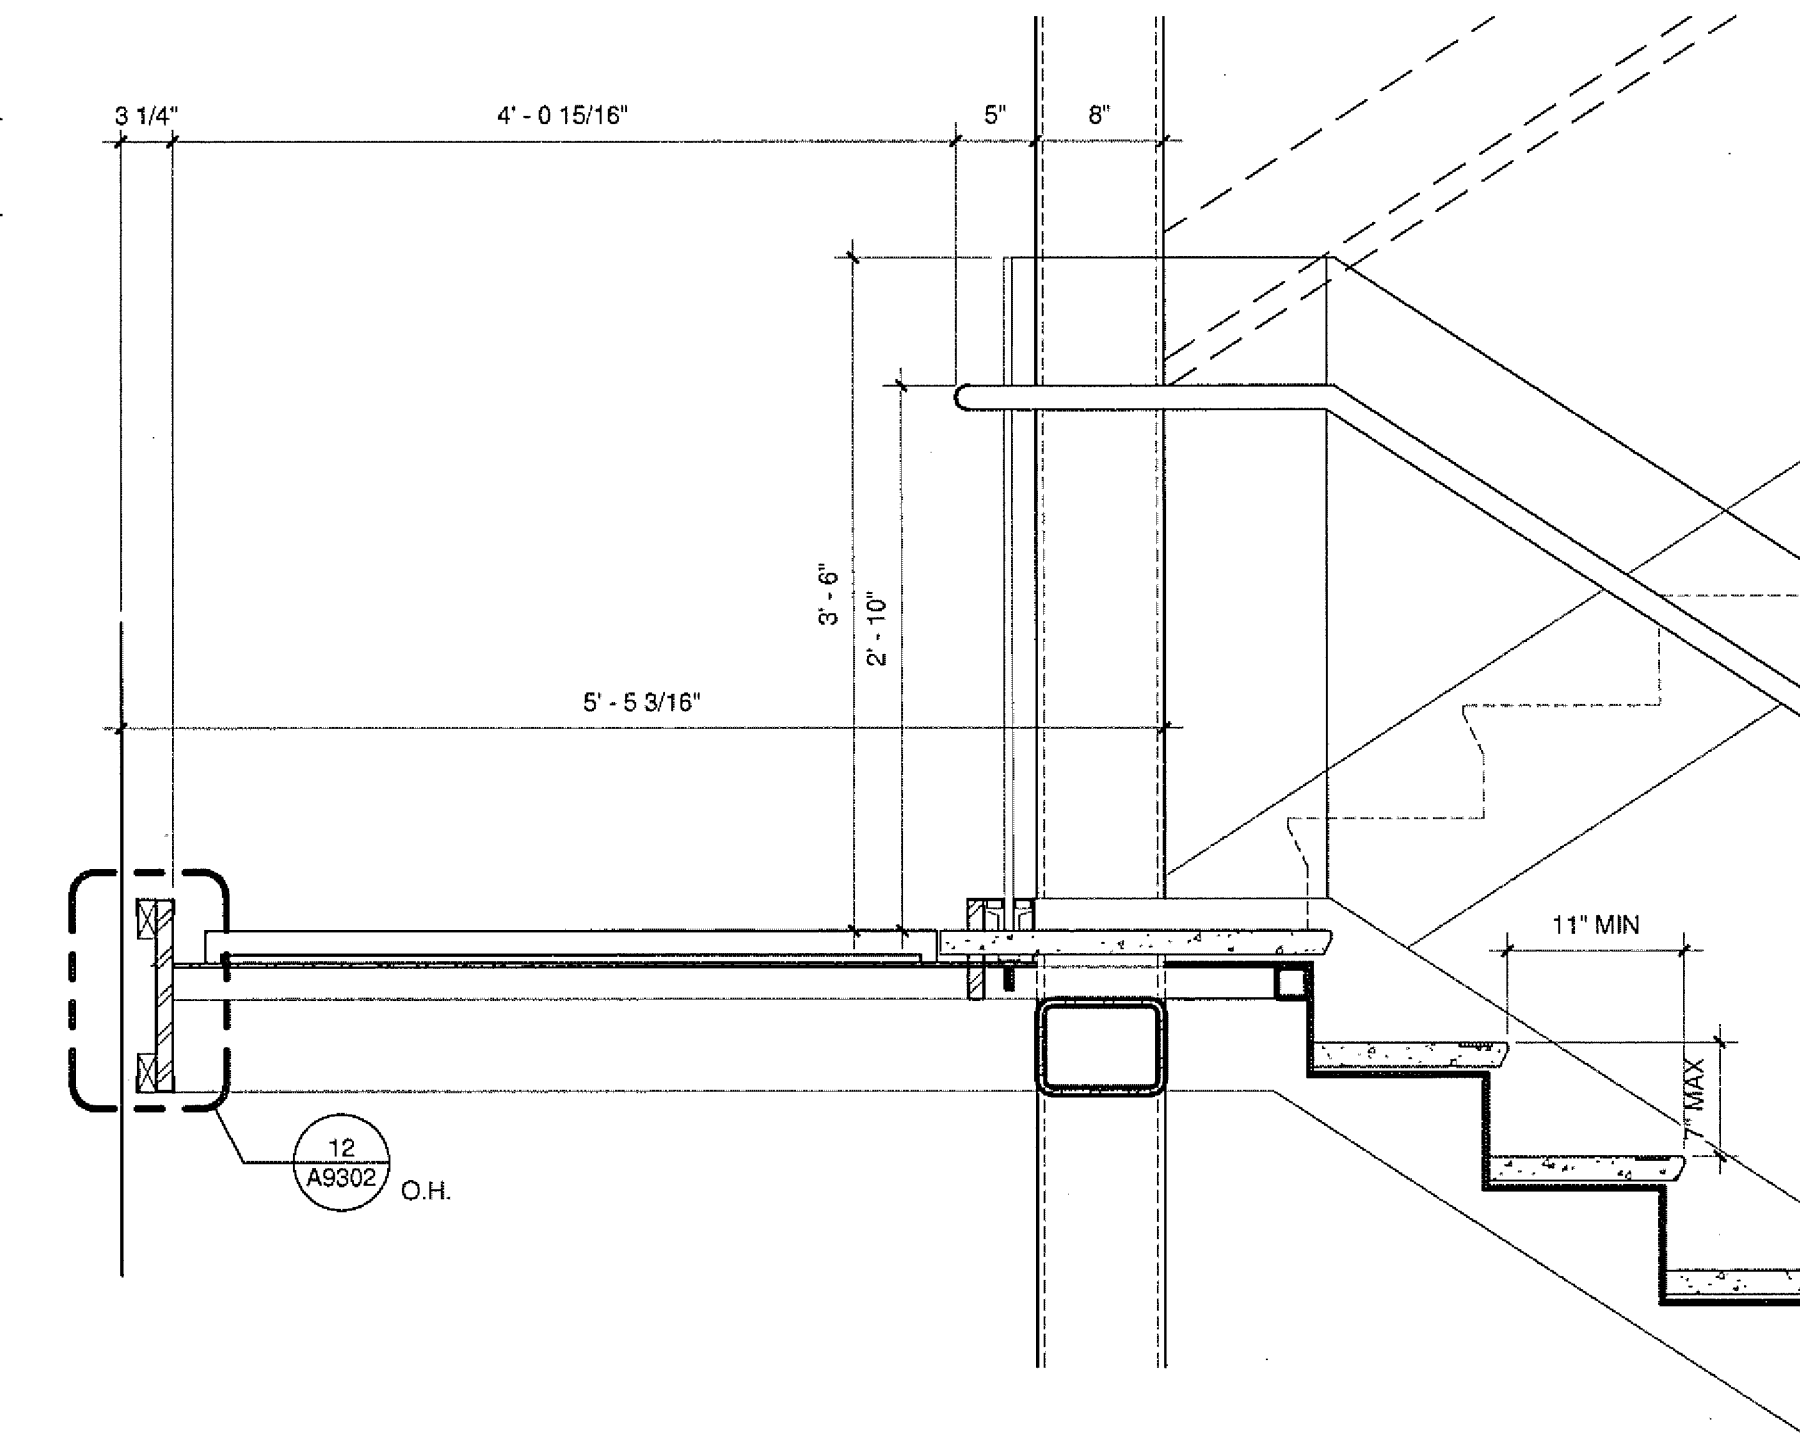


7 STAIR 4 LANDING SECTION - SOUTH  
A2801|A9302 1" = 1'-0"


8 STAIR LANDING @ STOREFRONT  
A9302|A9302 3" = 1'-0"

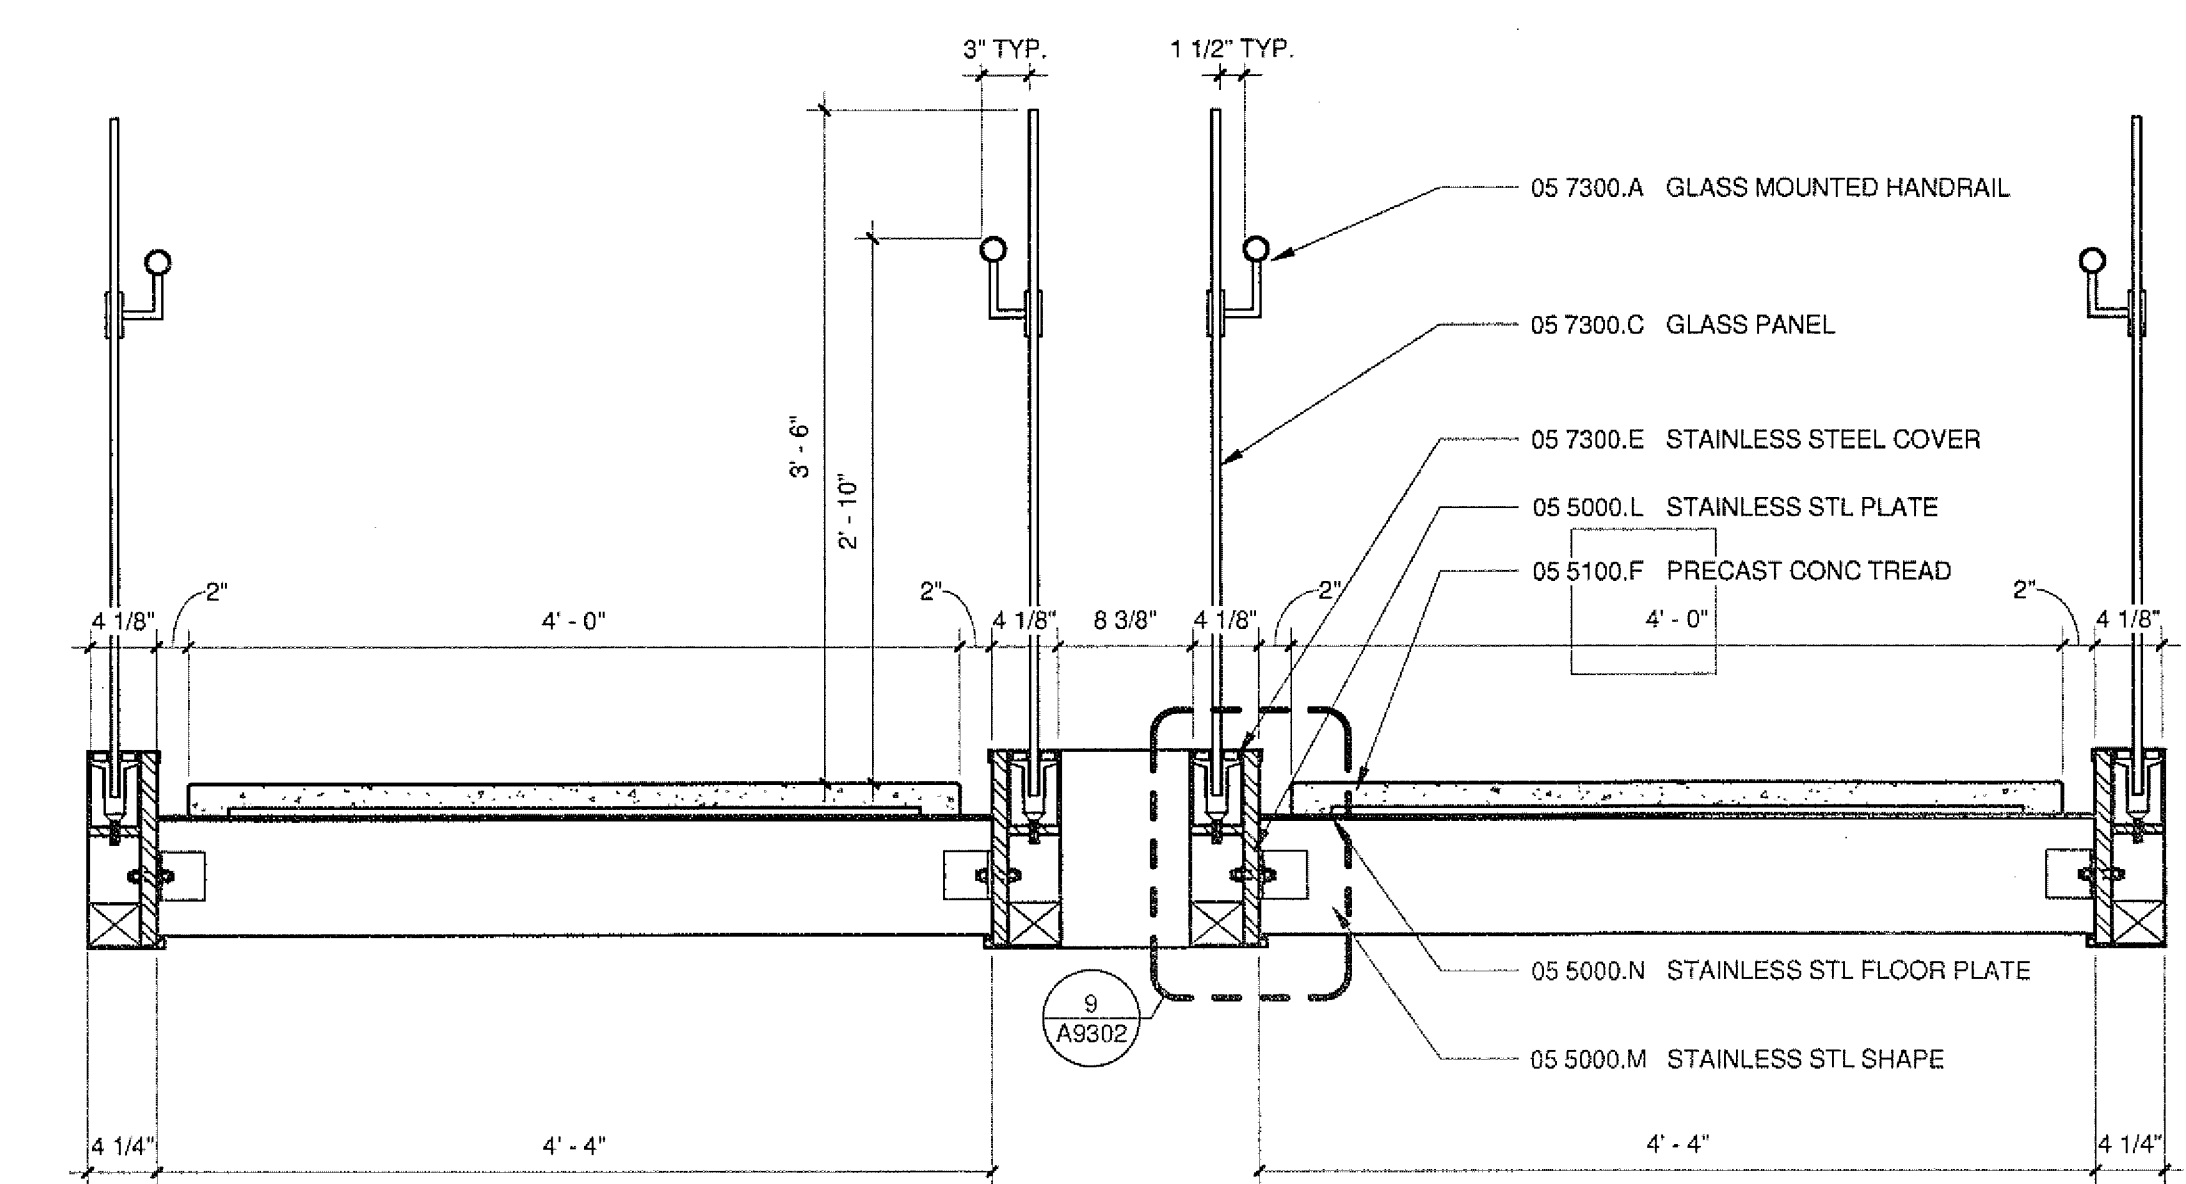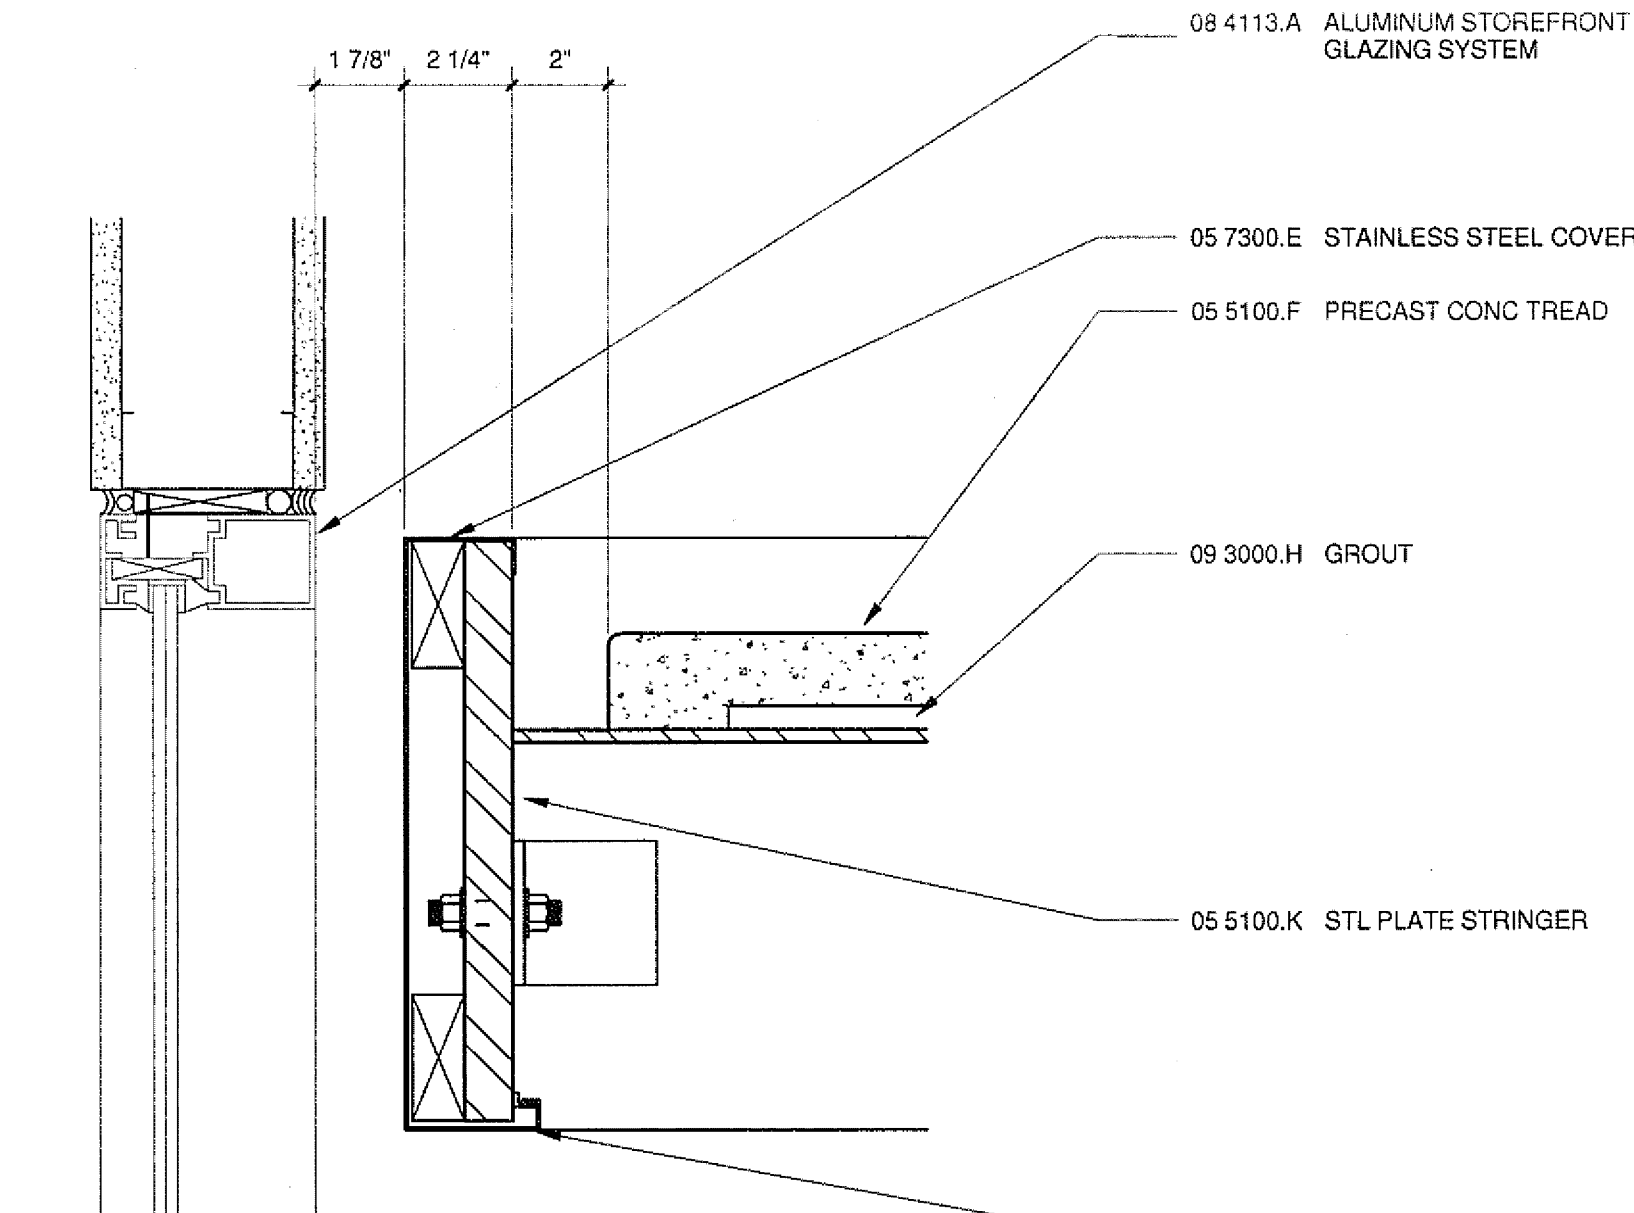


1 STAIR 1 LANDING SECTION DETAIL  
A9303|A9302 1" = 1'-0"

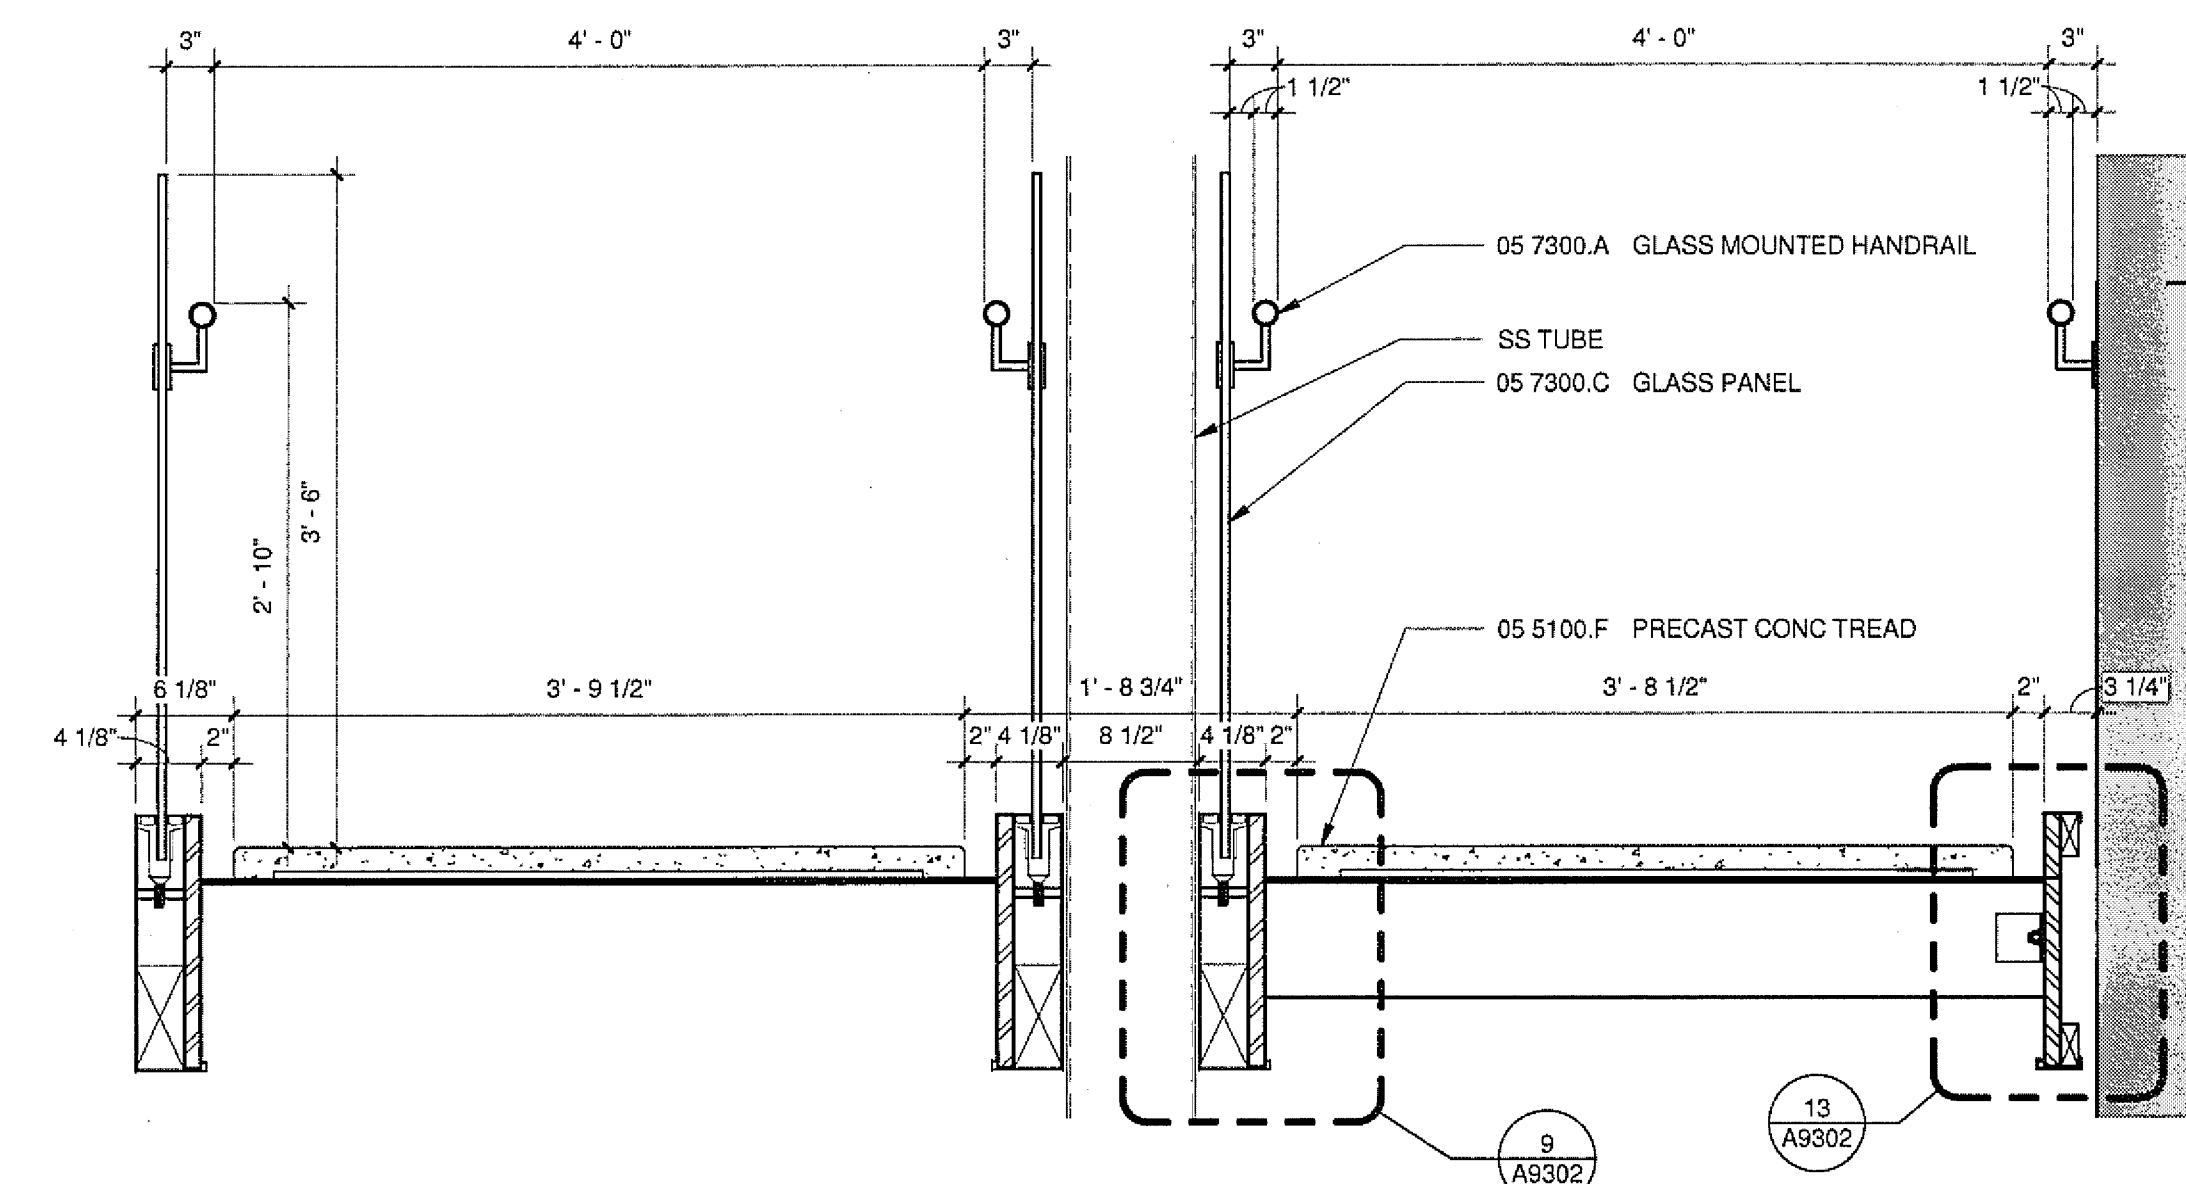

2 STAIR 4 LANDING SECTION DETAIL  
A9303|A9302 1" = 1'-0"

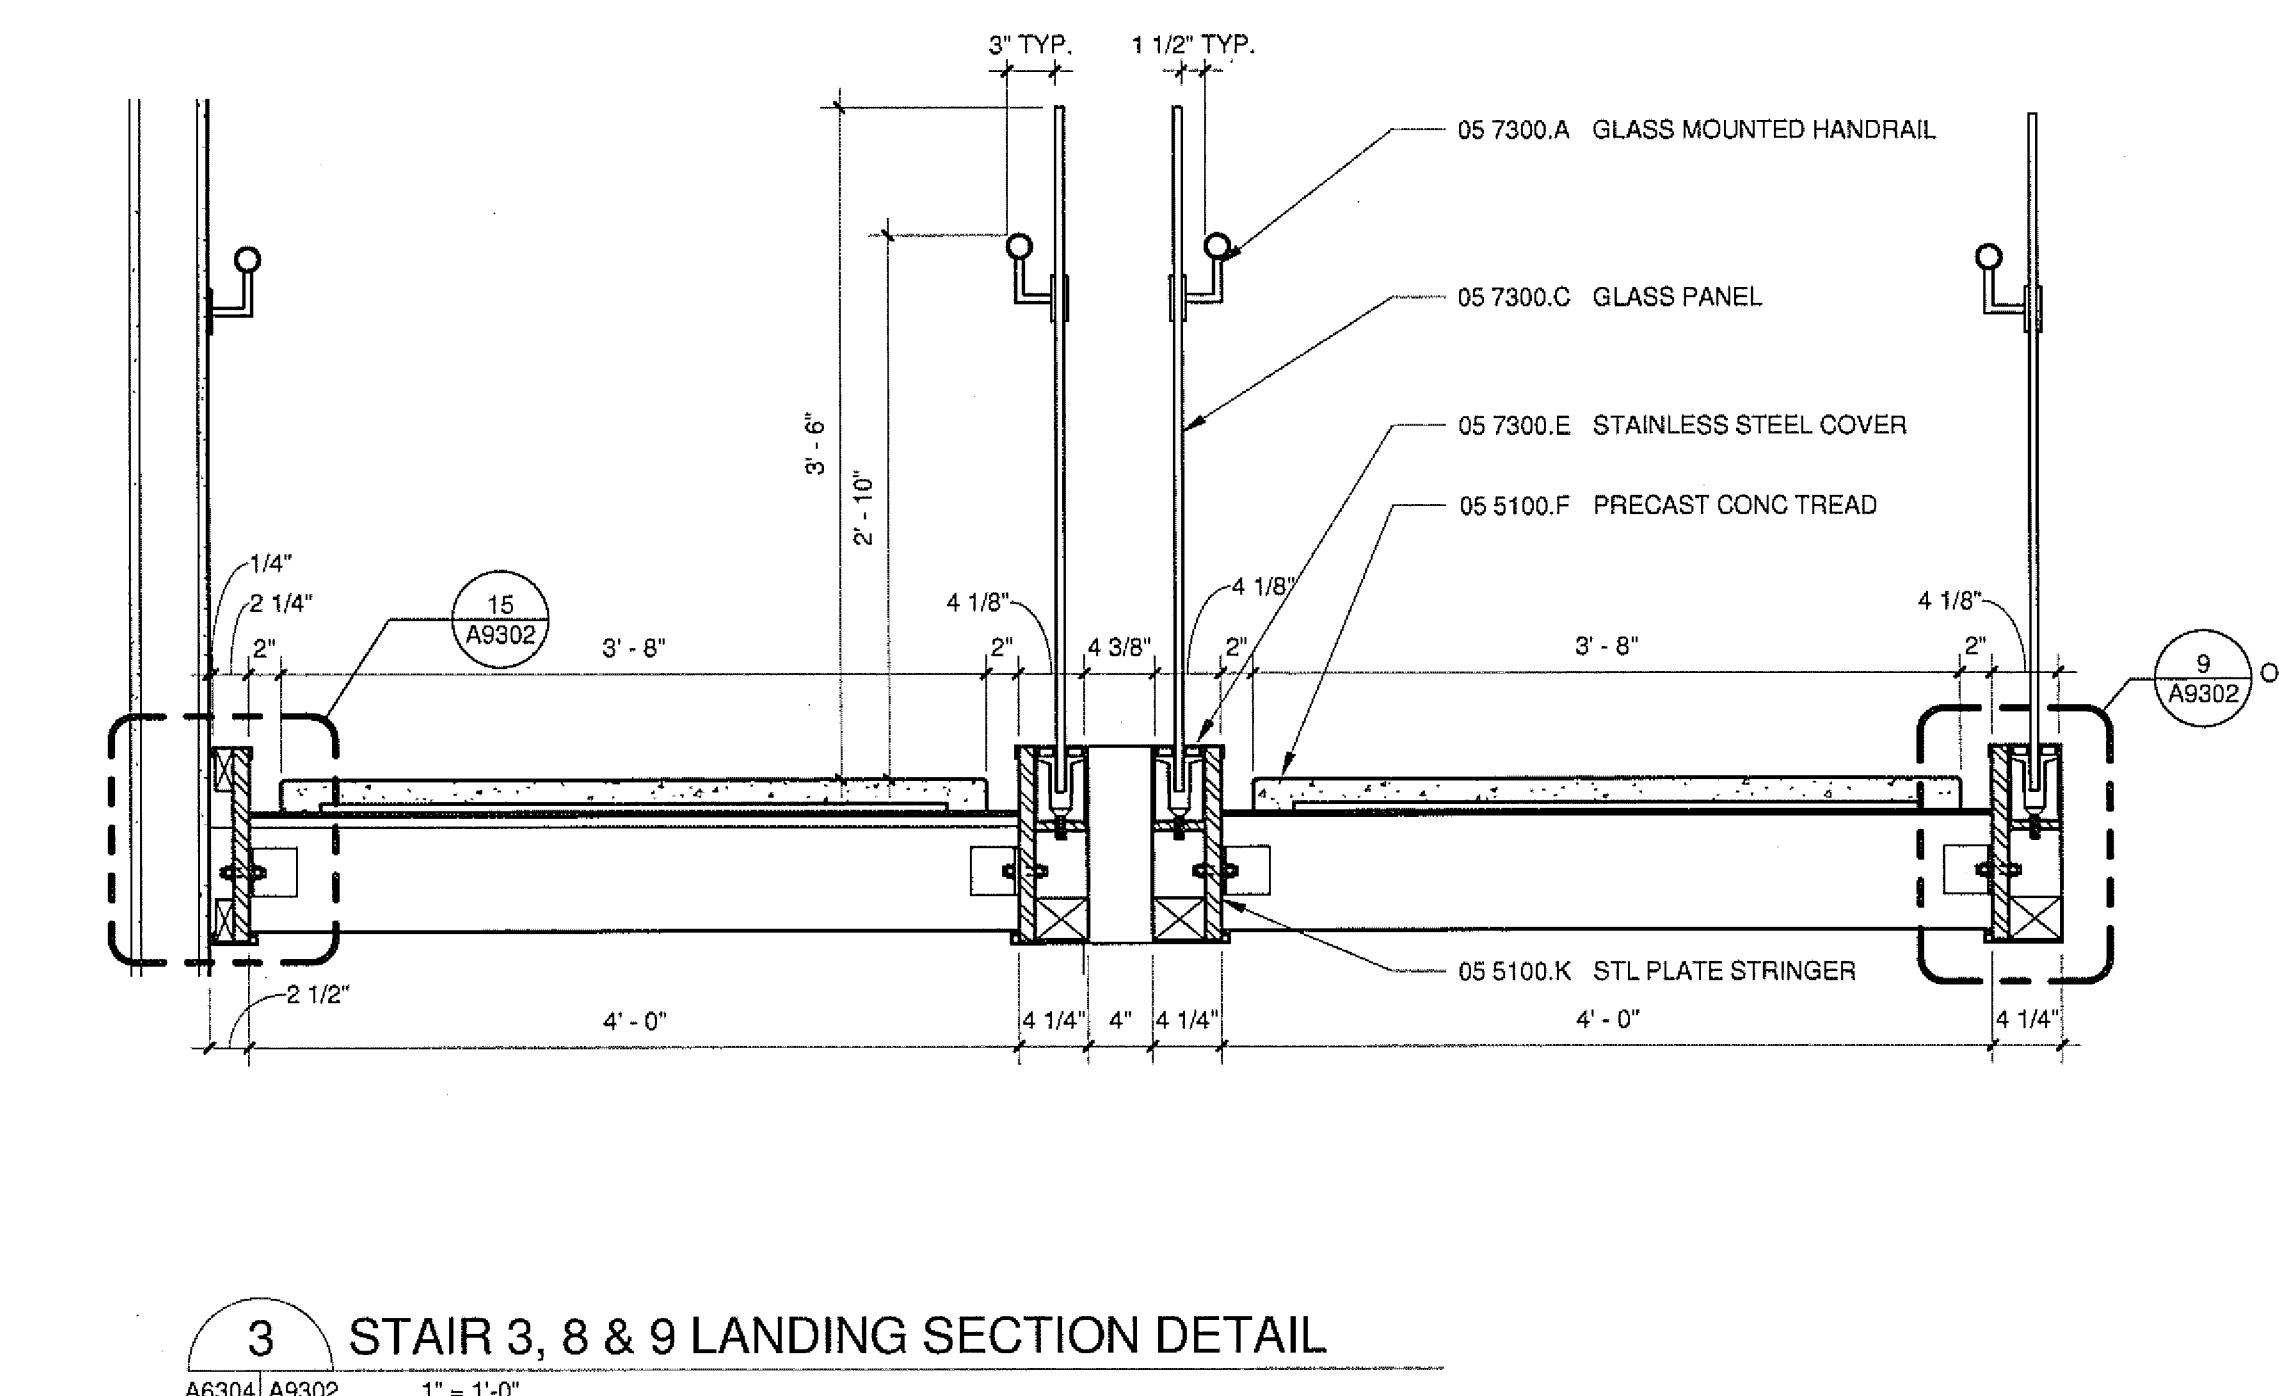


3 STAIR 3, 8 & 9 LANDING SECTION DETAIL  
A9304|A9302 1" = 1'-0"

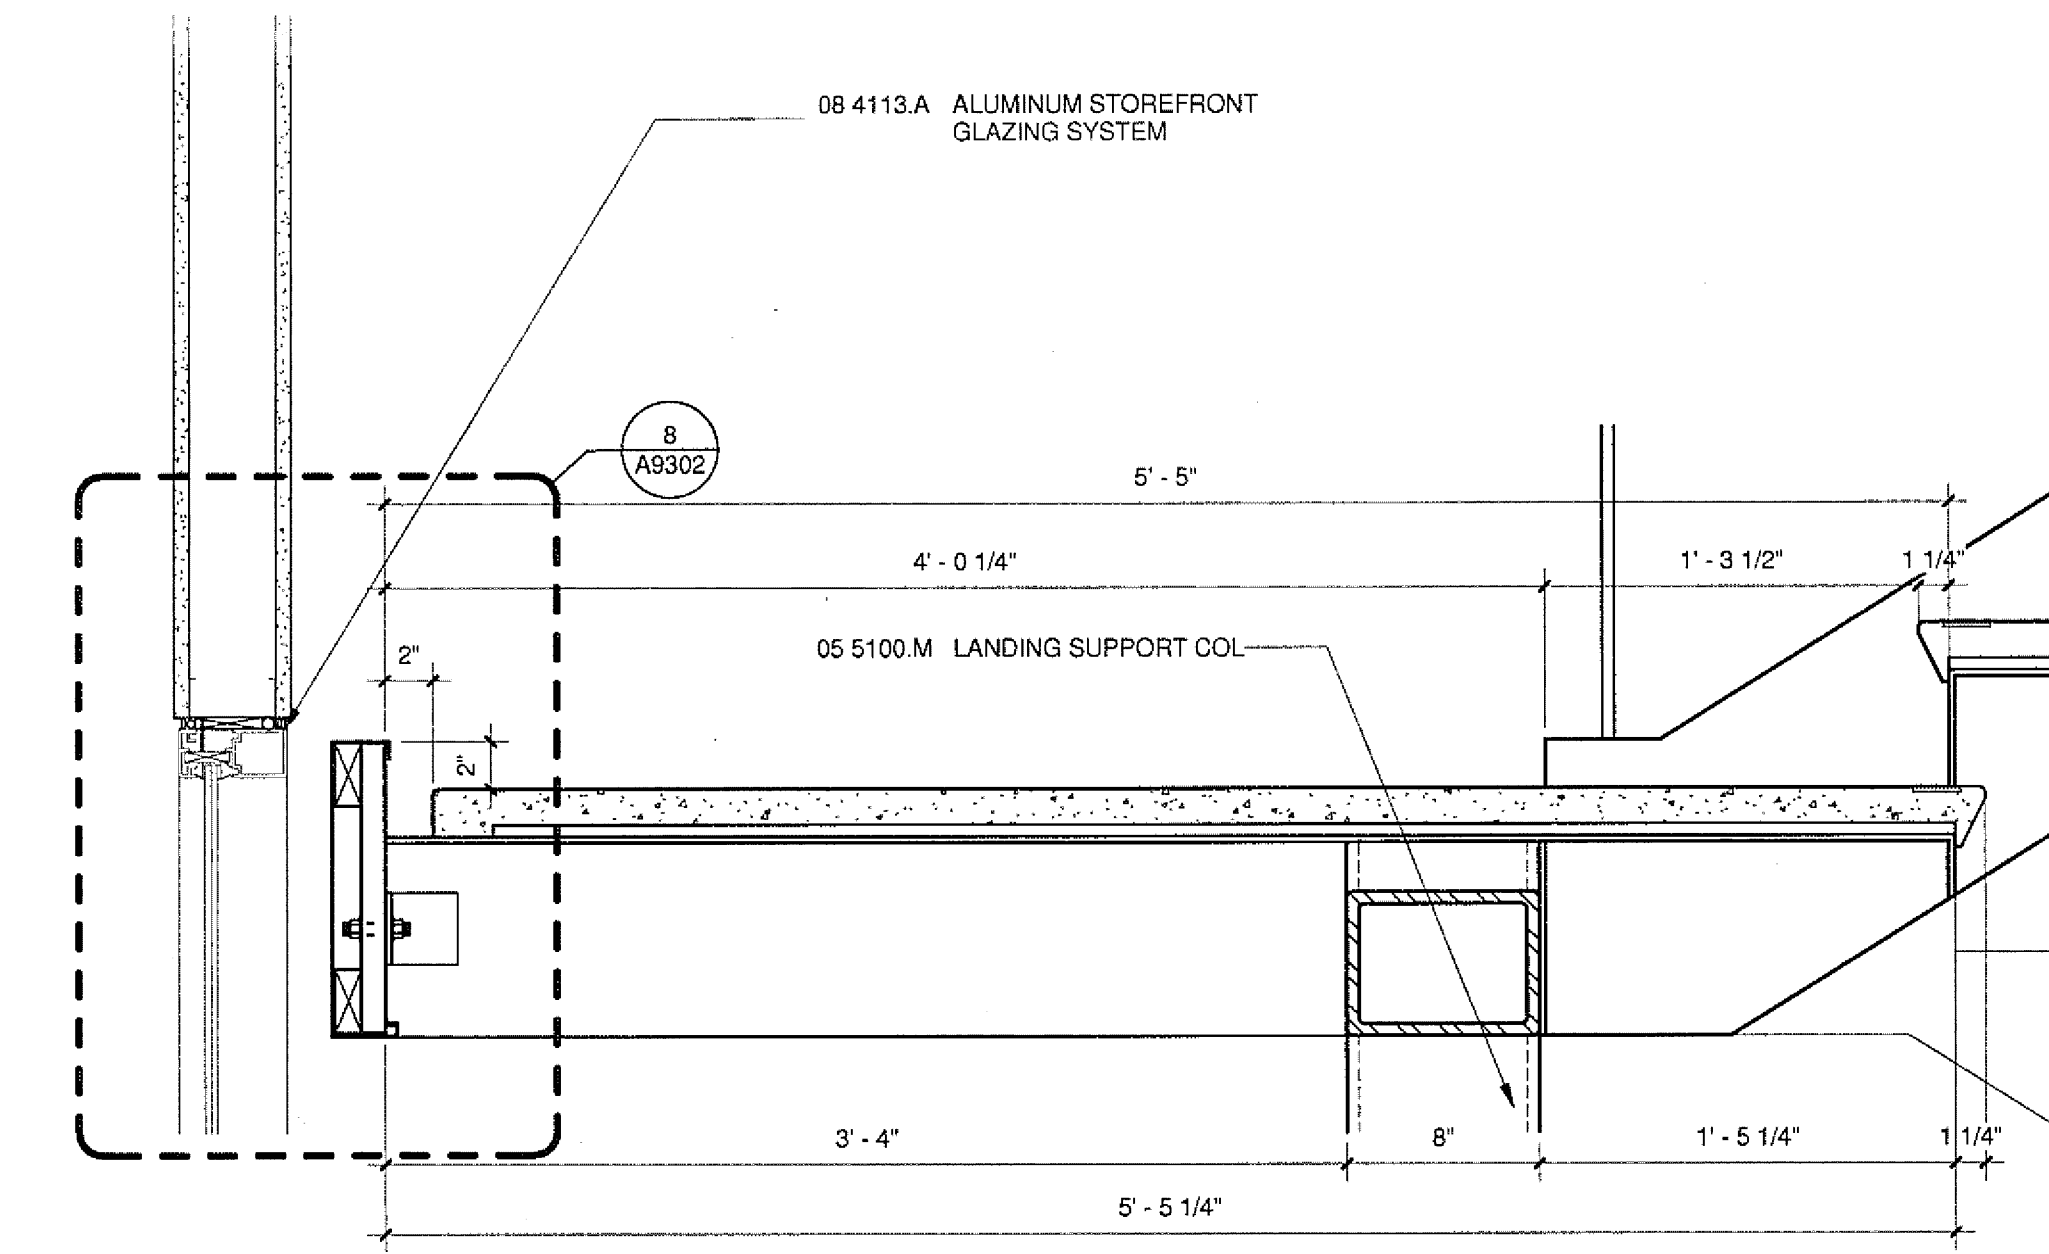

4 BREAKROOM LANDING SECTION  
A9304|A9302 1 1/2" = 1'-0"

FOR ALL STAINLESS STEEL EXTERIOR STAIRS:  
1/2" DIA. PRE-PLACED WEEP HOLES @ STL TREAD, 6 PER TREAD, TYP.  
1/2" DIA. PRE-PLACED WEEP HOLES @ STL LANDING, TYP.

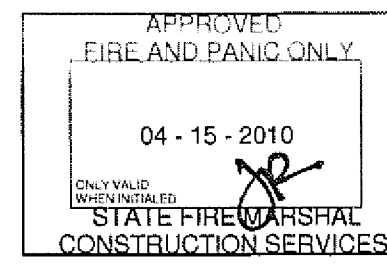

| ISSUED FOR       | DATE     |
|------------------|----------|
| BID PK #1 80 CD  | 12.01.08 |
| BID PK #1 100 CD | 02.16.09 |
| CD 3 CYCLE 1     | 02.20.09 |
| BID PK #2 100 CD | 03.29.09 |
| 100% CD          | 05.08.09 |
| ADA REVIEW       | 08.26.09 |
| CD-3             | 01.07.10 |
| RFI 0056         | 02.02.10 |

SANFORD CONSORTIUM FOR REGENERATIVE MEDICINE

2880 TORREY PINES SCENIC DRIVE  
LA JOLLA, CALIFORNIA 92037



CONSULTANT

LarkspurPharos Consortium, LLC  
401 Broadway, Suite 1000, San Francisco, CA 94111  
(415) 774-0000

FENTRESS | ARCHITECTS  
401 Broadway, Suite 1000, San Francisco, CA 94111  
(415) 774-0000

DAVID DAVIS  
ARCHITECTS  
3000 16th Avenue, Suite 200, San Francisco, CA 94111  
(415) 774-0000

STAMP  
LICENSED ARCHITECT  
Jeffrey W. Olson  
No. C-33761  
Exp. 03/31/11  
STATE OF CALIFORNIA  
SHEET NAME  
STAIR DETAILS  
DRAWN BY: Author  
PROJECT # 200725.000  
SHEET NUMBER  
A9302