



4/15/2010 10:05:45 AM
C:\F\Arch\Projects\200725 SANFORD_Jones.DWG

Warning: It is a violation of the law for any person, unless acting under the direction of a licensed architect, to alter an item in any way. If an item in this document is altered, the altering architect, if other than the architect of record, shall affix the item his seal and the notation "altered by" followed by his signature and the date of such alteration, and the specific description of the alteration.

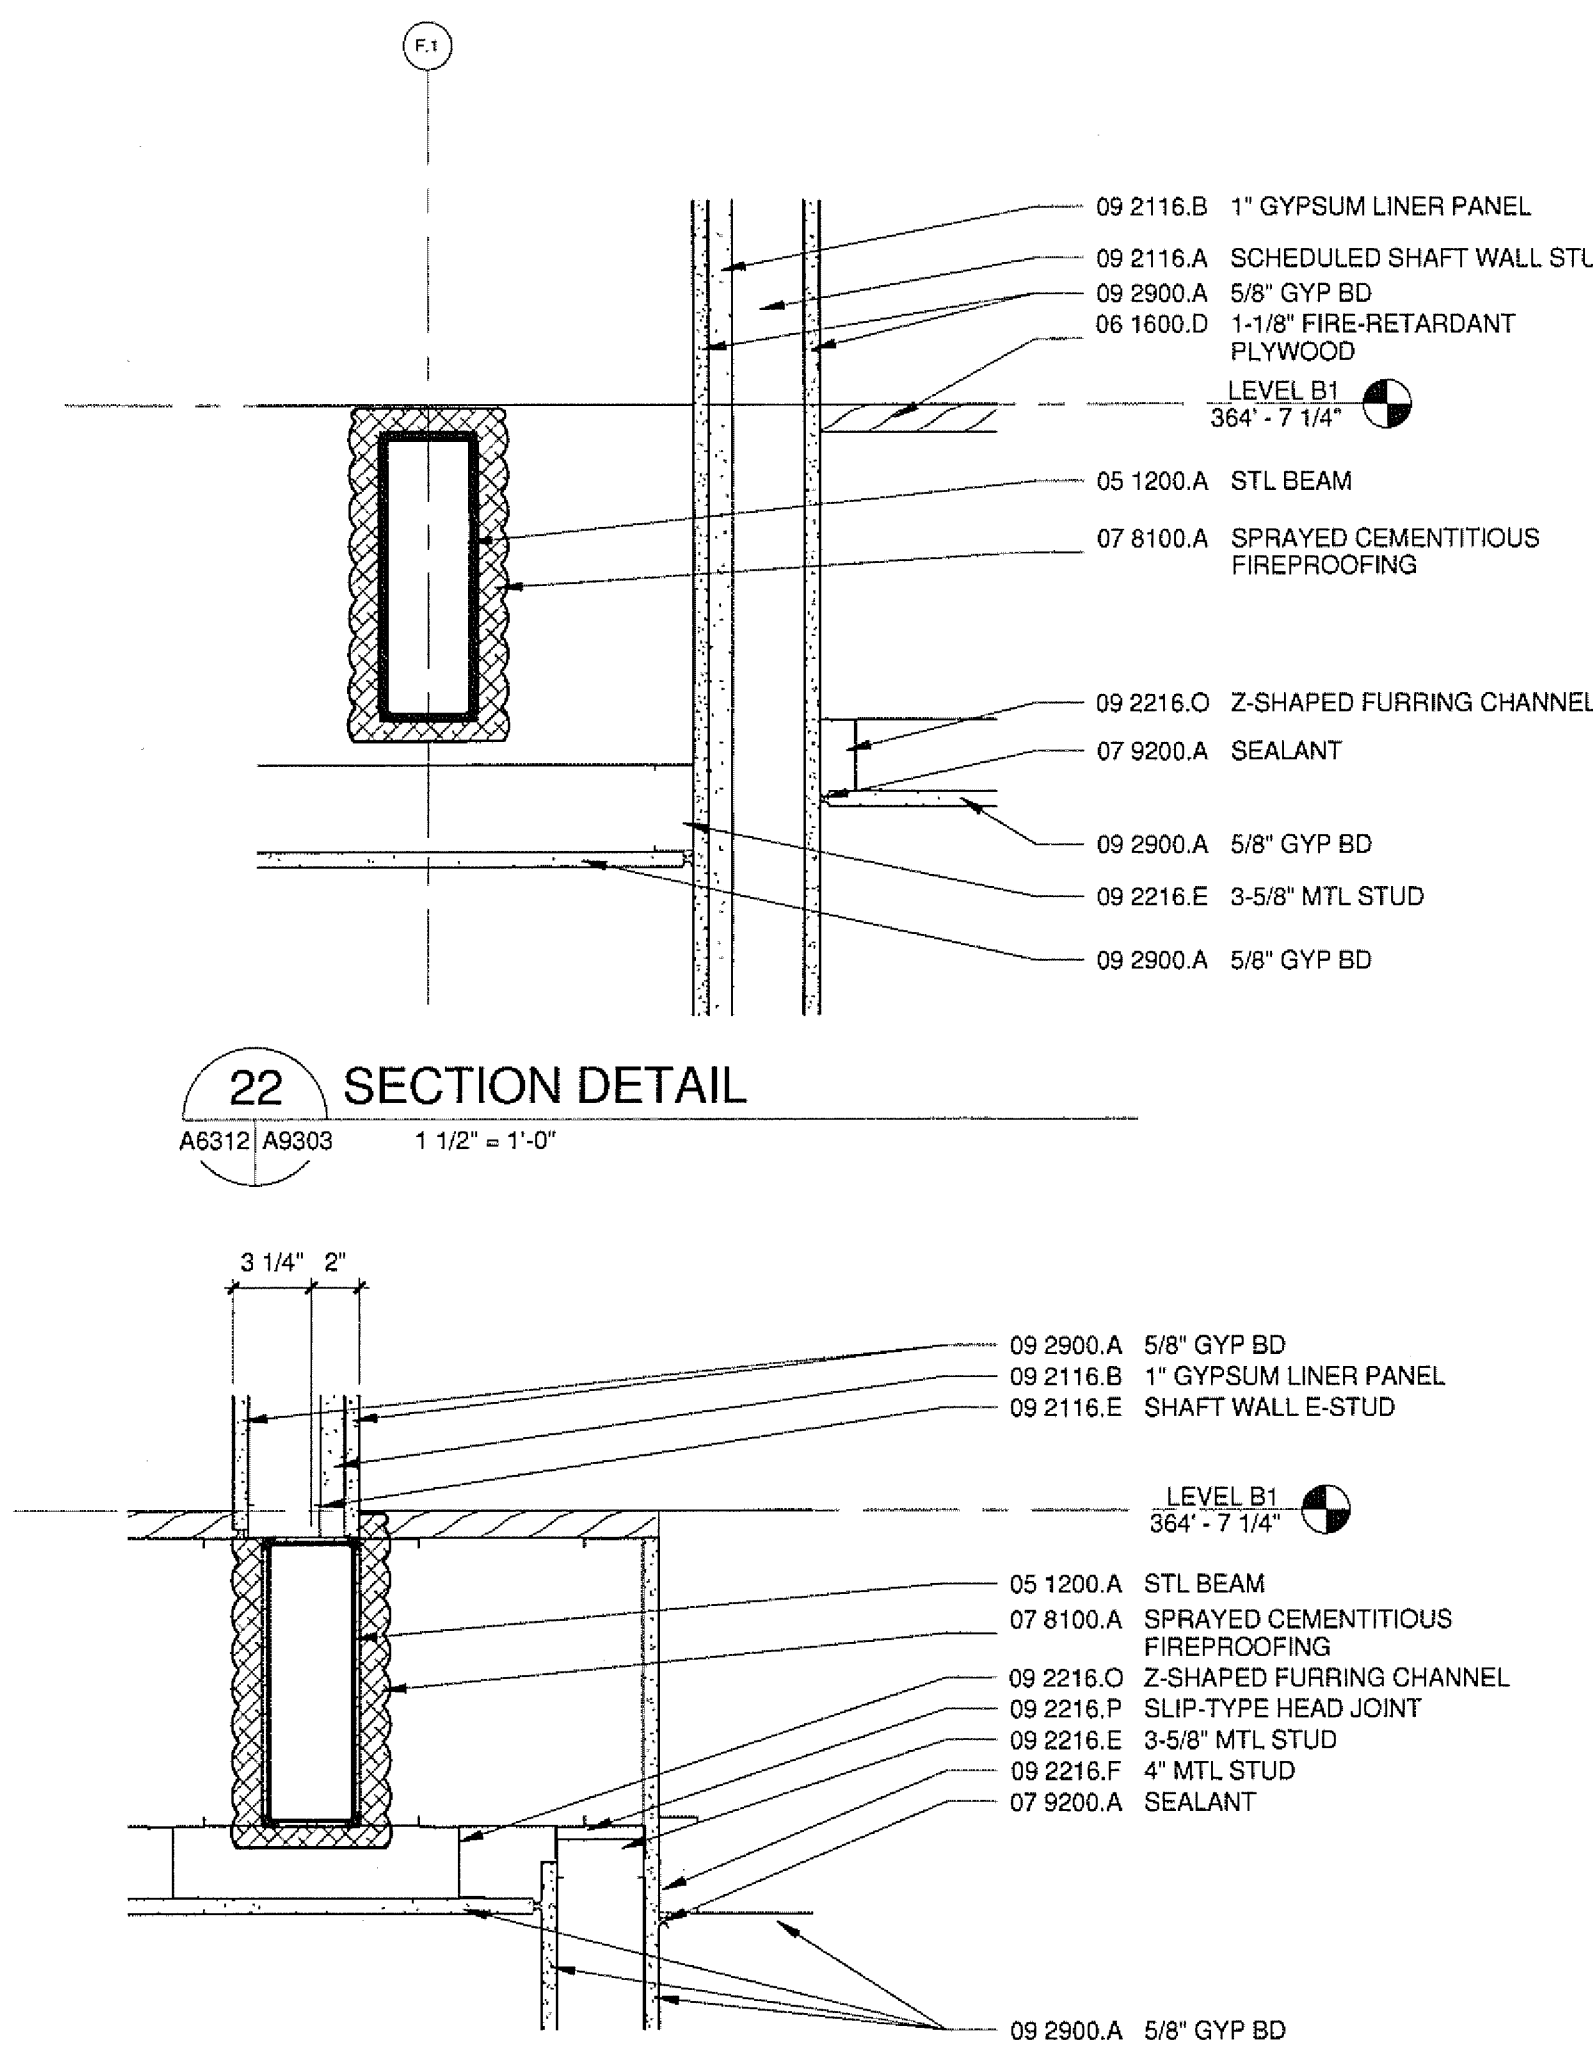


22 SECTION DETAIL
A6312 | A6303 1 1/2" = 1'-0"

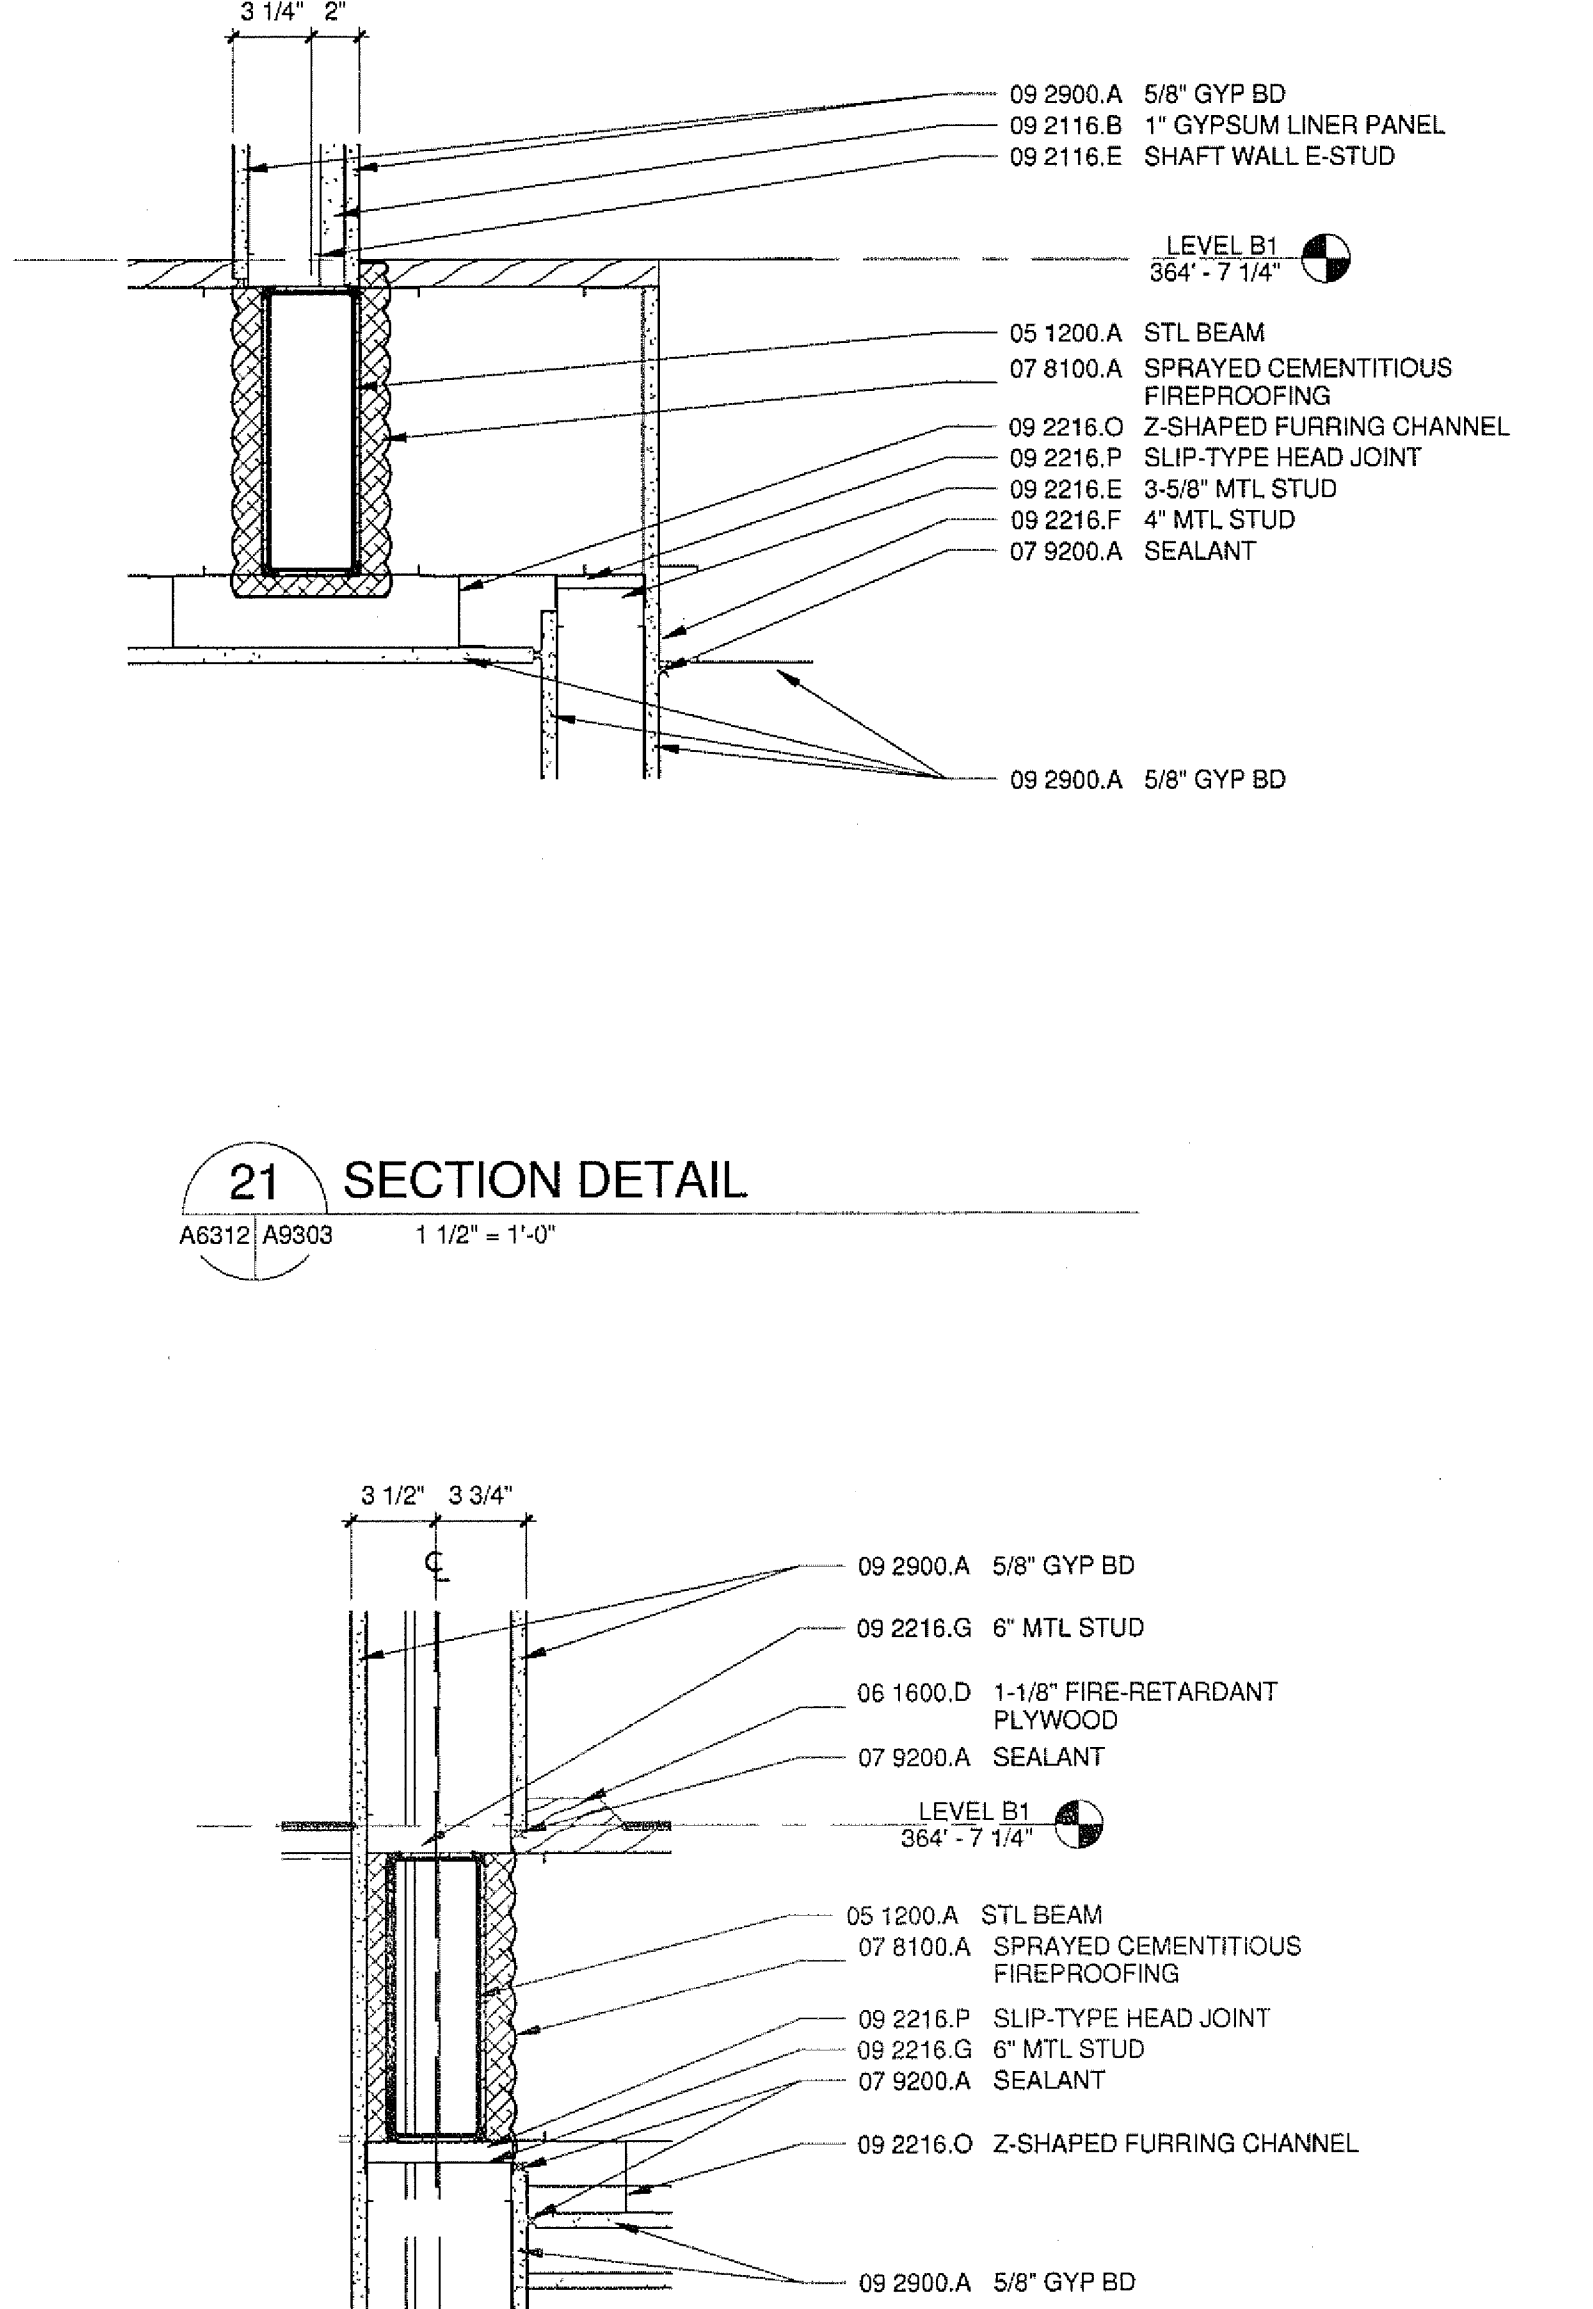


21 SECTION DETAIL
A6312 | A6303 1 1/2" = 1'-0"




20 SECTION DETAIL
A6312 | A6303 1 1/2" = 1'-0"

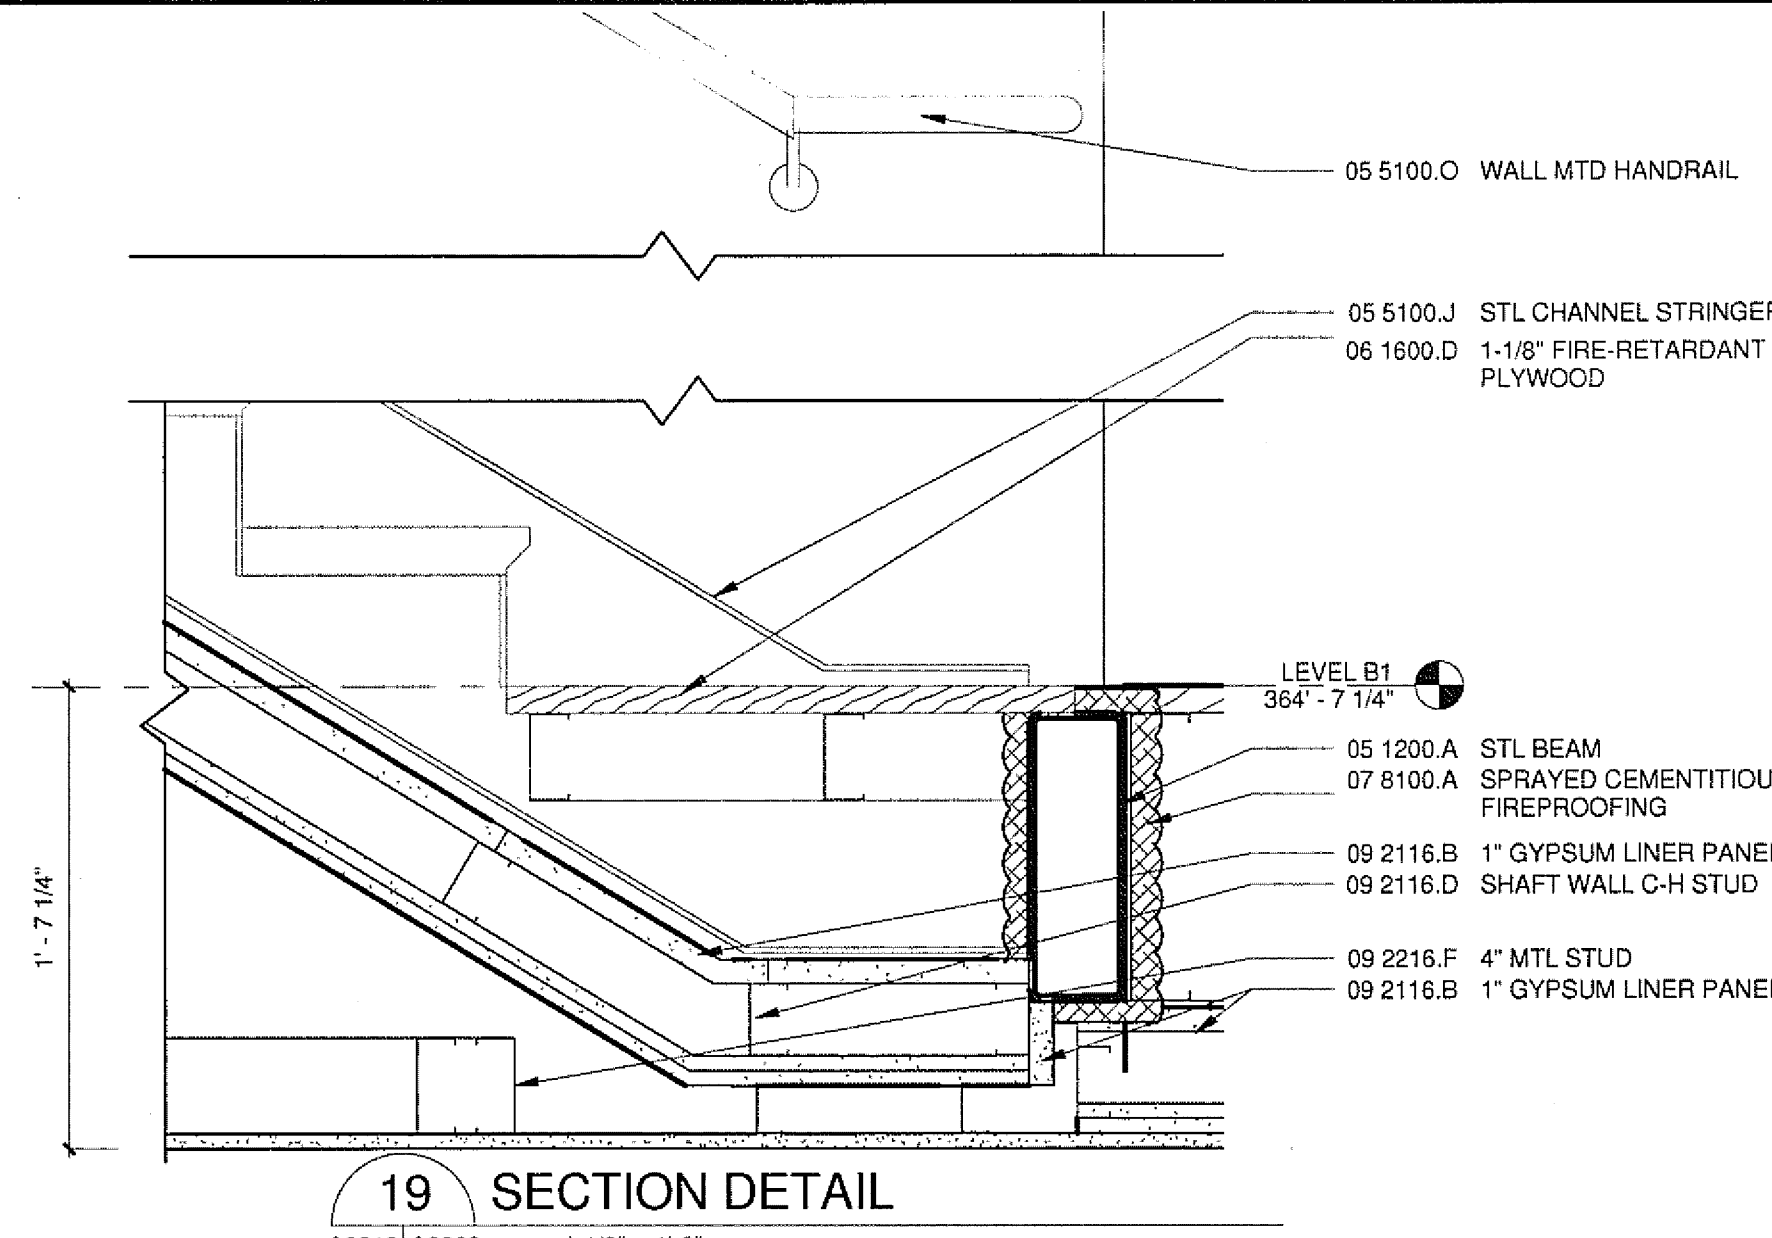


19 SECTION DETAIL
A6312 | A6303 1 1/2" = 1'-0"

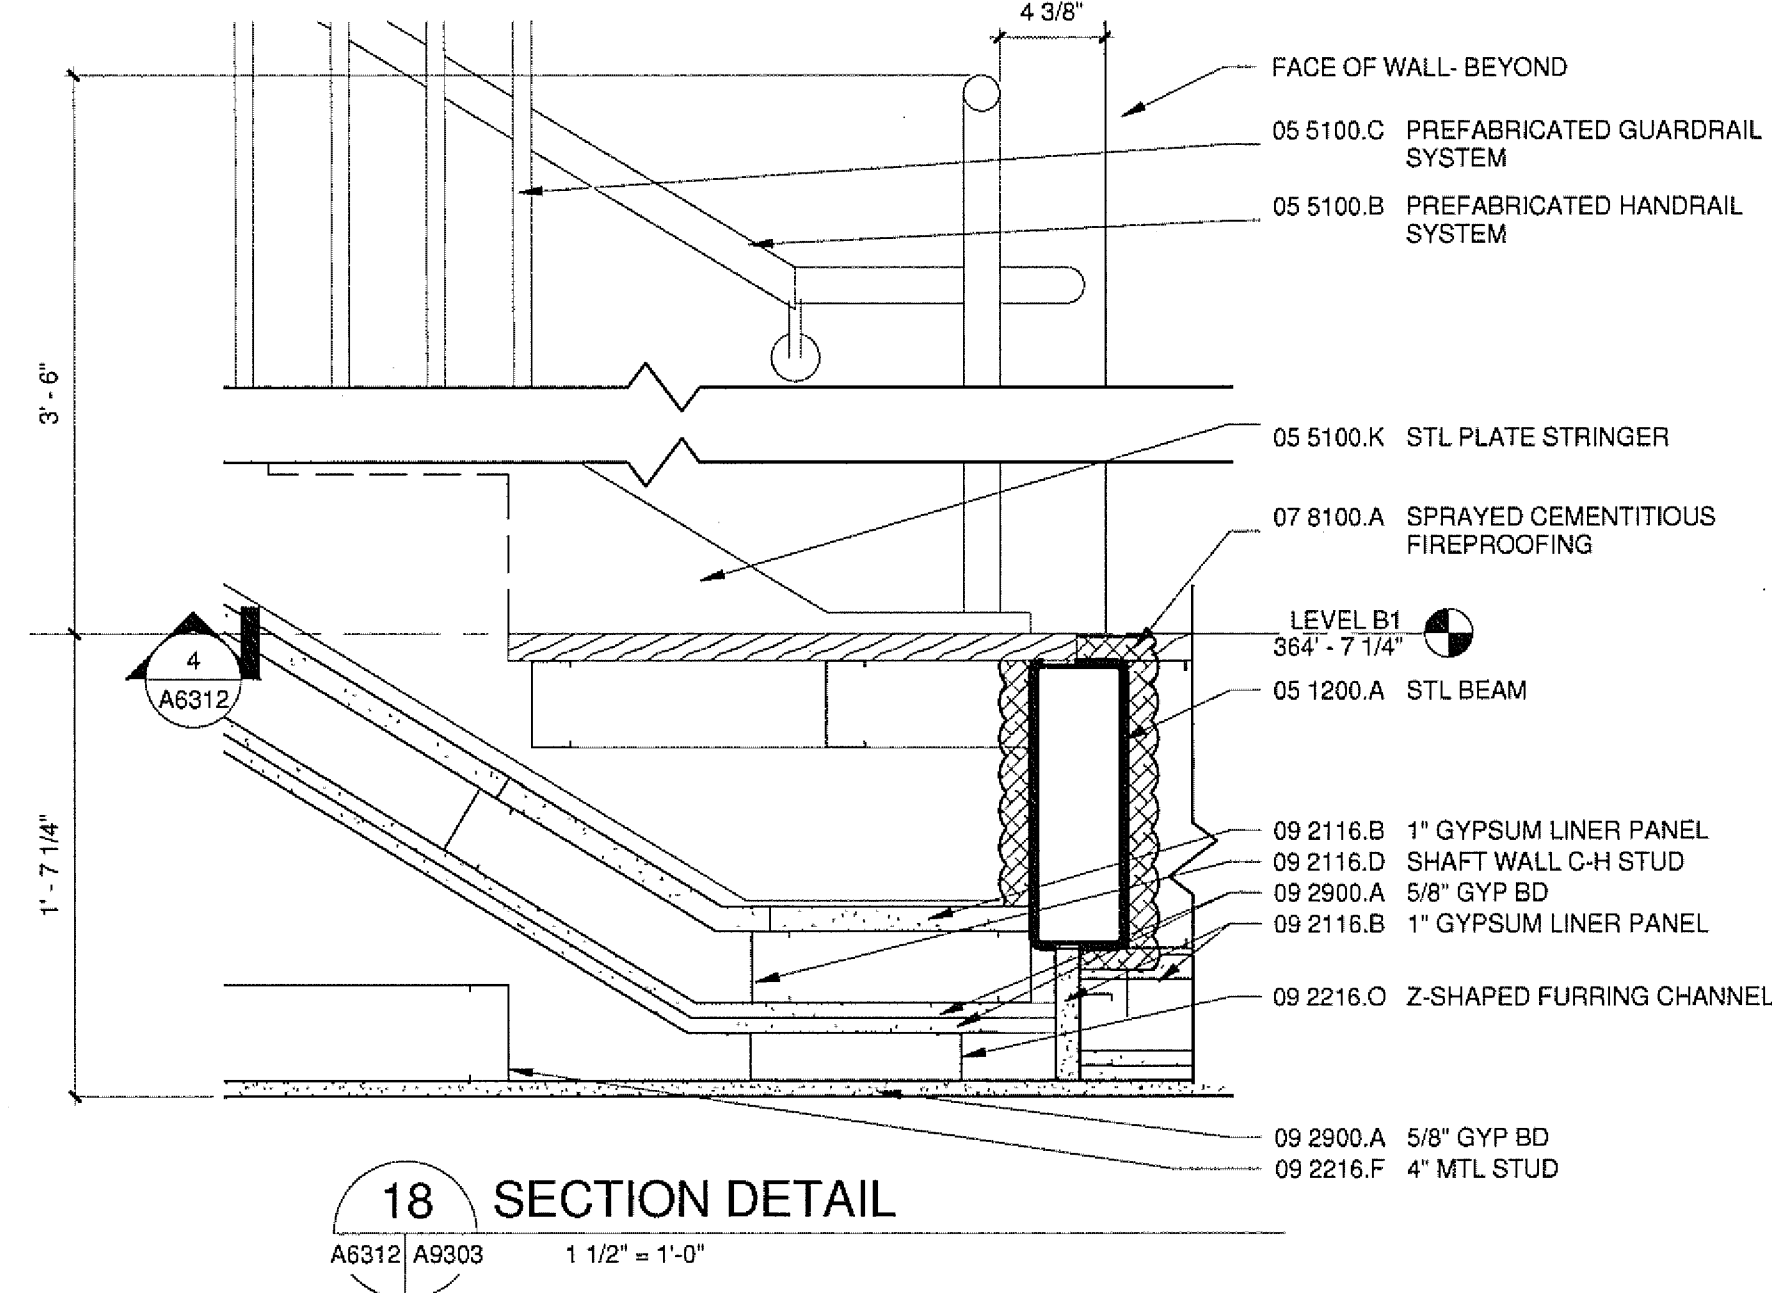


18 SECTION DETAIL
A6312 | A6303 1 1/2" = 1'-0"

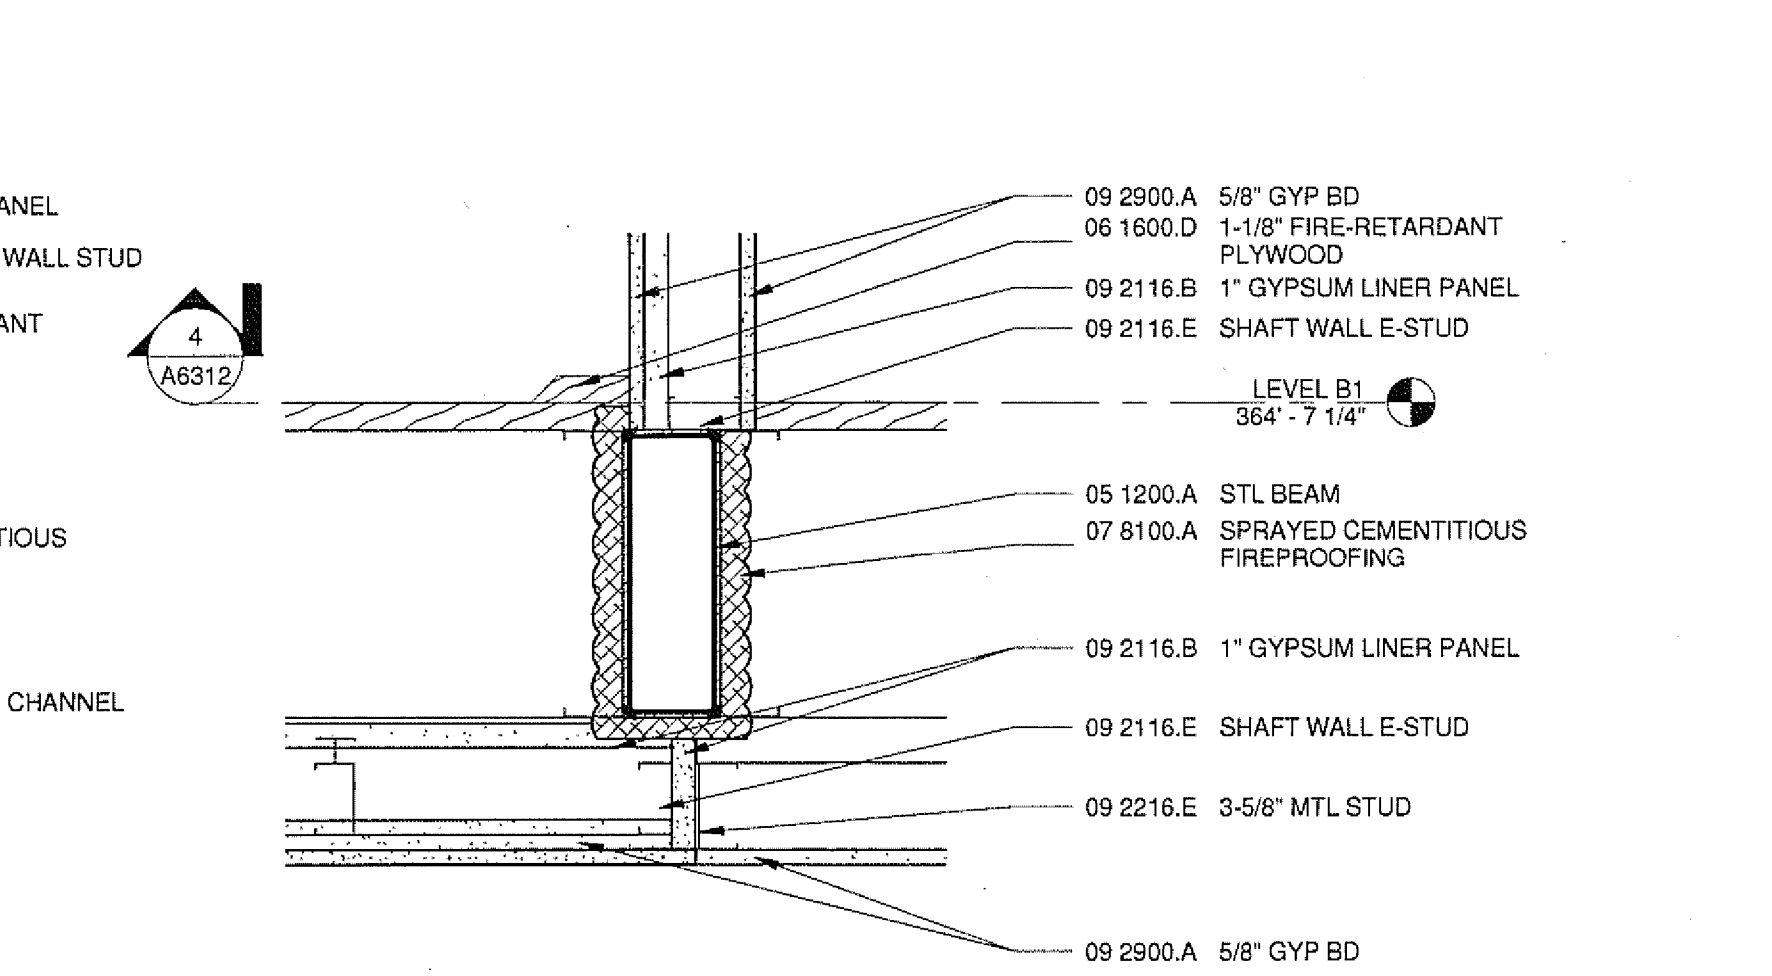


17 SECTION DETAIL
A6312 | A6303 1 1/2" = 1'-0"

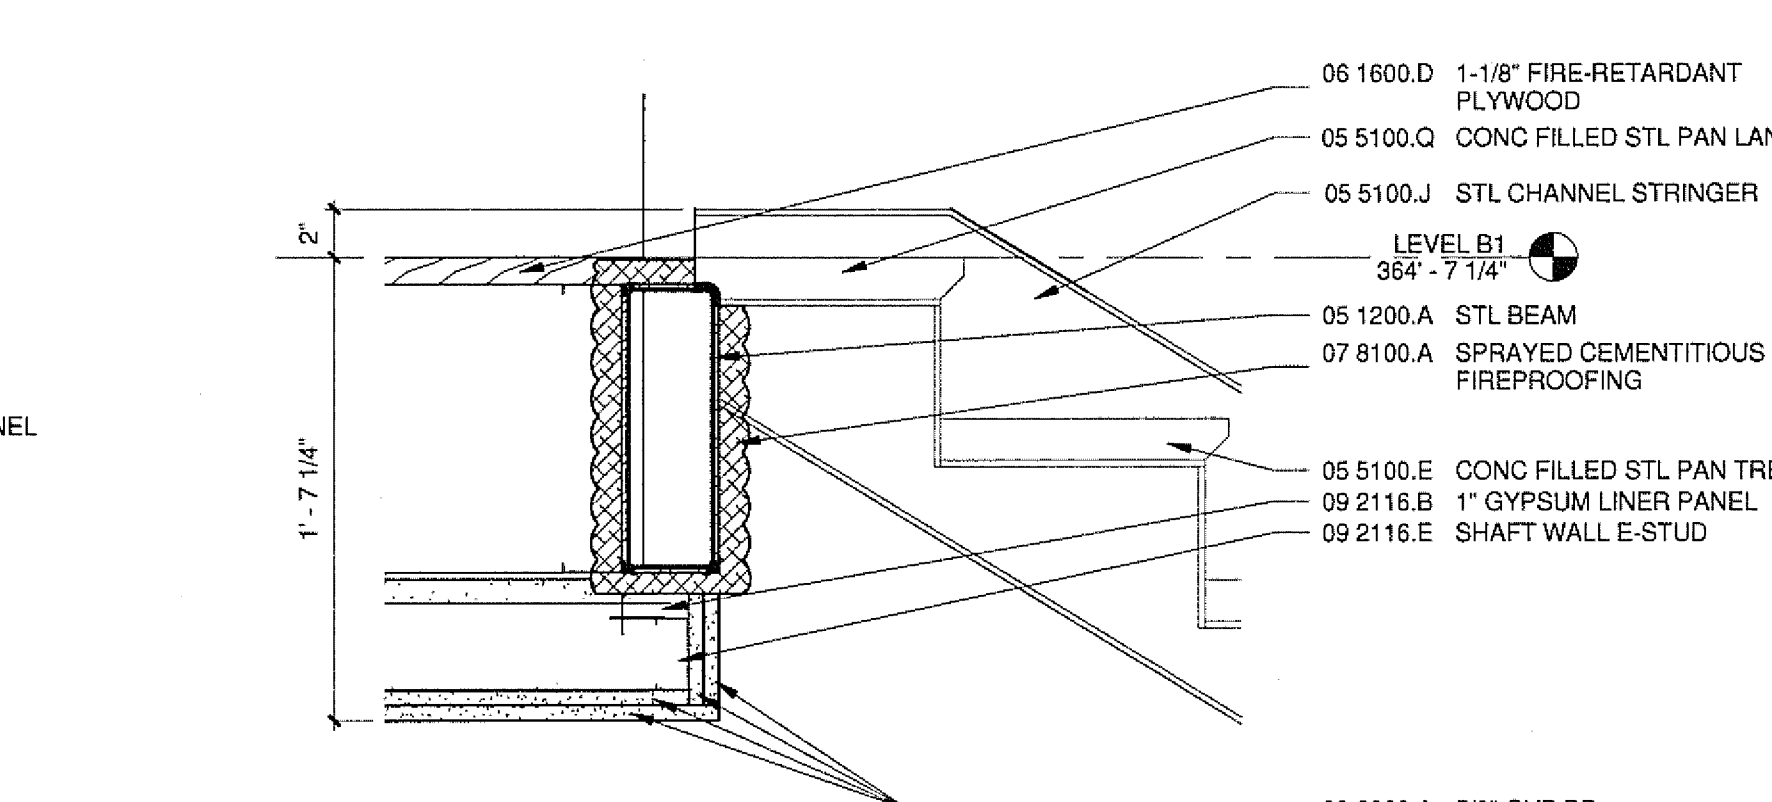


16 SECTION DETAIL
A6312 | A6303 1 1/2" = 1'-0"

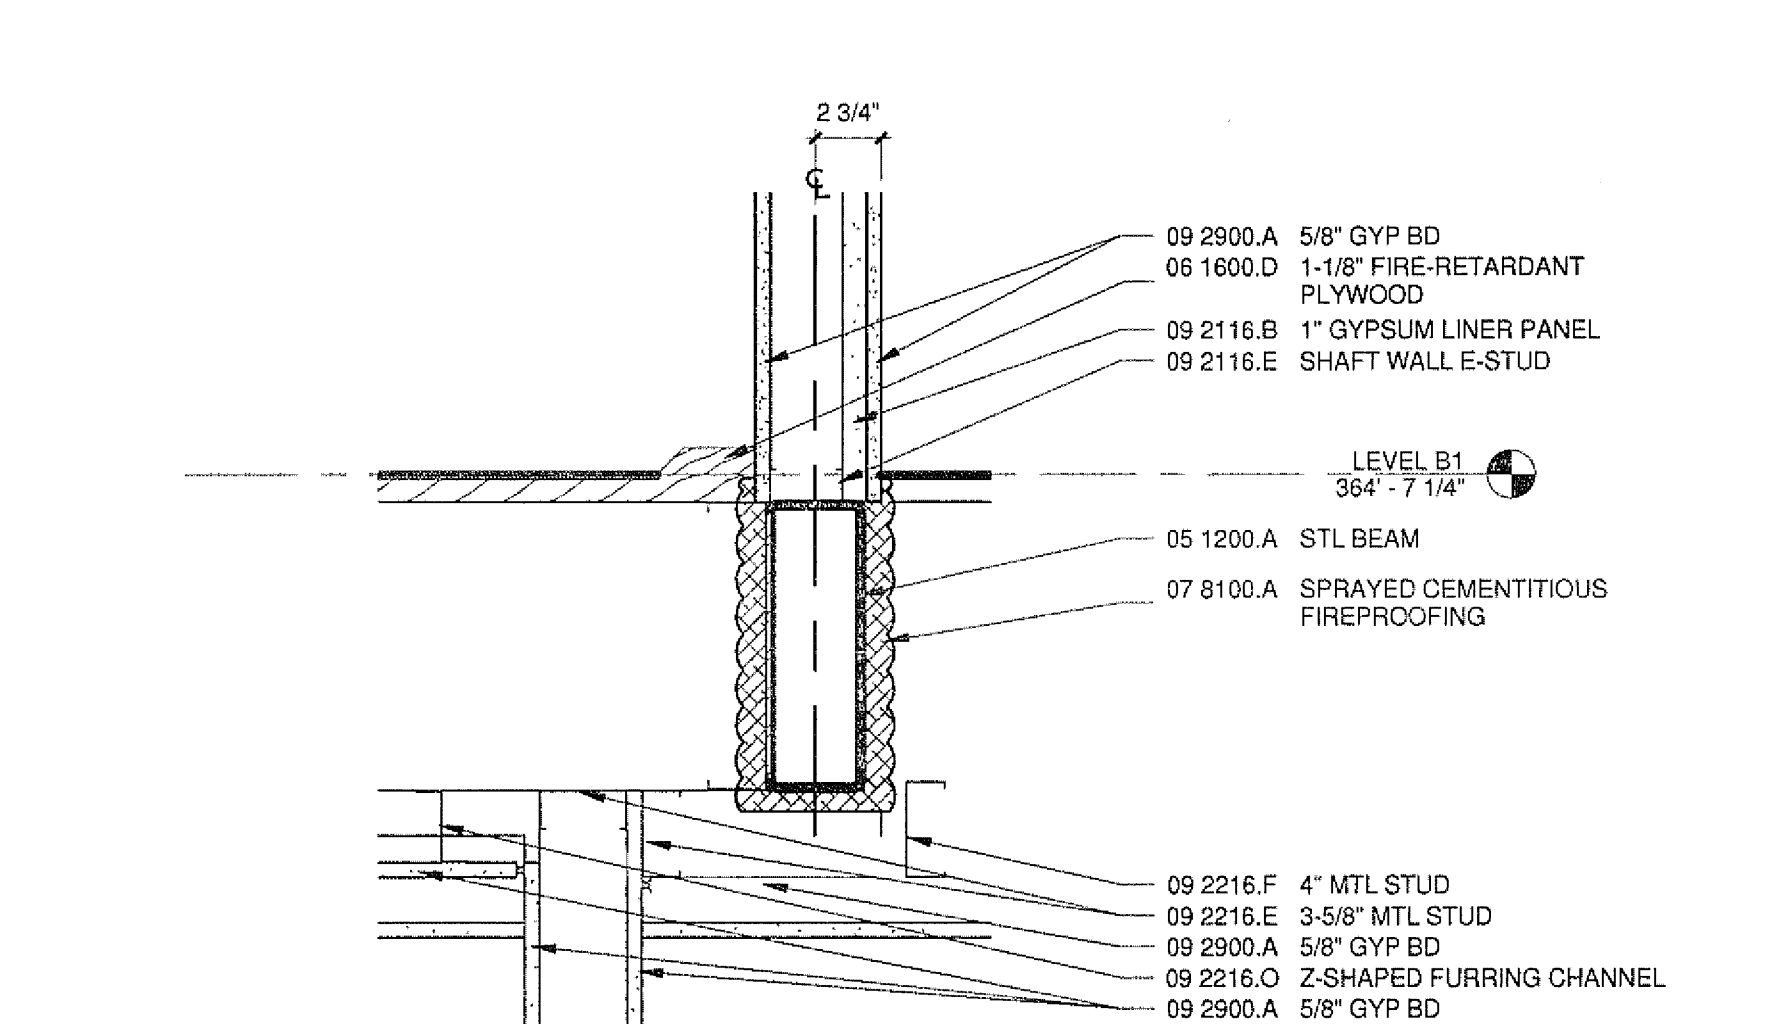


15 SECTION DETAIL
A6312 | A6303 1 1/2" = 1'-0"

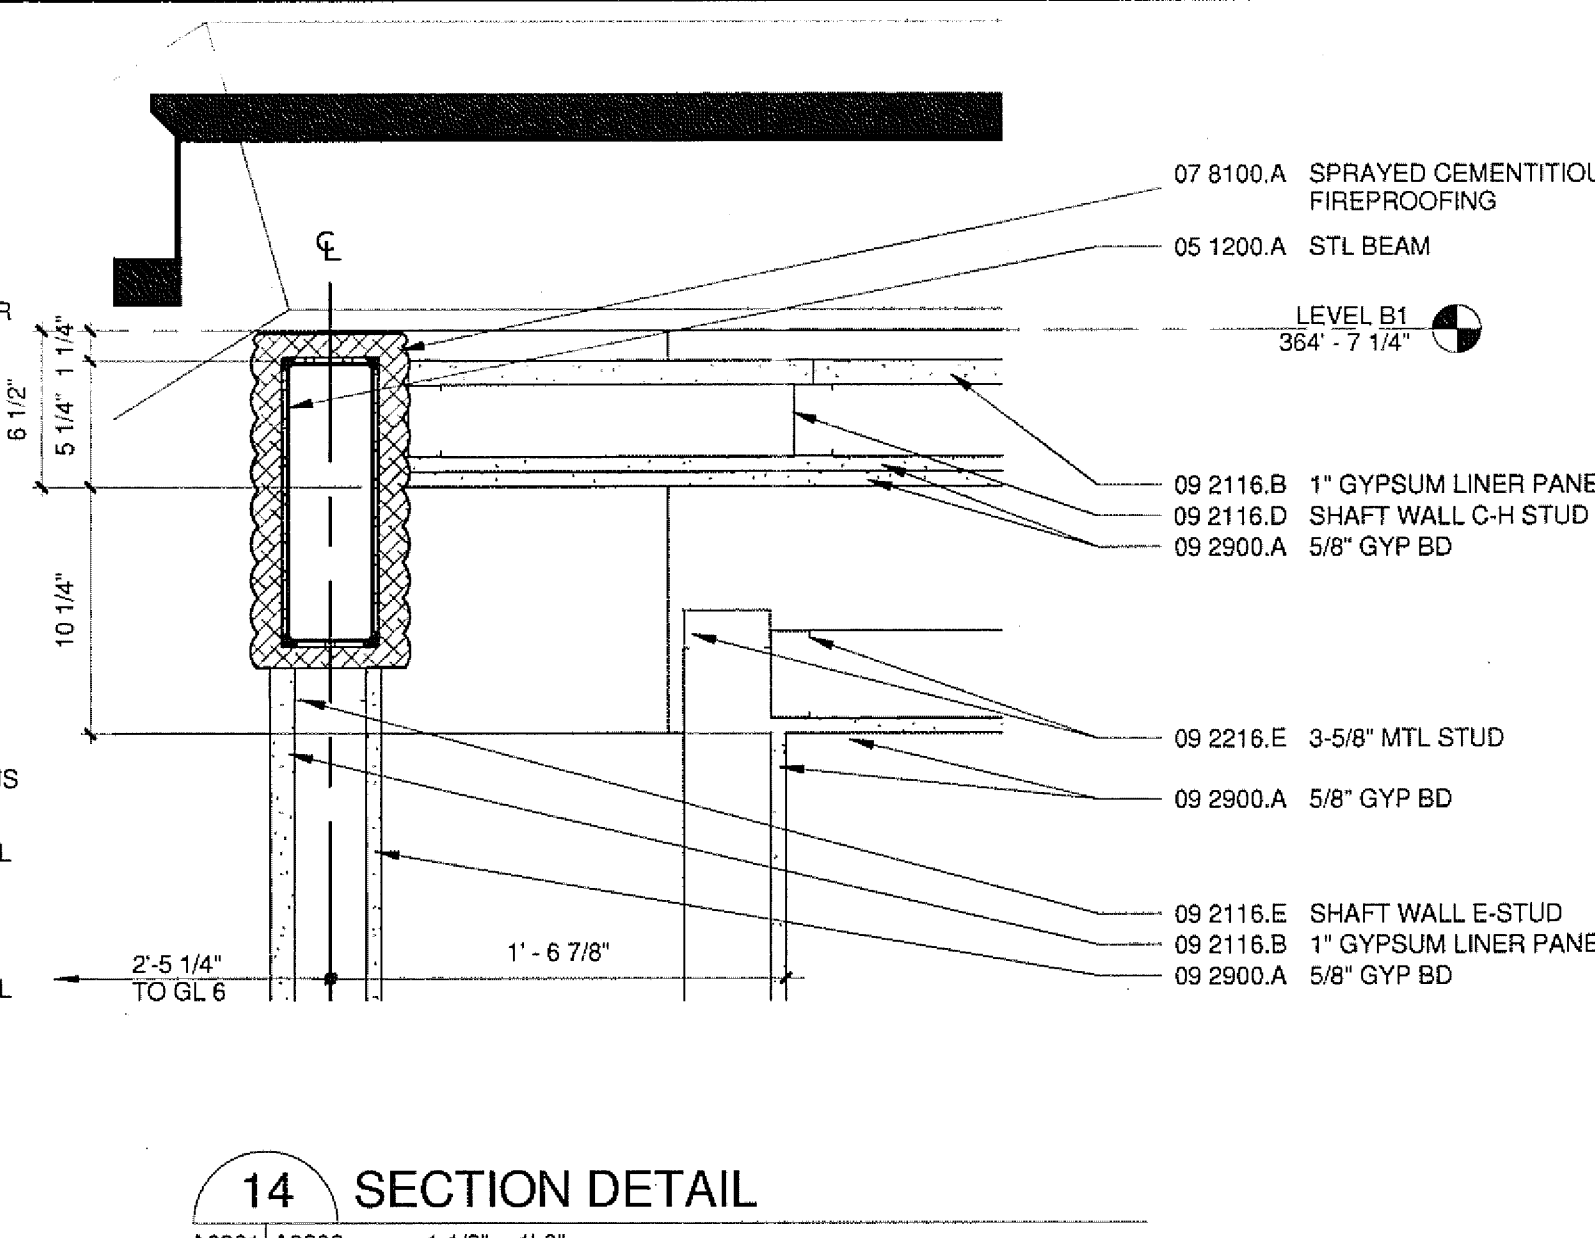


14 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

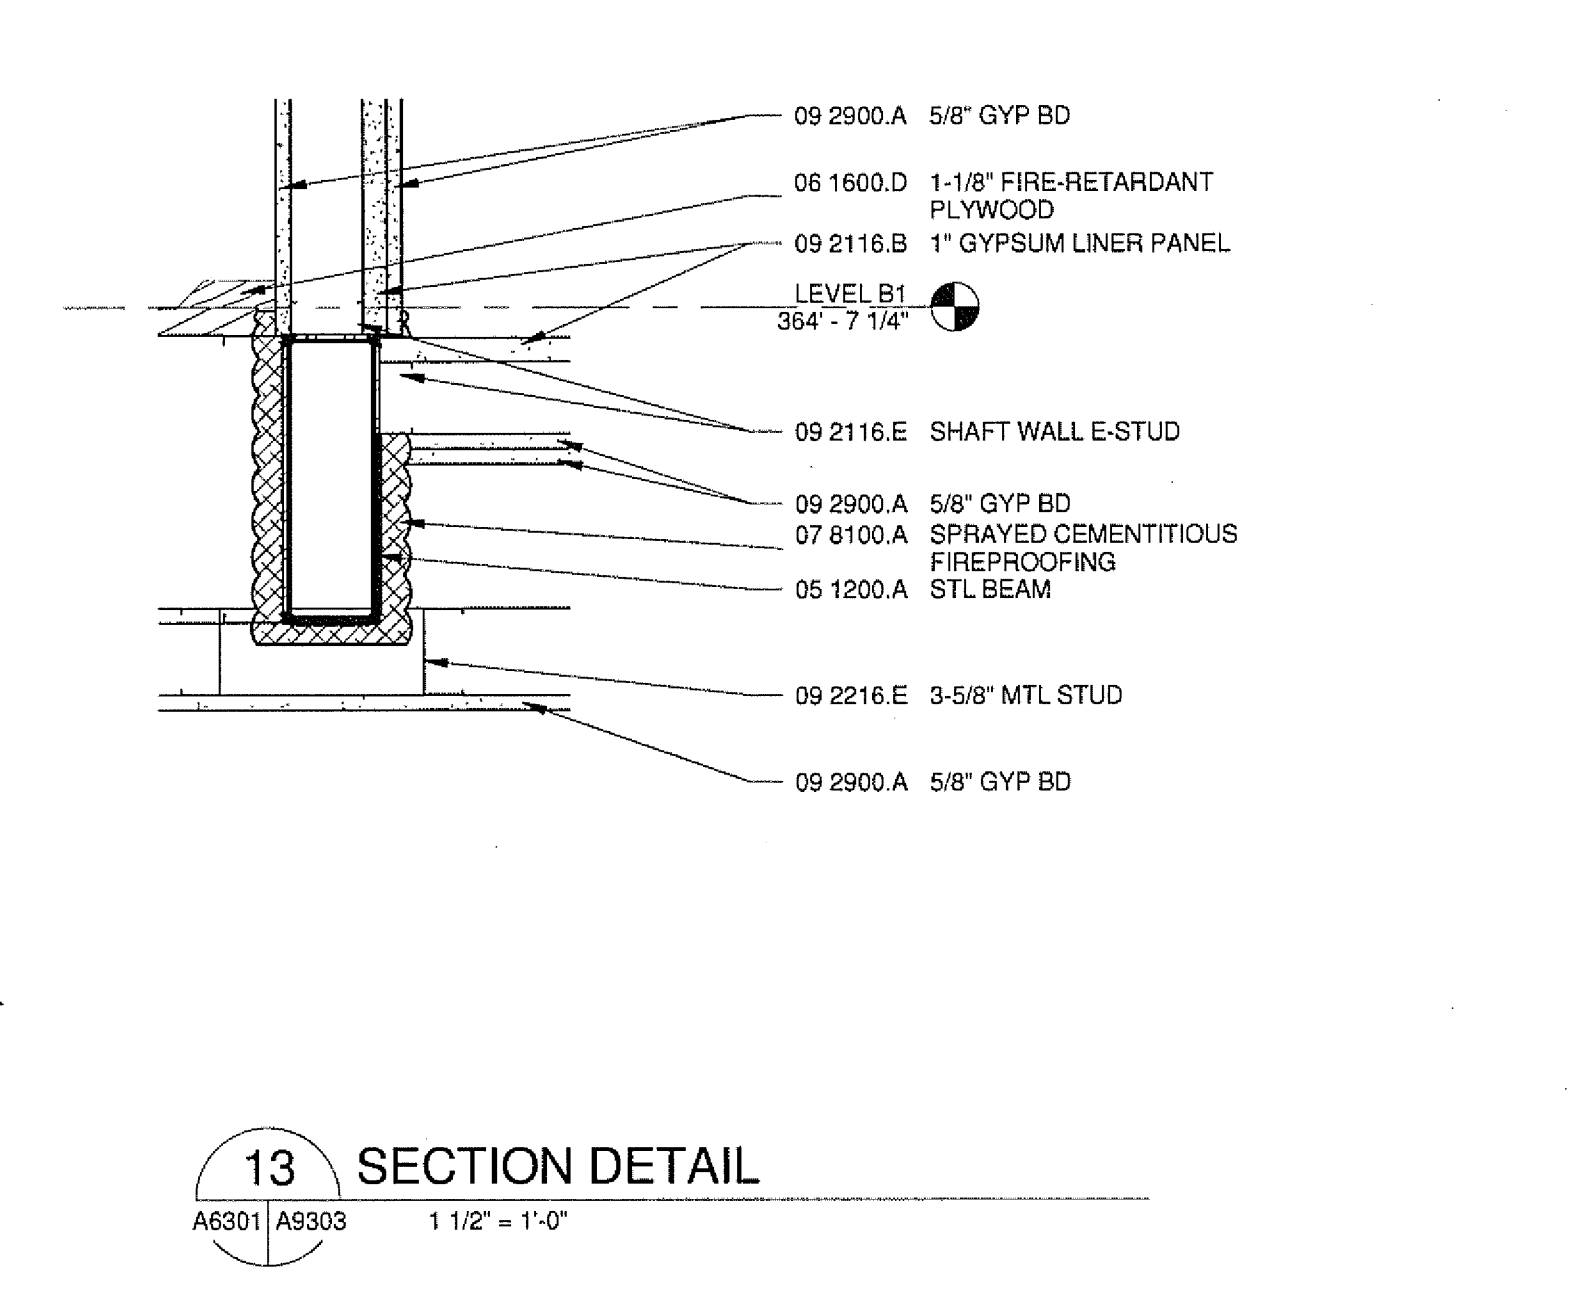


13 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

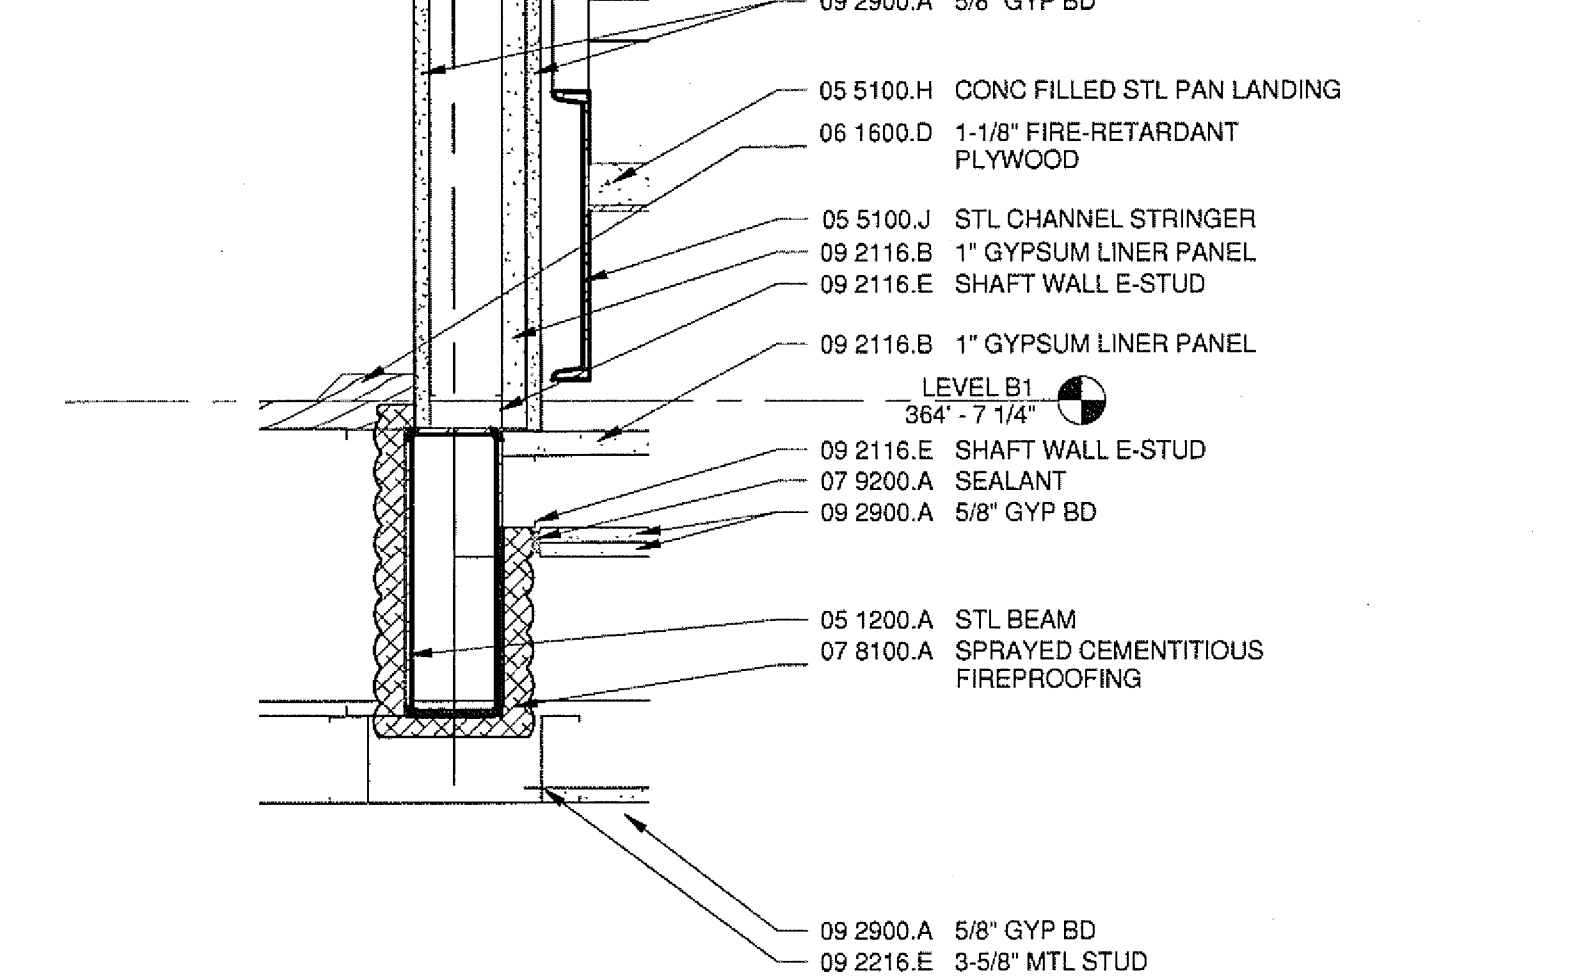


12 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

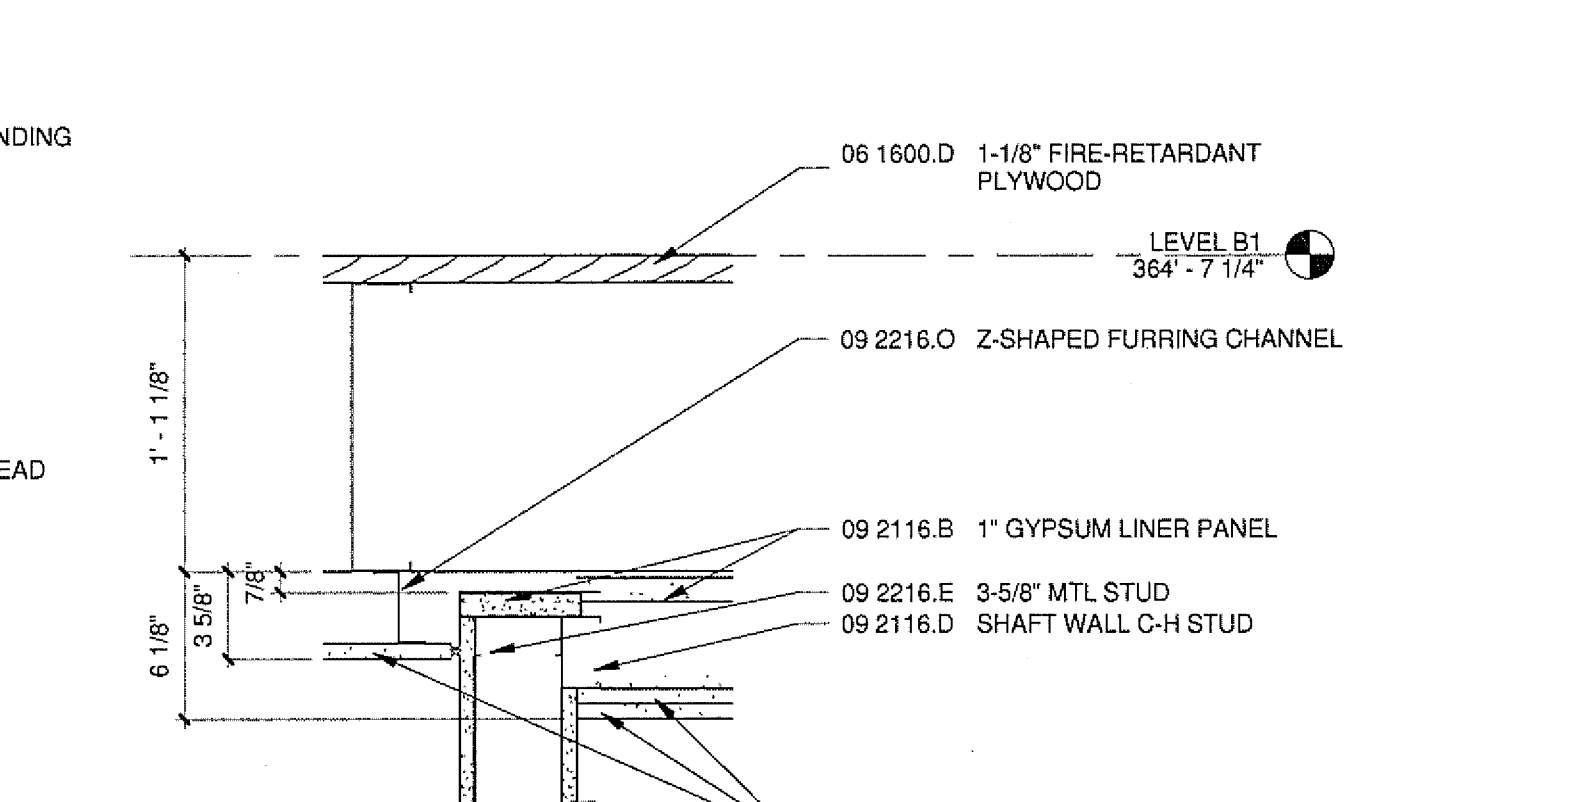


11 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

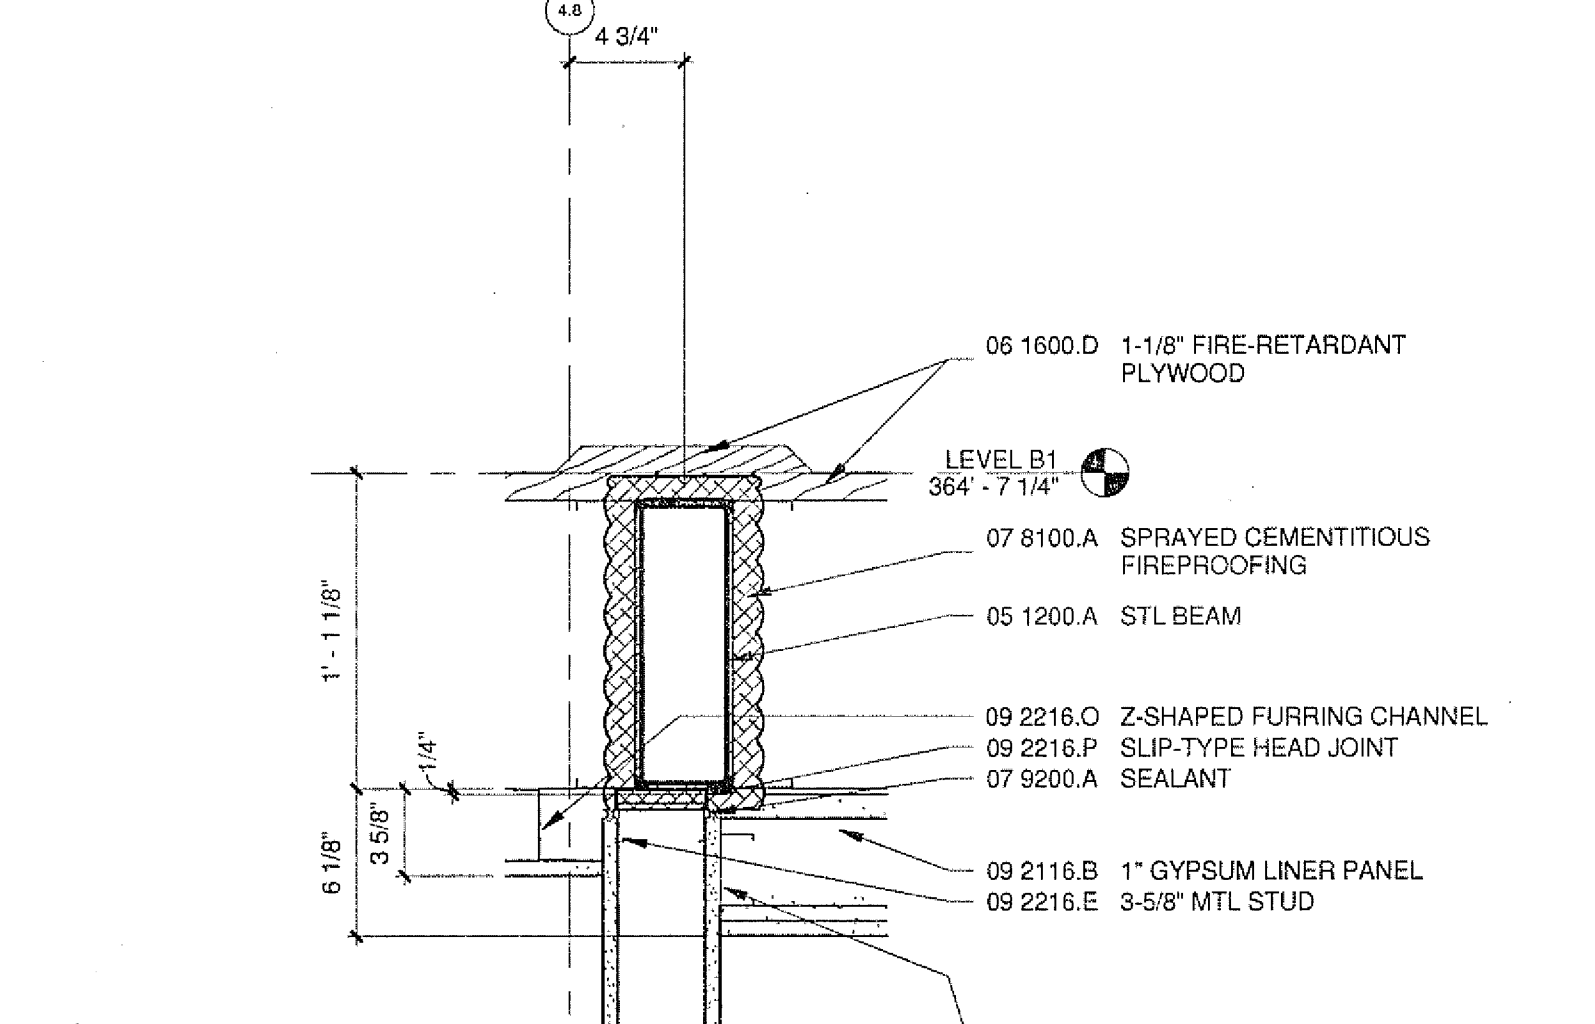


10 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

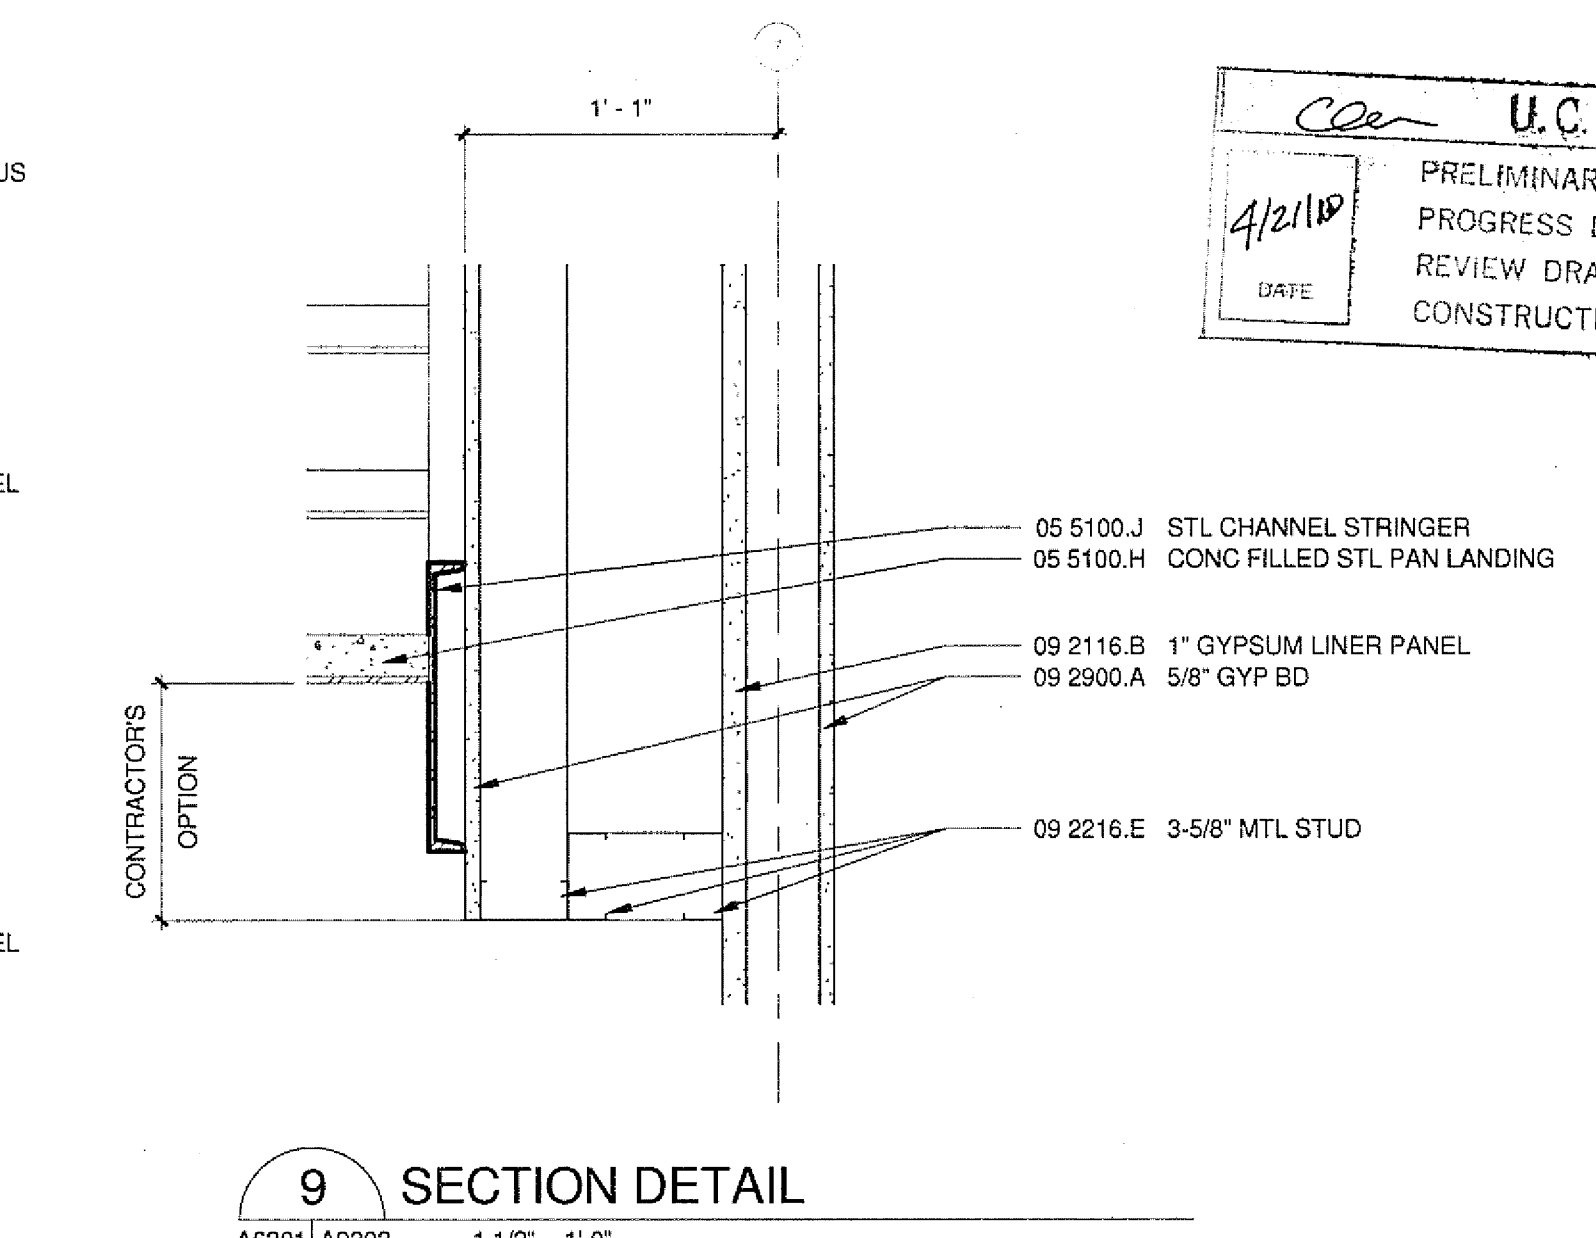


9 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

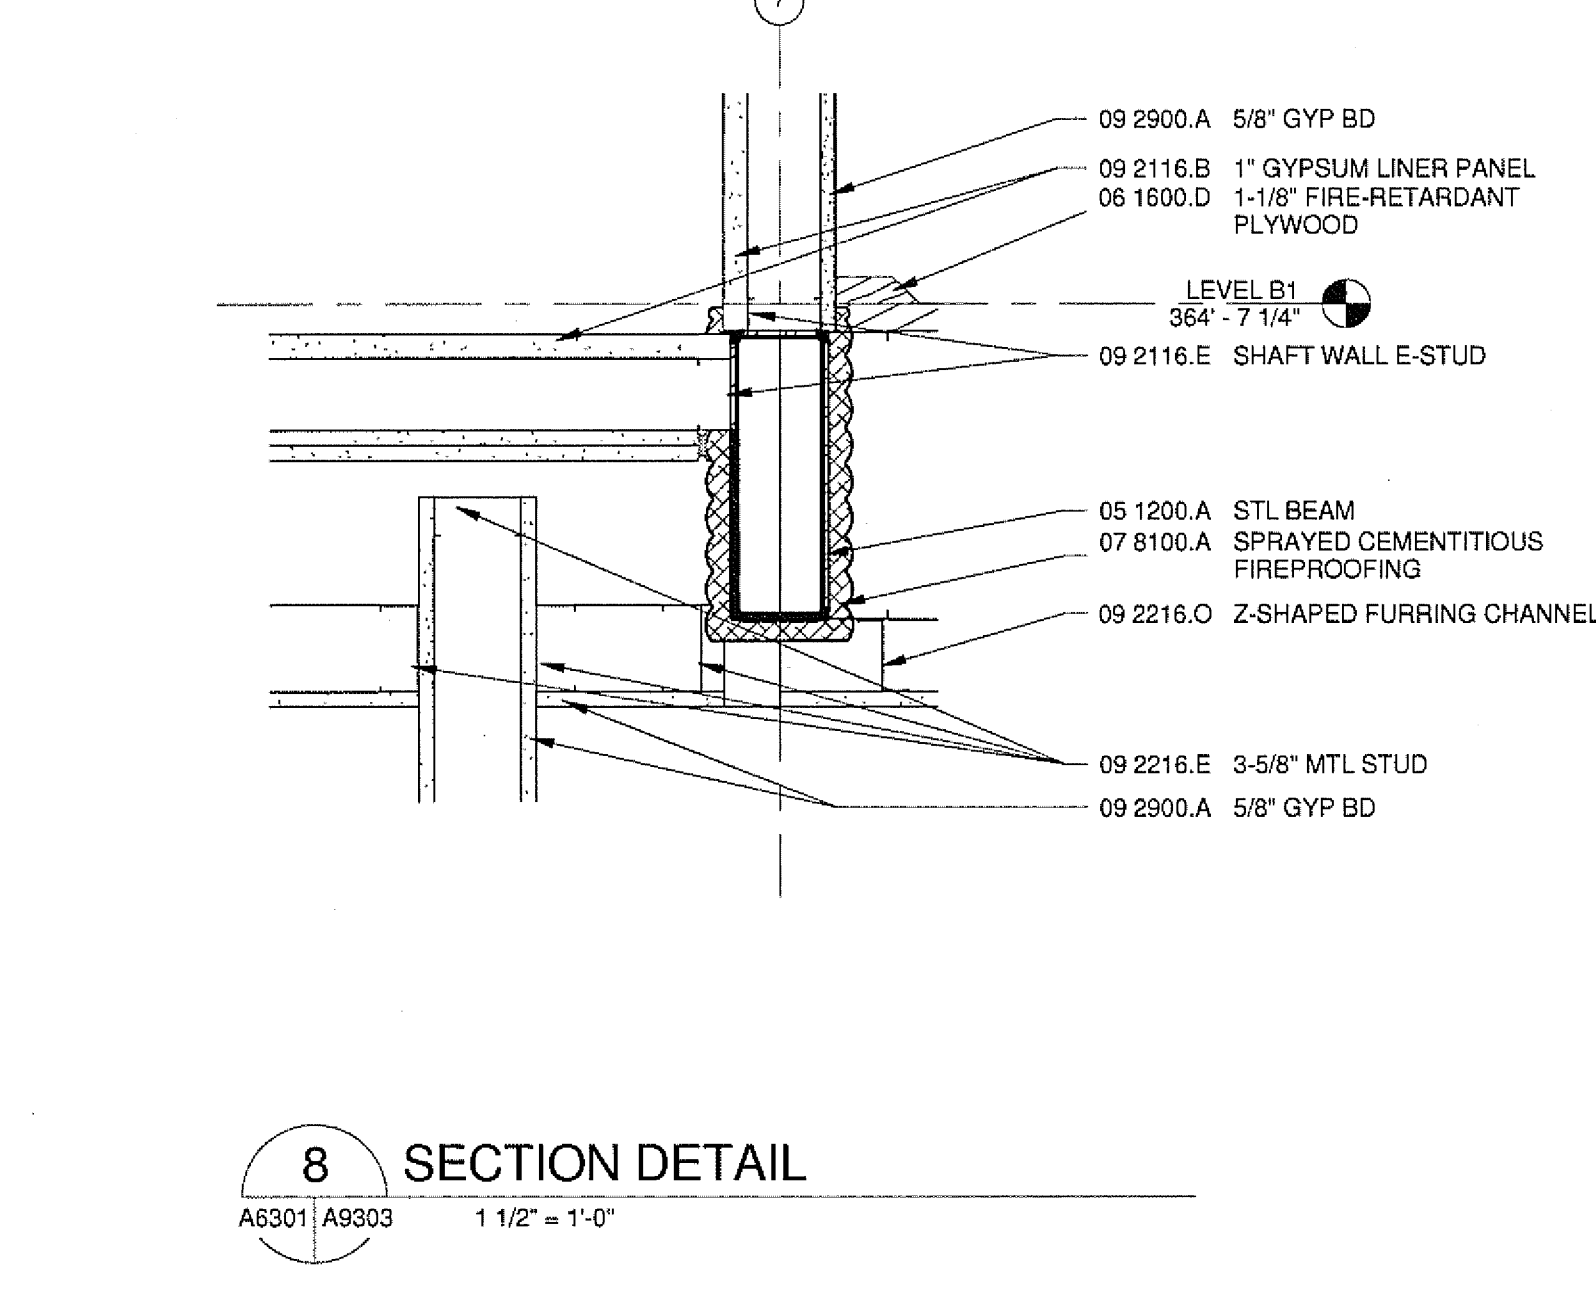


8 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

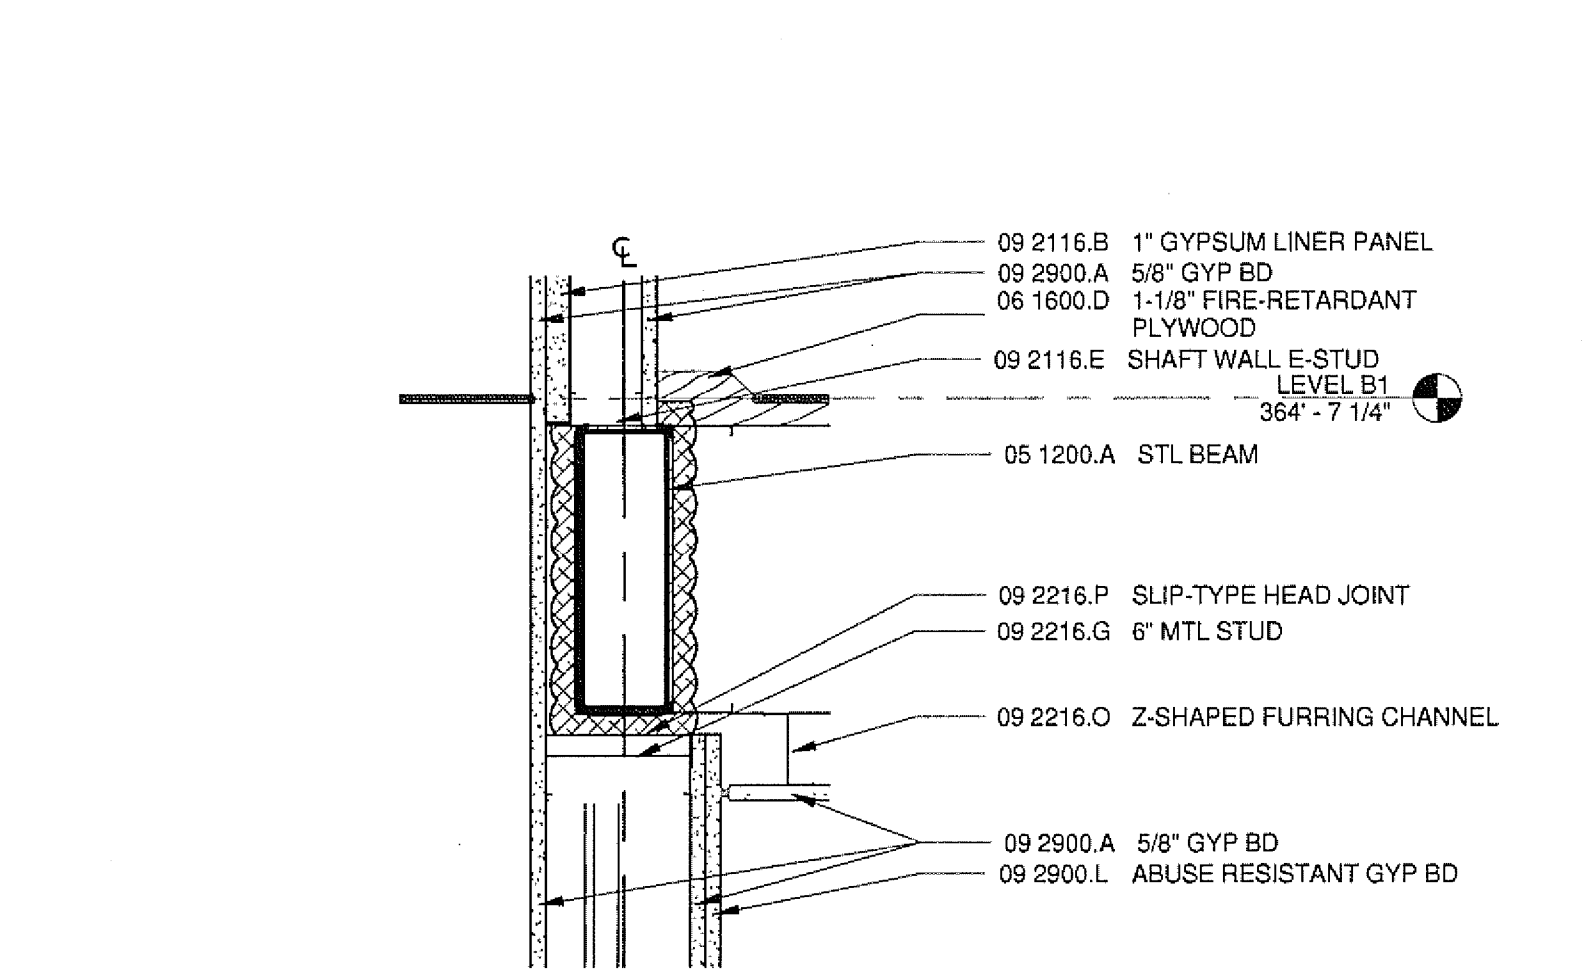


7 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

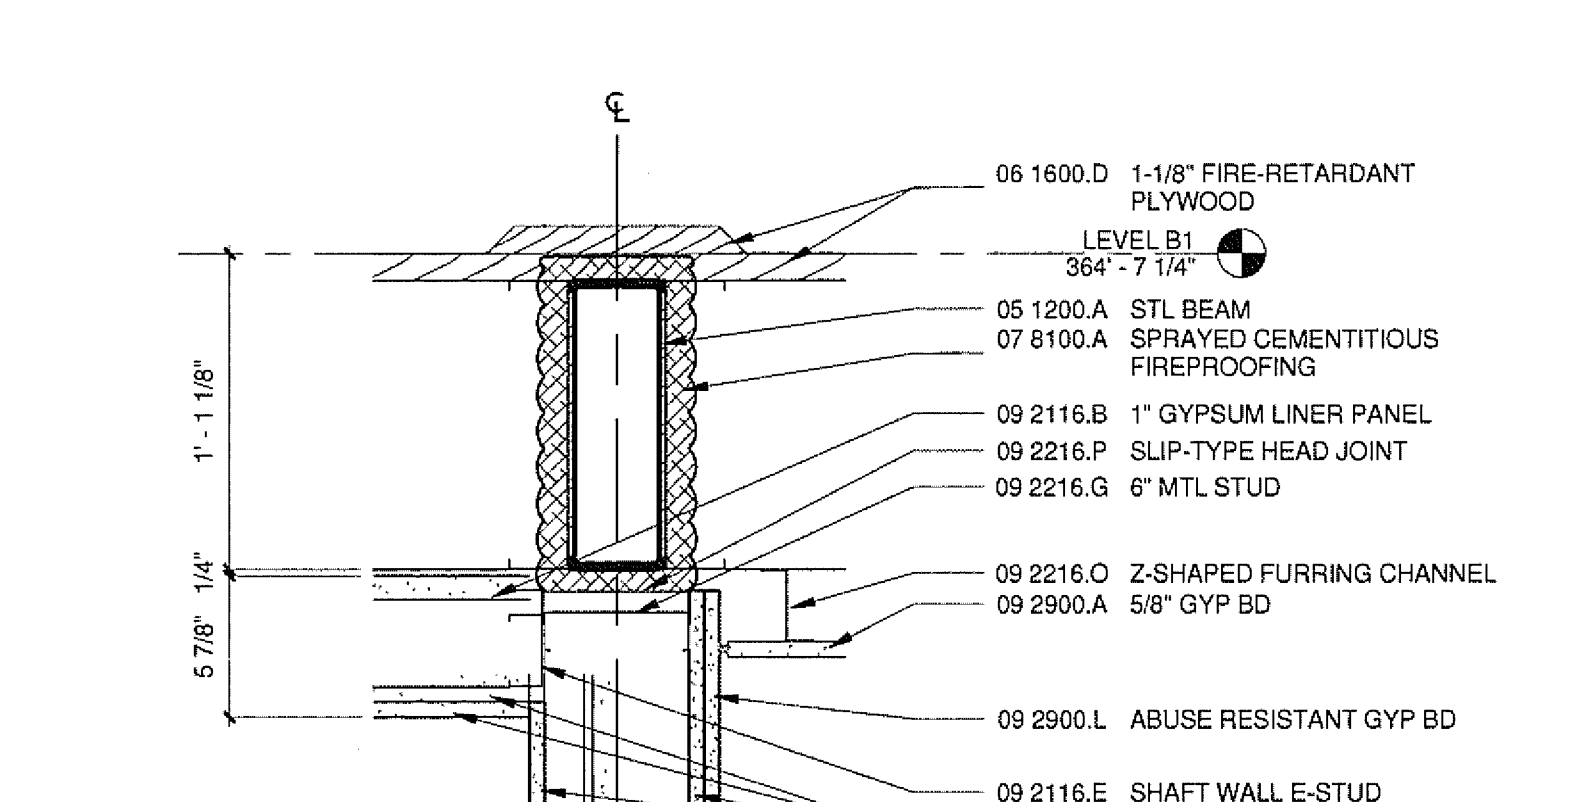


6 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

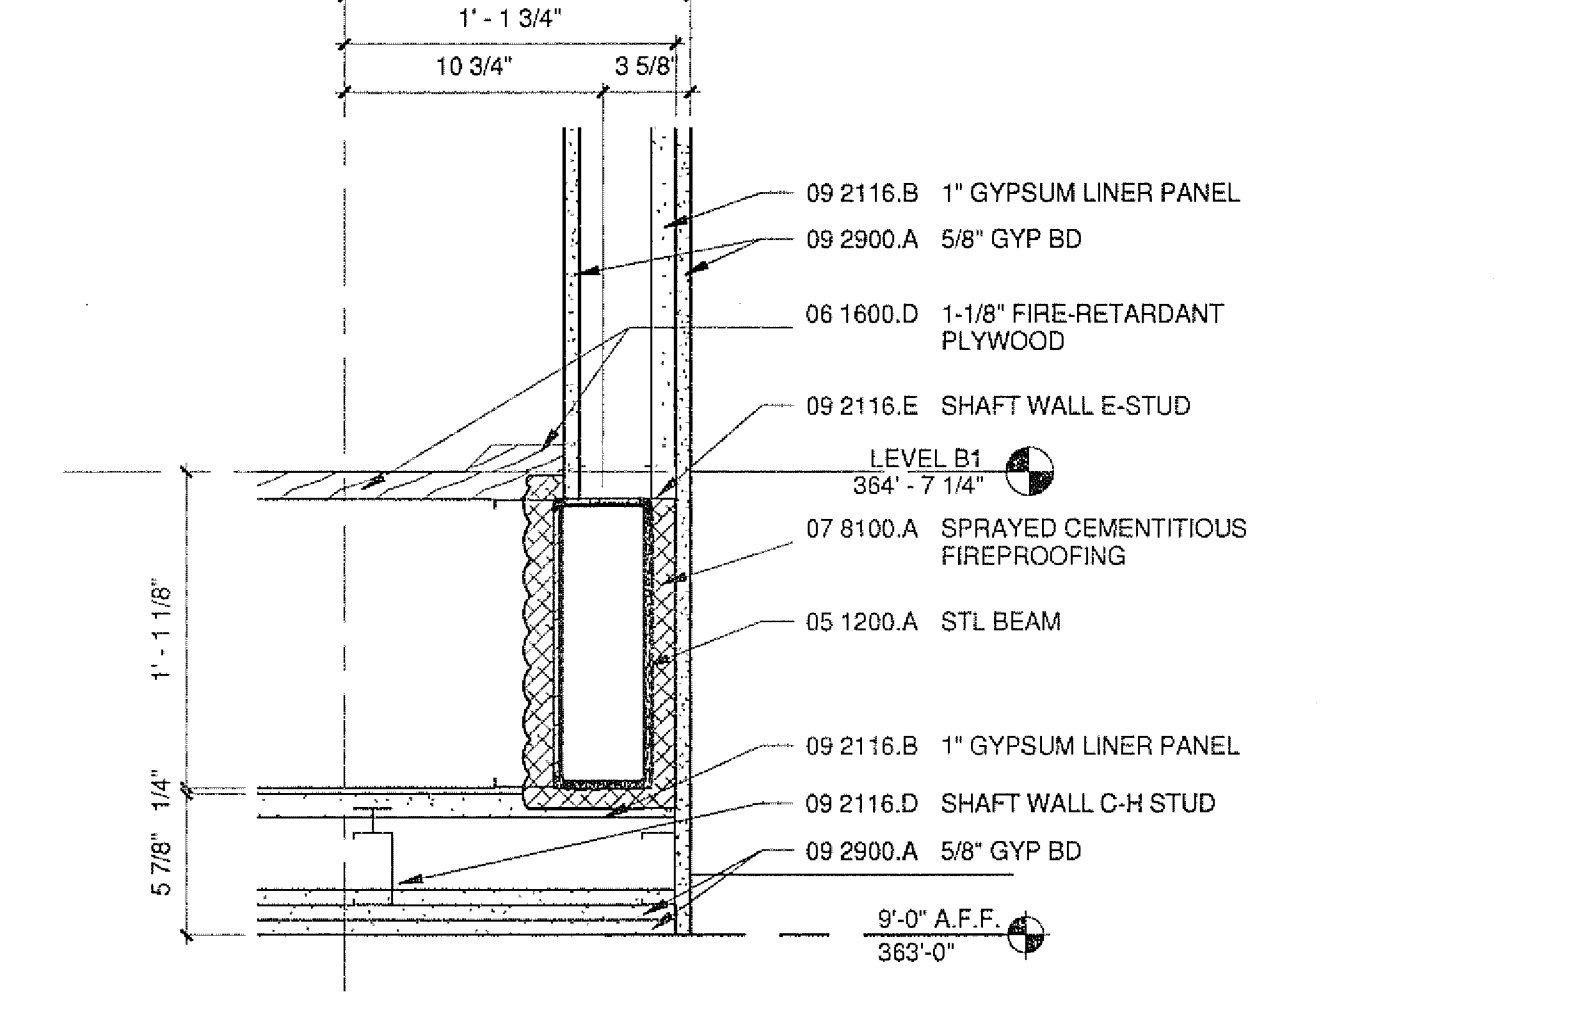


5 SECTION DETAIL
A6301 | A6303 1 1/2" = 1'-0"

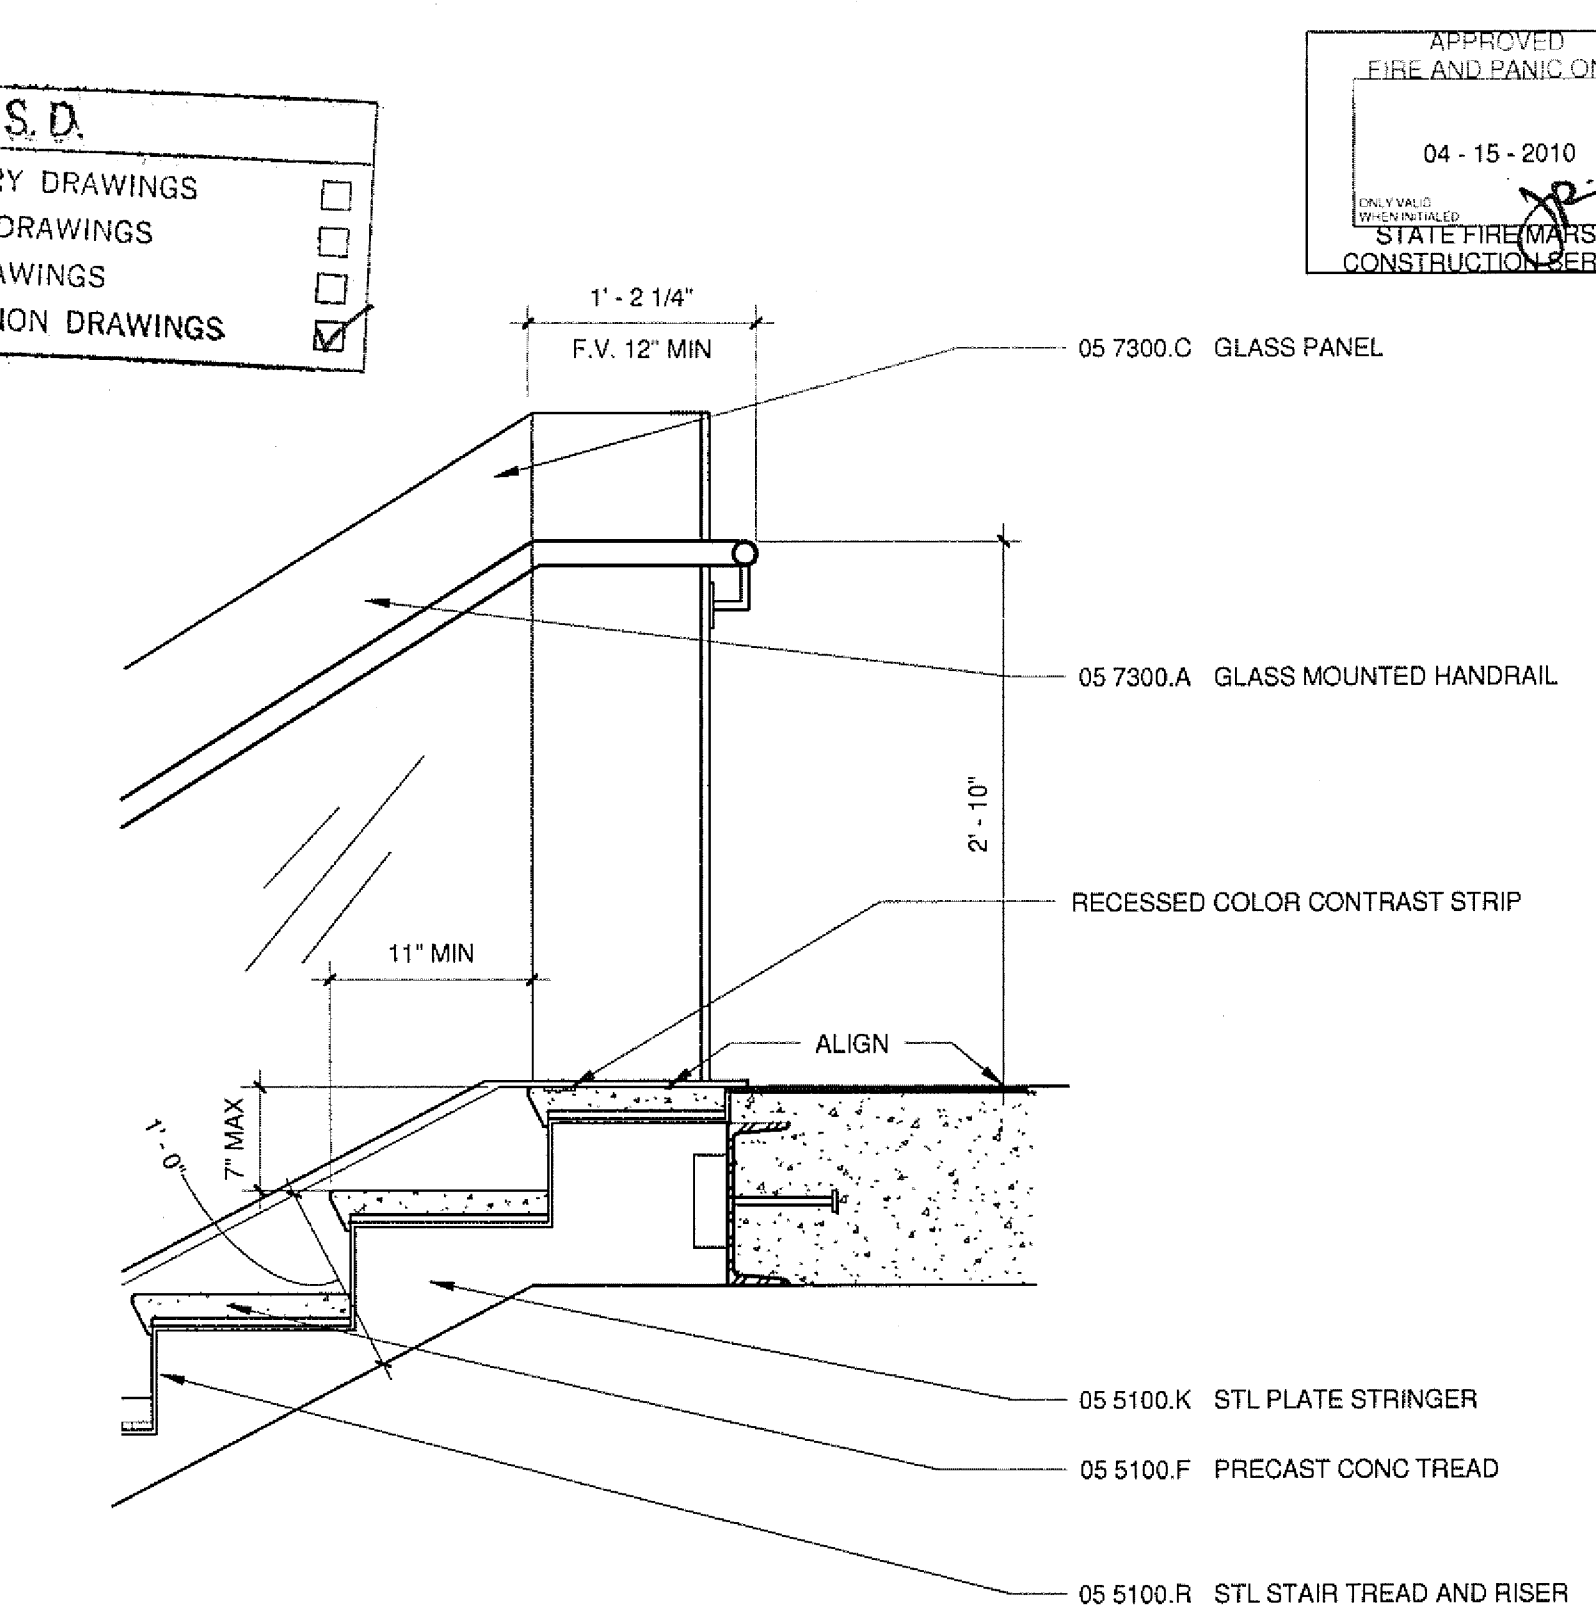


4 LANDING SECTION
A6303 | A6303 1" = 1'-0"

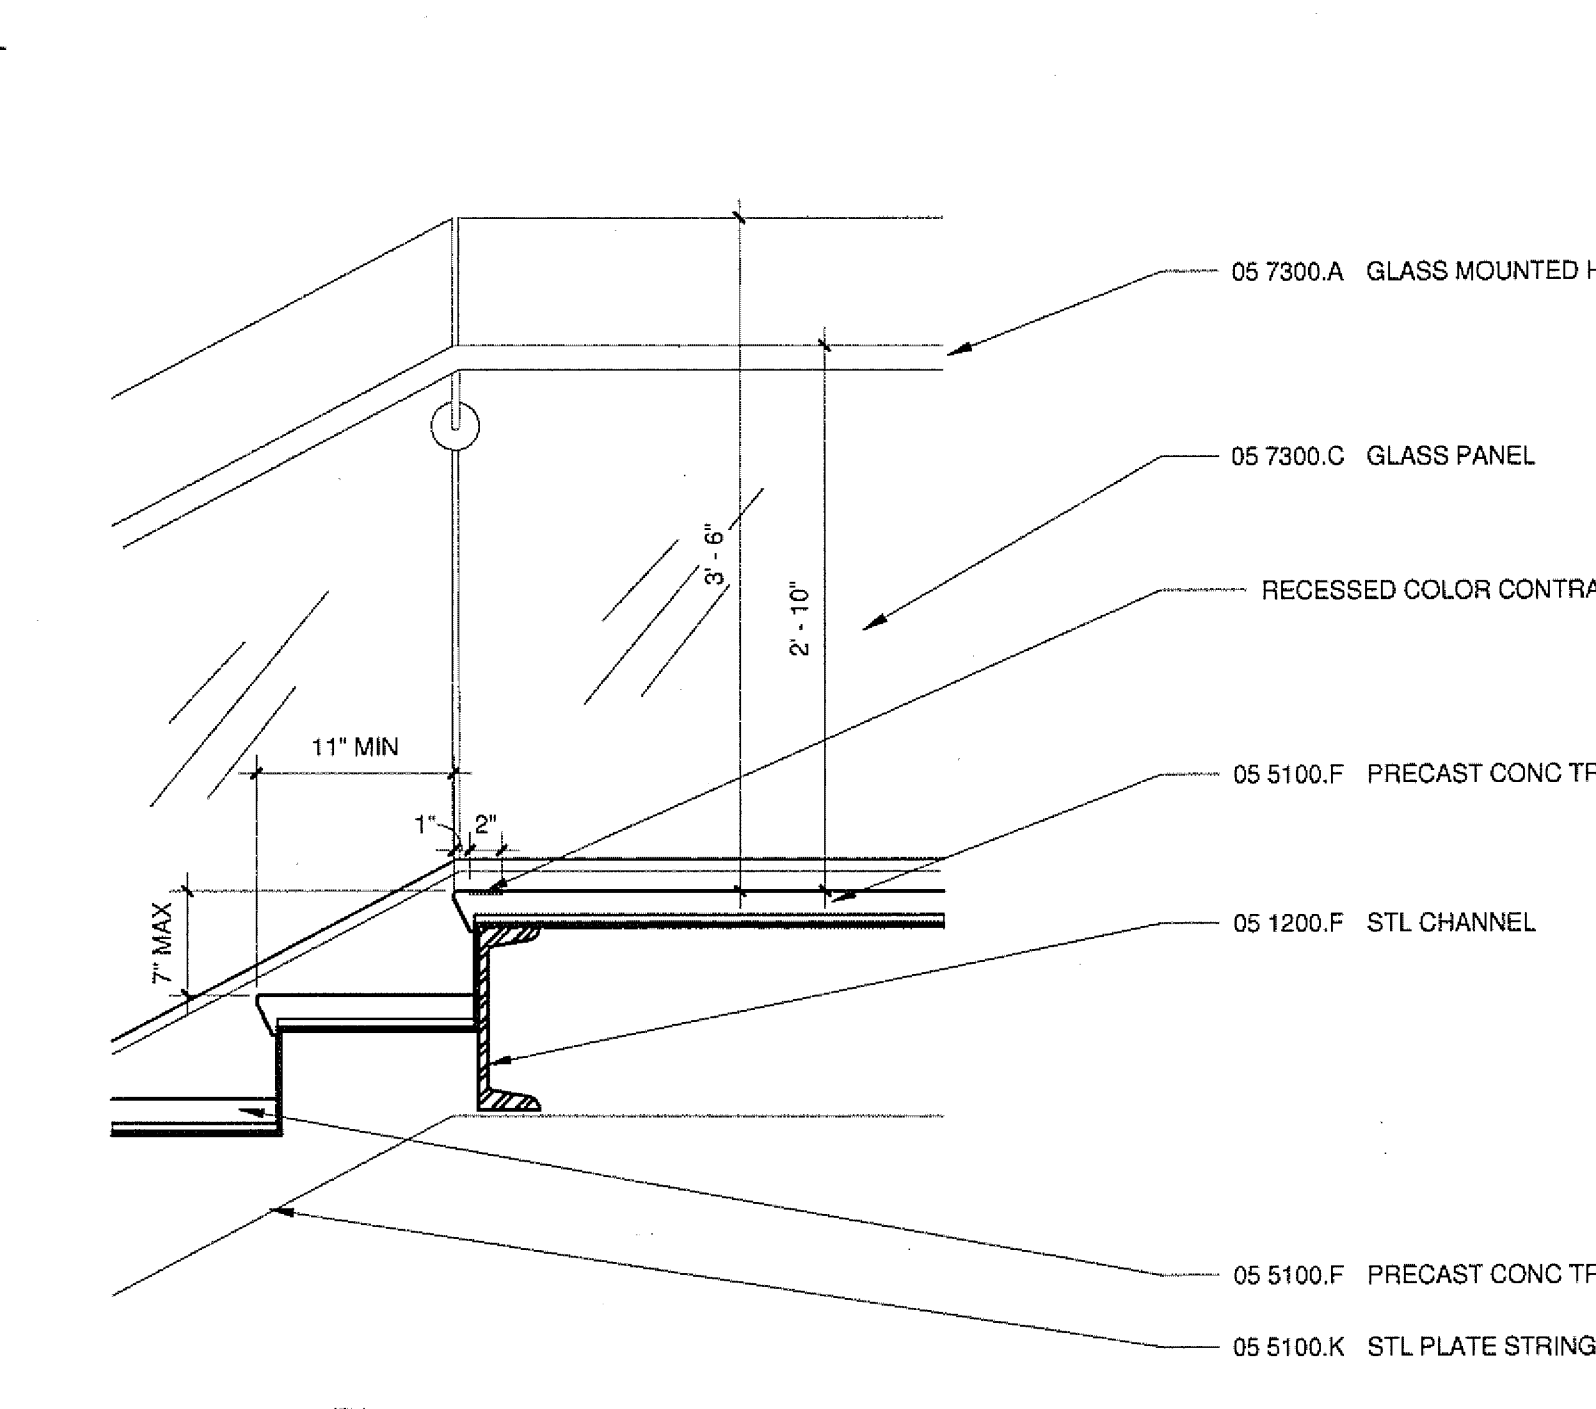

3 LANDING DETAIL
A6303 | A6303 1" = 1'-0"


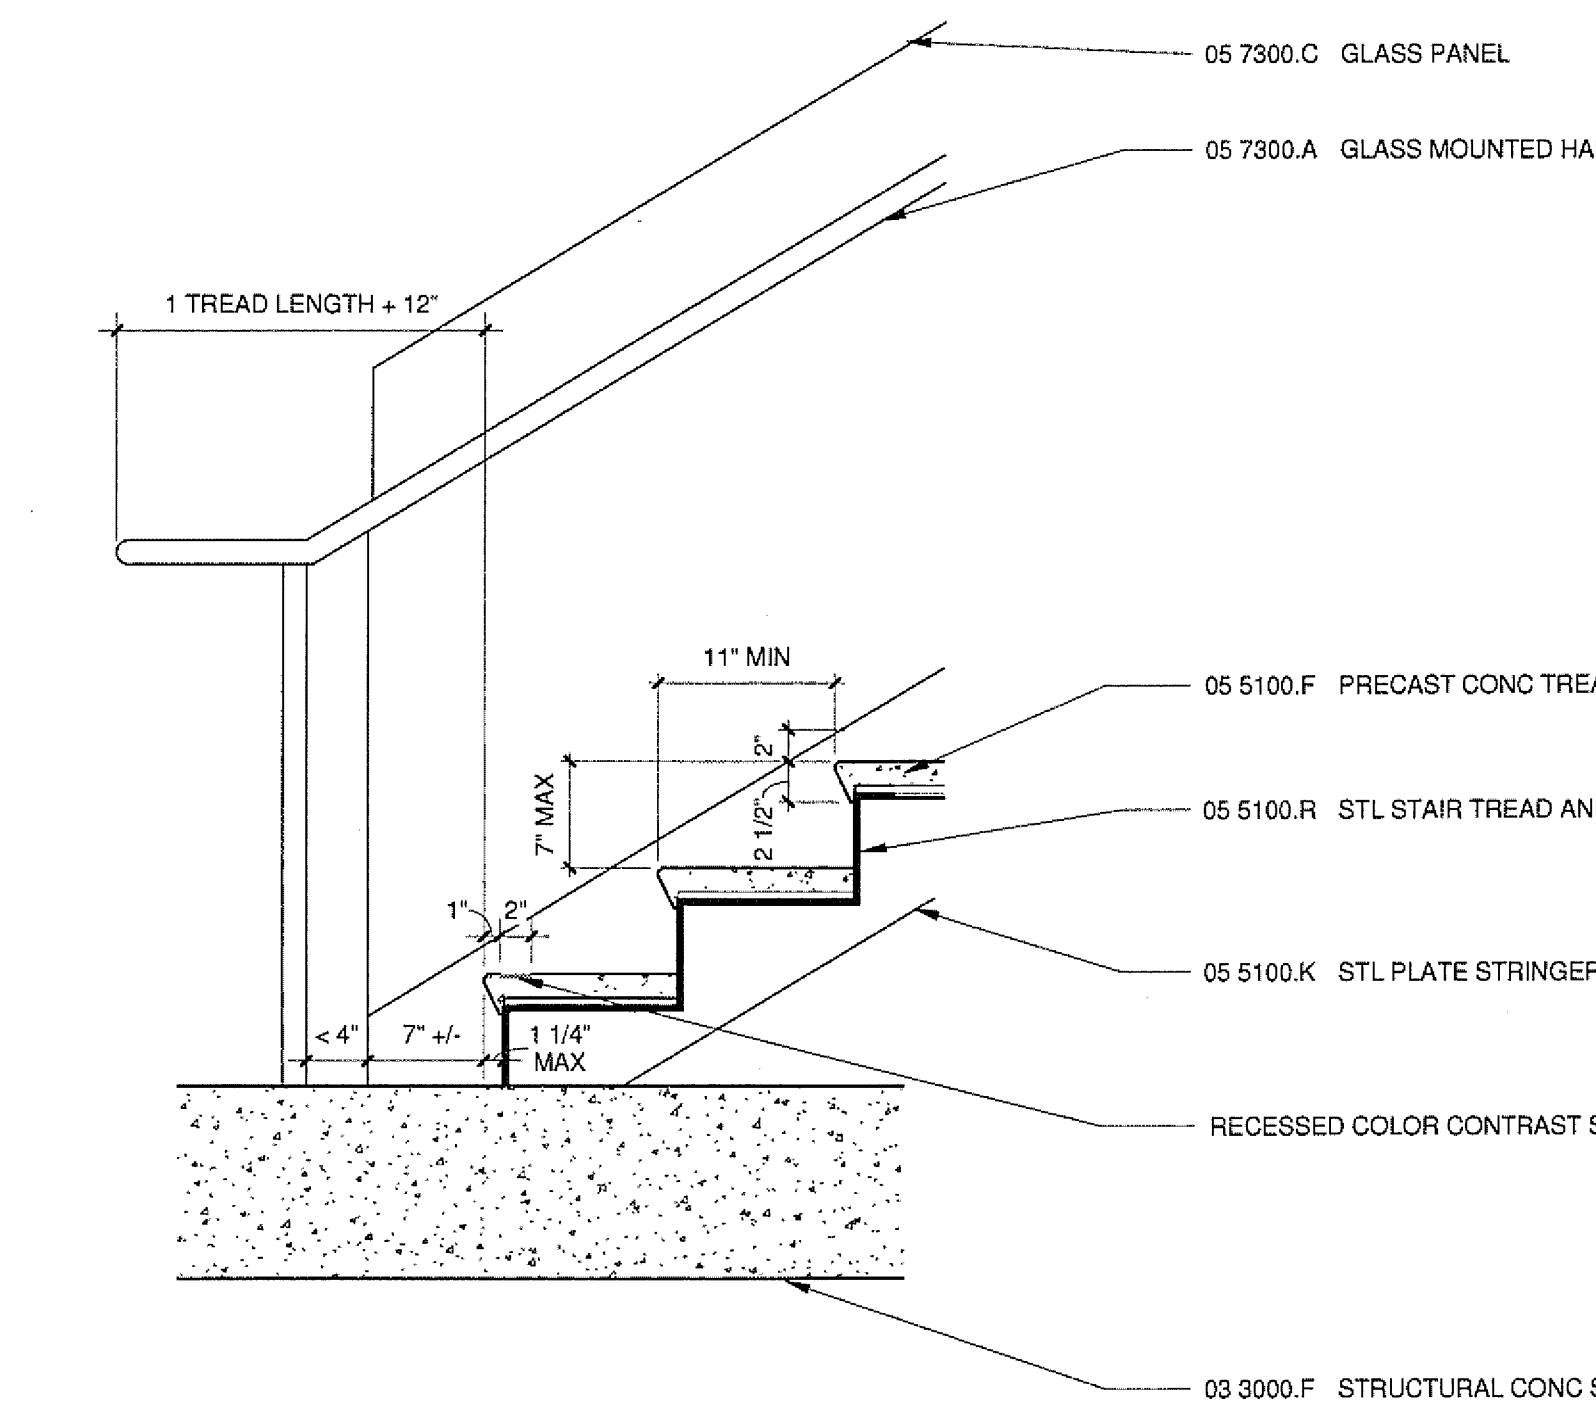


2 STAIR SECTION
A6301 | A6303 1" = 1'-0"

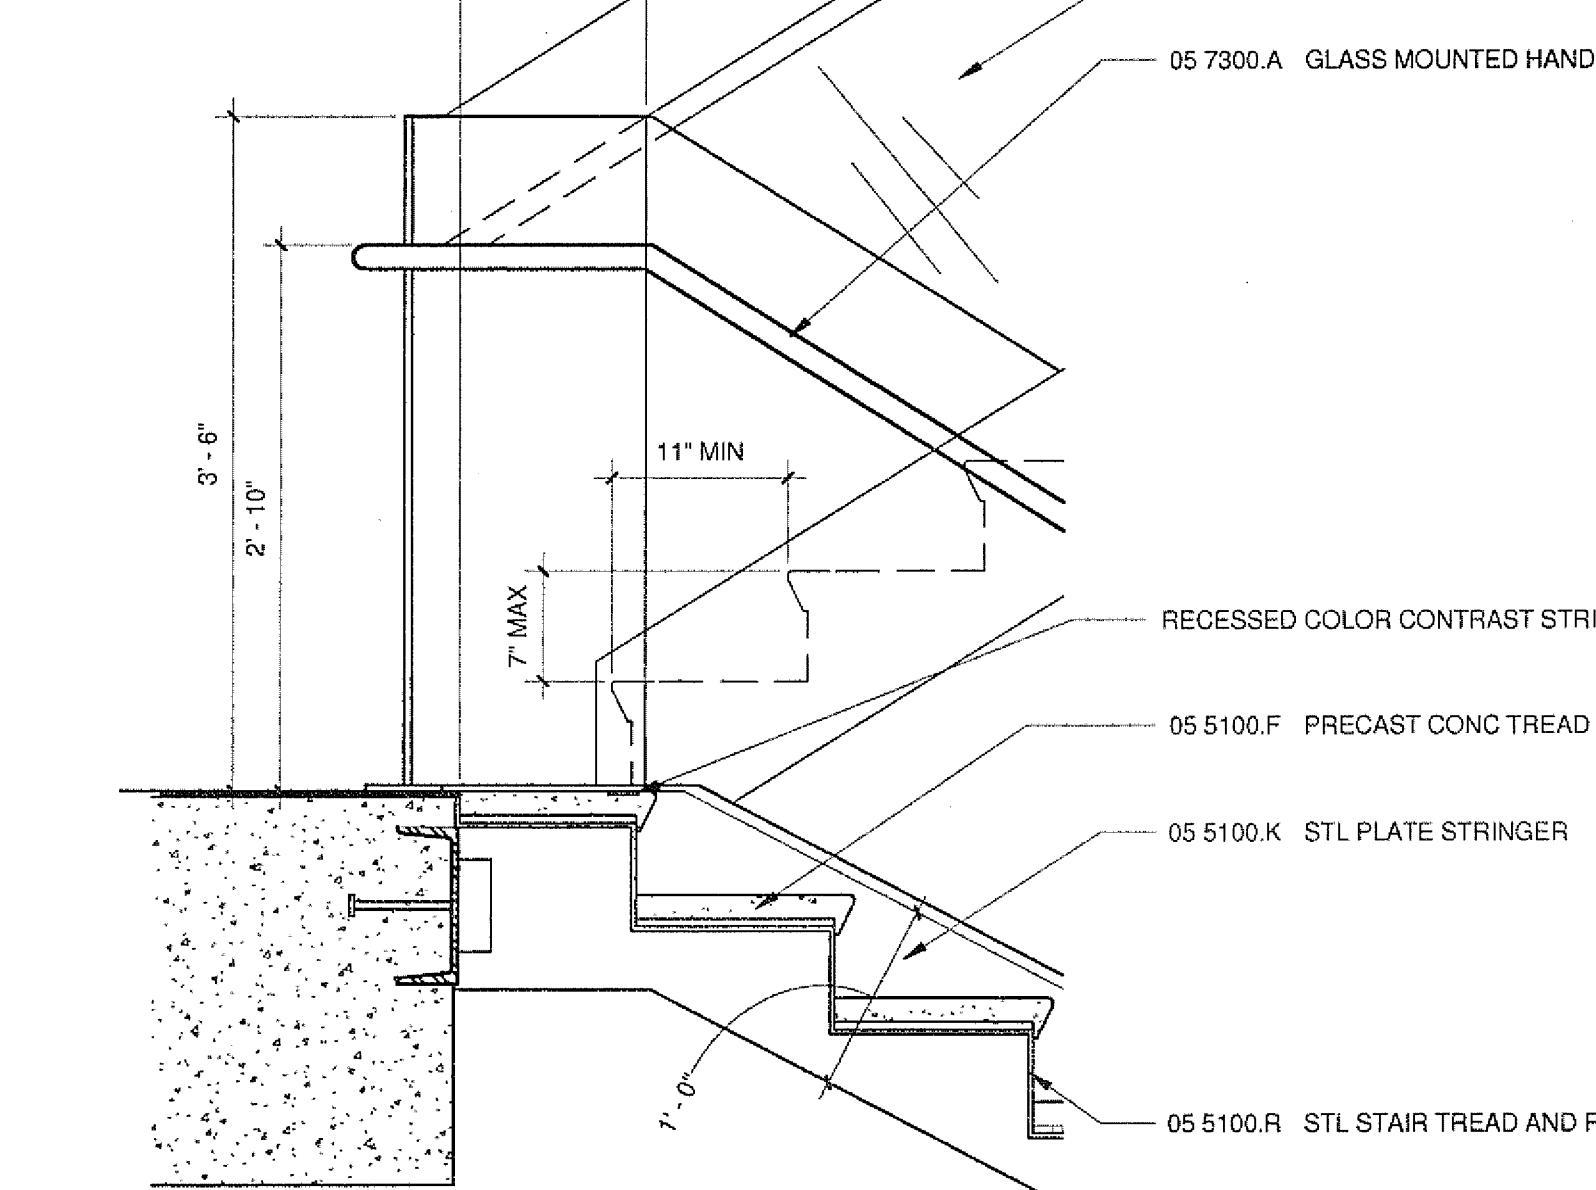

1 LANDING SECTION
A6302 | A6303 1" = 1'-0"

FOR ALL STAINLESS STEEL EXTERIOR STAIRS:
1/2" DIA. PRE-PUNCHED WEEP HOLES @ SS TREAD, 6 PER TREAD, TYP.
1/2" DIA. PRE-PUNCHED WEEP HOLES @ SS LANDING, TYP.

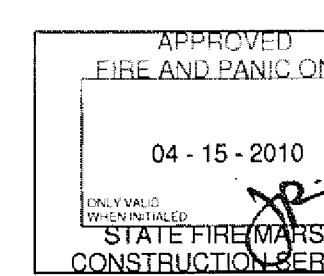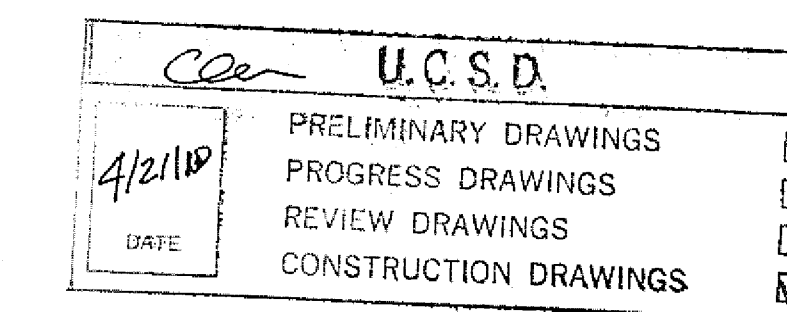

ISSUED FOR	DATE
ADA REVIEW	08.28.09
CD-3	01.07.10
RPT 0088	02.02.10

SANFORD CONSORTIUM FOR REGENERATIVE MEDICINE

2880 TORREY PINES SCENIC DRIVE
LA JOLLA, CALIFORNIA 92037



CONSULTANT

LandscapePhases Consortium, LLC
401 Broadway, Suite 200
San Francisco, CA 94111
(415) 774-0000

FENTRESS | ARCHITECTS
401 Broadway, Suite 200
San Francisco, CA 94111
(415) 774-0000

DAVIS | ARCHITECTS
401 Broadway, Suite 200
San Francisco, CA 94111
(415) 774-0000

STAMP
LICENSED ARCHITECT
Jeffrey W. Olson
No. C-31761
Exp. 03/31/11
J. Olson
SHEET NAME
STAIR DETAILS
DRAWN BY: Author
PROJECT #: 200725.000
SHEET NUMBER

A9303