

September 8, 2017

JN 17422

Capitol Hill Housing  
1620 – 12<sup>th</sup> Avenue  
Seattle, Washington 98122

Subject: **Transmittal Letter – Geotechnical Engineering Study**  
Proposed Helen V Apartments  
East Union Street  
Seattle, Washington

Dear Mr. Hall:

We are pleased to present this geotechnical engineering report for the proposed Apartment Building to be constructed in Seattle, Washington. The scope of our services consisted of exploring site surface and subsurface conditions, and then developing this report to provide recommendations for general earthwork and design criteria for foundations, retaining walls, pavements, and temporary shoring. This work was authorized by your acceptance of our proposal, P-9836, dated July 19, 2017.

The attached report contains a discussion of the study and our recommendations. Please contact us if there are any questions regarding this report, or for further assistance during the design and construction phases of this project.

Respectfully submitted,

GEOTECH CONSULTANTS, INC.



D. Robert Ward, P.E.  
Principal

DRW:

## **GEOTECHNICAL ENGINEERING STUDY**

**East Union Street  
Seattle, Washington**

This report presents the findings and recommendations of our geotechnical engineering study for the site of the proposed Apartments to be located in Seattle.

We were provided with some site plans that included topographic information and a site section. This information was prepared by Environmental Works dated October 2016. Based on these plans, we understand that the building will be constructed in what is now a parking lot of an existing apartment building.

If the scope of the project changes from what we have described above, we should be provided with revised plans in order to determine if modifications to the recommendations and conclusions of this report are warranted.

### **SITE CONDITIONS**

#### ***SURFACE***

The Vicinity Map, Plate 1, illustrates the general location of the site in the Capitol Hill area of Seattle. The rectangular site is located at the southwestern corner of 14<sup>th</sup> Avenue and East Union. It is also bordered to the west by a small alley. As noted earlier, the site is the parking lot of an apartment building that borders the southern side of the site. This parking lot slopes gently downward to the southwest. A small slope is between the parking lot and alley. Overall, the site drops downward about 8 to 9 feet. An apartment building is located on the western side of the adjacent alley.

#### ***SUBSURFACE***

The subsurface conditions were explored by drilling two test borings at the approximate locations shown on the Site Exploration Plan, Plate 2. Our exploration program was based on the proposed construction, anticipated subsurface conditions and those encountered during exploration, and the scope of work outlined in our proposal.

The test borings were drilled on August 24, 2017 using a track-mounted, hollow-stem auger drill. This drill system utilizes a small, gasoline-powered engine to advance a hollow-stem auger to the sampling depth. Samples were taken at approximate 5-foot intervals with a standard penetration sampler. This split-spoon sampler, which has a 2-inch outside diameter, is driven into the soil with a 140-pound hammer falling 30 inches. The number of blows required to advance the sampler a given distance is an indication of the soil density or consistency. A geotechnical engineer from our staff observed the drilling process, logged the test borings, and obtained representative samples of the soil encountered. The Test Boring Logs are attached as Plates 3 and 4.

### **Soil Conditions**

The southwestern test boring revealed about 3 feet of loose fill soil overlying loose, native silty sand soil. Medium-dense, silty/clay sand was revealed at approximately 5 feet in this lower, southwestern test boring, and within about 2 feet of the ground surface in the upper, northeastern test boring. Medium-dense to dense sand was revealed below this soil in the southwestern test boring to a depth of approximately 13 feet, which was then underlain by very dense, gravelly silty sand; this soil is known geologically as glacial till. In the northwestern test boring, the medium-dense silty/clayey sand was underlain by dense sand at about 7 feet and then the very dense glacial till at about 10 feet. The glacial till was revealed to the maximum explored depths of approximately 20 and 25 feet.

### **Groundwater Conditions**

No groundwater seepage was observed in the test borings were left open for only a short time period. Therefore, the lack of seepage may not indicate groundwater conditions. In addition, groundwater levels encountered during drilling can be deceptive, because seepage into the boring can be blocked or slowed by the auger itself. However, some wet soil lenses were encountered at various depths between 10 and 20 feet in the test borings.

It should be noted that groundwater levels vary seasonally with rainfall and other factors. It is possible that the wet lenses could have actual water flow in them during the winter and spring months when groundwater amounts are generally the greatest.

The stratification lines on the logs represent the approximate boundaries between soil types at the exploration locations. The actual transition between soil types may be gradual, and subsurface conditions can vary between exploration locations. The logs provide specific subsurface information only at the locations tested. Where a transition in soil type occurred between samples in the borings, the depth of the transition was interpreted. The relative densities and moisture descriptions indicated on the test boring logs are interpretive descriptions based on the conditions observed during drilling.

## **CONCLUSIONS AND RECOMMENDATIONS**

### **GENERAL**

*THIS SECTION CONTAINS A SUMMARY OF OUR STUDY AND FINDINGS FOR THE PURPOSES OF A GENERAL OVERVIEW ONLY. MORE SPECIFIC RECOMMENDATIONS AND CONCLUSIONS ARE CONTAINED IN THE REMAINDER OF THIS REPORT. ANY PARTY RELYING ON THIS REPORT SHOULD READ THE ENTIRE DOCUMENT.*

The test borings conducted for this study encountered medium-dense to dense sand and/or glacial till soils at depths of approximately 7 feet. Excavations needed for this project based on one level of underground parking will likely be in the range of 6 to 15 feet, this the planned excavations should reach this competent soil or very close to it; some possible minor overexcavation could be needed on the southeastern corner of the proposed building. The competent soils are, however, silty and thus are very sensitive to moisture. They can become softened if wet. Therefore, it may be necessary to protect bearing surfaces with a mat of imported, clean, angular material if they are wet or become wet at the time of foundation construction.

For excavations near property lines, vertical excavations should be limited to 2 feet in height. For other areas on the site not near the property lines, this can be increased to 4 feet. For excavations that are needed taller than this, the excavation inclinations noted in the subsequent **Excavations and Slopes** section of this should be followed. It appears that open excavations using these inclinations will not allow all excavations to be made within the property. It may be possible to obtain agreements with the neighboring property owners (SDOT) to extend the temporary excavations beyond the property limits. However, if this is not possible, then the need for shoring is would be the next alternative. The shoring should consist of cantilevered soldier piles. We believe the piles could be installed with either drilled-hole or driven methods. The excavations depths noted in the preceding paragraph should be used for the design excavation depth of the shoring.

The erosion control measures needed during the site development will depend heavily on the weather conditions that are encountered. We anticipate that a silt fence will be needed around the downslope sides of any cleared areas. Existing pavements, ground cover, and landscaping should be left in place wherever possible to minimize the amount of exposed soil. Rocked staging areas and construction access roads should be provided to reduce the amount of soil or mud carried off the property by trucks and equipment. Wherever possible, the access roads should follow the alignment of planned pavements. Trucks should not be allowed to drive off of the rock-covered areas. Cut slopes and soil stockpiles should be covered with plastic during wet weather. Following clearing or rough grading, it may be necessary to mulch or hydroseed bare areas that will not be immediately covered with landscaping or an impervious surface. On most construction projects, it is necessary to periodically maintain or modify temporary erosion control measures to address specific site and weather conditions.

The drainage and/or waterproofing recommendations presented in this report are intended only to prevent active seepage from flowing through concrete walls or slabs. Even in the absence of active seepage into and beneath structures, water vapor can migrate through walls, slabs, and floors from the surrounding soil, and can even be transmitted from slabs and foundation walls due to the concrete curing process. Water vapor also results from occupant uses, such as cooking and bathing. Excessive water vapor trapped within structures can result in a variety of undesirable conditions, including, but not limited to, moisture problems with flooring systems, excessively moist air within occupied areas, and the growth of molds, fungi, and other biological organisms that may be harmful to the health of the occupants. The designer or architect must consider the potential vapor sources and likely occupant uses, and provide sufficient ventilation, either passive or mechanical, to prevent a build-up of excessive water vapor within the planned structure.

Geotech Consultants, Inc. should be allowed to review the final development plans to verify that the recommendations presented in this report are adequately addressed in the design. Such a plan review would be additional work beyond the current scope of work for this study, and it may include revisions to our recommendations to accommodate site, development, and geotechnical constraints that become more evident during the review process.

We recommend including this report, in its entirety, in the project contract documents. This report should also be provided to any future property owners so they will be aware of our findings and recommendations.

## **SEISMIC CONSIDERATIONS**

In accordance with the Seattle Building Code (SBC), the site class within 100 feet of the ground surface is best represented by Site Class Type D (Stiff Soil). As noted in the USGS website, the mapped spectral acceleration value for a 0.2 second ( $S_s$ ) and 1.0 second period ( $S_1$ ) equals 1.35g and 0.52g, respectively.

The SBC and ASCE 7 require that the potential for liquefaction (soil strength loss) be evaluated for the peak ground acceleration of the Maximum Considered Earthquake (MCE), which has a probability of occurring once in 2,475 years (2 percent probability of occurring in a 50-year period). The MCE peak ground acceleration is adjusted for site class effects ( $F_{PGA}$ ) and equals 0.55g. The soils beneath the site are not susceptible to/have a low potential for seismic liquefaction under the ground motions of the MCE (because of their dense nature (and/or) the absence of near-surface groundwater).

Sections 1803.5 of the SBC and 11.8 of ASCE 7 require that other seismic-related geotechnical design parameters (seismic surcharge for retaining wall design and slope stability) include the potential effects of the Design Earthquake. The peak ground acceleration for the Design Earthquake is defined in Section 11.2 of ASCE 7 as two-thirds ( $2/3$ ) of the MCE peak ground acceleration, or 0.36g.

## **CONVENTIONAL FOUNDATIONS**

The proposed structure can be supported on conventional continuous and spread footings bearing on undisturbed, medium-dense to dense, or denser, native sandy soils. Some minor overexcavations may be needed on the southwestern corner of the building to reach these competent soils. We recommend that continuous and individual spread footings have minimum widths of 16 and 24 inches, respectively. Exterior footings should also be bottomed at least 18 inches below the lowest adjacent finish ground surface for protection against frost and erosion. The local building codes should be reviewed to determine if different footing widths or embedment depths are required. Footing subgrades must be cleaned of loose or disturbed soil prior to pouring concrete. Depending upon site and equipment constraints, this may require removing the disturbed soil by hand.

An allowable bearing pressure of 5,000 pounds per square foot (psf) is appropriate for footings supported on competent native soil. A one-third increase in this design bearing pressure may be used when considering short-term wind or seismic loads. For the above design criteria, it is anticipated that the total post-construction settlement of footings founded on competent native soil, will be about one inch, with differential settlements on the order of one-half inch in a distance of 50 feet along a continuous footing with a uniform load.

Lateral loads due to wind or seismic forces may be resisted by friction between the foundation and the bearing soil, or by passive earth pressure acting on the vertical, embedded portions of the foundation. For the latter condition, the foundation must be either poured directly against relatively level, undisturbed soil or be surrounded by level, well-compacted fill.

We recommend using the following ultimate values for the foundation's resistance to lateral loading:

PARAMETER	ULTIMATE VALUE
Coefficient of Friction	0.50
Passive Earth Pressure	300 pcf

Where: pcf is Pounds per Cubic Foot, and Passive Earth Pressure is computed using the Equivalent Fluid Density.

If the ground in front of a foundation is loose or sloping, the passive earth pressure given above will not be appropriate. We recommend maintaining a safety factor of at least 1.5 for the foundation's resistance to lateral loading, when using the above ultimate values.

### **FOUNDATION AND RETAINING WALLS**

Retaining walls backfilled on only one side should be designed to resist the lateral earth pressures imposed by the soil they retain. The following recommended parameters are for walls that restrain level backfill:

PARAMETER	VALUE
Active Earth Pressure *	35 pcf
Passive Earth Pressure	300 pcf
Coefficient of Friction	0.50
Soil Unit Weight	130 pcf

Where: pcf is Pounds per Cubic Foot, and Active and Passive Earth Pressures are computed using the Equivalent Fluid Pressures.

\* For a restrained wall that cannot deflect at least 0.002 times its height, a uniform lateral pressure equal to 10 psf times the height of the wall should be added to the above active equivalent fluid pressure.

The design values given above do not include the effects of any hydrostatic pressures behind the walls and assume that no surcharges, such as those caused by slopes, vehicles, or adjacent foundations will be exerted on the walls. If these conditions exist, those pressures should be added to the above lateral soil pressures. Where sloping backfill is desired behind the walls, we will need to be given the wall dimensions and the slope of the backfill in order to provide the appropriate design earth pressures. The surcharge due to traffic loads behind a wall can typically be accounted for by adding a uniform pressure equal to 2 feet multiplied by the above active fluid density. Heavy construction equipment should not be operated behind retaining and foundation walls within a distance equal to the height of a wall, unless the walls are designed for the additional lateral pressures resulting from the equipment.

The values given above are to be used to design only permanent foundation and retaining walls that are to be backfilled, such as conventional walls constructed of reinforced concrete or masonry. It is not appropriate to use the above earth pressures and soil unit weight to back-calculate soil

strength parameters for design of other types of retaining walls, such as soldier pile, reinforced earth, modular or soil nail walls. We can assist with design of these types of walls, if desired. The passive pressure given is appropriate only for a shear key poured directly against undisturbed native soil, or for the depth of level, well-compacted fill placed in front of a retaining or foundation wall. The values for friction and passive resistance are ultimate values and do not include a safety factor. Restrained wall soil parameters should be utilized for a distance of 1.5 times the wall height from corners or bends in the walls. This is intended to reduce the amount of cracking that can occur where a wall is restrained by a corner.

### **Wall Pressures Due to Seismic Forces**

The surcharge wall loads that could be imposed by the design earthquake can be modeled by adding a uniform lateral pressure to the above-recommended active pressure. The recommended surcharge pressure is  $8H$  pounds per square foot (psf), where  $H$  is the design retention height of the wall. Using this increased pressure, the safety factor against sliding and overturning can be reduced to 1.2 for the seismic analysis.

### **Retaining Wall Backfill and Waterproofing**

Backfill placed behind retaining or foundation walls should be coarse, free-draining structural fill containing no organics. This backfill should contain no more than 5 percent silt or clay particles and have no gravel greater than 4 inches in diameter. The percentage of particles passing the No. 4 sieve should be between 25 and 70 percent. If the native sand is used as backfill, a drainage composite similar to Miradrain 6000 should be placed against the backfilled retaining walls. The drainage composites should be hydraulically connected to the foundation drain system. Free-draining backfill or gravel should be used for the entire width of the backfill where seepage is encountered. The later section entitled **Drainage Considerations** should also be reviewed for recommendations related to subsurface drainage behind foundation and retaining walls.

The purpose of these backfill requirements is to ensure that the design criteria for a retaining wall are not exceeded because of a build-up of hydrostatic pressure behind the wall. Also, subsurface drainage systems are not intended to handle large volumes of water from surface runoff. The top 12 to 18 inches of the backfill should consist of a compacted, relatively impermeable soil or topsoil, or the surface should be paved. The ground surface must also slope away from backfilled walls to reduce the potential for surface water to percolate into the backfill. Water percolating through pervious surfaces (pavers, gravel, permeable pavement, etc.) must also be prevented from flowing toward walls or into the backfill zone. The compacted subgrade below pervious surfaces and any associated drainage layer should therefore be sloped away. Alternatively, a membrane and subsurface collection system could be provided below a pervious surface.

It is critical that the wall backfill be placed in lifts and be properly compacted, in order for the above-recommended design earth pressures to be appropriate. The wall design criteria assume that the backfill will be well-compacted in lifts no thicker than 12 inches. The compaction of backfill near the walls should be accomplished with hand-operated equipment to prevent the walls from being overloaded by the higher soil forces that occur during compaction. The section entitled **General Earthwork and Structural Fill** contains additional recommendations regarding the placement and compaction of structural fill behind retaining and foundation walls.

The above recommendations are not intended to waterproof below-grade walls, or to prevent the formation of mold, mildew or fungi in interior spaces. Over time, the performance of subsurface drainage systems can degrade, subsurface groundwater flow patterns can change, and utilities can break or develop leaks. Therefore, waterproofing should be provided where future seepage through the walls is not acceptable. This typically includes limiting cold-joints and wall penetrations, and using bentonite panels or membranes on the outside of the walls. There are a variety of different waterproofing materials and systems, which should be installed by an experienced contractor familiar with the anticipated construction and subsurface conditions. Applying a thin coat of asphalt emulsion to the outside face of a wall is not considered waterproofing, and will only help to reduce moisture generated from water vapor or capillary action from seeping through the concrete. As with any project, adequate ventilation of basement and crawl space areas is important to prevent a build-up of water vapor that is commonly transmitted through concrete walls from the surrounding soil, even when seepage is not present. This is appropriate even when waterproofing is applied to the outside of foundation and retaining walls. We recommend that you contact an experienced envelope consultant if detailed recommendations or specifications related to waterproofing design, or minimizing the potential for infestations of mold and mildew are desired.

The **General**, **Slabs-On-Grade**, and **Drainage Considerations** sections should be reviewed for additional recommendations related to the control of groundwater and excess water vapor for the anticipated construction.

## **SLABS-ON-GRADE**

The building floors can be constructed as slabs-on-grade atop competent native soil or on structural fill. The subgrade soil must be in a firm, non-yielding condition at the time of slab construction or underslab fill placement. Any soft areas encountered should be excavated and replaced with select, imported structural fill.

Even where the exposed soils appear dry, water vapor will tend to naturally migrate upward through the soil to the new constructed space above it. This can affect moisture-sensitive flooring, cause imperfections or damage to the slab, or simply allow excessive water vapor into the space above the slab. All interior slabs-on-grade should be underlain by a capillary break drainage layer consisting of a minimum 4-inch thickness of clean gravel or crushed rock that has a fines content (percent passing the No. 200 sieve) of less than 3 percent and a sand content (percent passing the No. 4 sieve) of no more than 10 percent. Pea gravel or crushed rock are typically used for this layer.

As noted by the American Concrete Institute (ACI) in the *Guides for Concrete Floor and Slab Structures*, proper moisture protection is desirable immediately below any on-grade slab that will be covered by tile, wood, carpet, impermeable floor coverings, or any moisture-sensitive equipment or products. ACI also notes that vapor *retarders* such as 6-mil plastic sheeting have been used in the past, but are now recommending a minimum 10-mil thickness for better durability and long term performance. A vapor retarder is defined as a material with a permeance of less than 0.3 perms, as determined by ASTM E 96. It is possible that concrete admixtures may meet this specification, although the manufacturers of the admixtures should be consulted. Where vapor retarders are used under slabs, their edges should overlap by at least 6 inches and be sealed with adhesive tape. The sheeting should extend to the foundation walls for maximum vapor protection. If no potential for vapor passage through the slab is desired, a vapor *barrier* should be used. A vapor



barrier, as defined by ACI, is a product with a water transmission rate of 0.01 perms when tested in accordance with ASTM E 96. Reinforced membranes having sealed overlaps can meet this requirement.

We recommend that the contractor, the project materials engineer, and the owner discuss these issues and review recent ACI literature and ASTM E-1643 for installation guidelines and guidance on the use of the protection/blotter material.

The **General, Permanent Foundation and Retaining Walls**, and **Drainage Considerations** sections should be reviewed for additional recommendations related to the control of groundwater and excess water vapor for the anticipated construction.

### **EXCAVATIONS AND SLOPES**

Excavation slopes should not exceed the limits specified in local, state, and national government safety regulations. Temporary cuts to a depth of about 4 feet may be attempted vertically in unsaturated soil, if there are no indications of slope instability. However, vertical cuts should not be made near property boundaries, or existing utilities and structures. Based upon Washington Administrative Code (WAC) 296, Part N, the upper soil at the subject site would generally be classified as Type B, while the dense to very dense sand and glacial till soil would be classified as A. Therefore, temporary cut slopes greater than 4 feet in height should not be excavated at an inclination steeper than 1:1 or 0.75:1 (Horizontal:Vertical), respectively, extending continuously between the top and the bottom of a cut.

The above-recommended temporary slope inclinations are based on the conditions exposed in our explorations, and on what has been successful at other sites with similar soil conditions. It is possible that variations in soil and groundwater conditions will require modifications to the inclination at which temporary slopes can stand. Temporary cuts are those that will remain unsupported for a relatively short duration to allow for the construction of foundations, retaining walls, or utilities. Temporary cut slopes should be protected with plastic sheeting during wet weather. It is also important that surface runoff be directed away from the top of temporary slope cuts. Cut slopes should also be backfilled or retained as soon as possible to reduce the potential for instability. Please note that loose soil can cave suddenly and without warning. Excavation, foundation, and utility contractors should be made especially aware of this potential danger. These recommendations may need to be modified if the area near the potential cuts has been disturbed in the past by utility installation, or if settlement-sensitive utilities are located nearby.

Water should not be allowed to flow uncontrolled over the top of any temporary or permanent slope. All permanently exposed slopes should be seeded with an appropriate species of vegetation to reduce erosion and improve the stability of the surficial layer of soil.

### **TEMPORARY SHORING**

This section discusses cantilevered soldier-pile systems. These systems have proven to be an efficient and economical method for providing excavation shoring where the depth of excavation is less than 15 feet.

The design heights of the shoring were discussed in the earlier **General** section of this report and should be reviewed in addition to this section. In addition, we recommend that a safety factor of 1.2 be used in the design of the temporary shoring.

### ***Soldier Pile Installation***

Soldier pile walls would be constructed by setting steel H-beams in a drilled hole and grouting the space between the beam and the soil with concrete for the entire height of the drilled hole. We anticipate that the holes could be drilled without casing, but the contractor should be prepared to case the holes or use the slurry method if caving soil is encountered. Excessive ground loss in the drilled holes must be avoided to reduce the potential for settlement on adjacent properties. If water is present in a hole at the time the soldier pile is poured, concrete must be tremied to the bottom of the hole.

As excavation proceeds downward, the space between the piles should be lagged with timber, and any voids behind the timbers should be filled with pea gravel, or a slurry comprised of sand and fly ash. Treated lagging is usually required for permanent walls, while untreated lagging can often be utilized for temporary shoring walls. Temporary vertical cuts will be necessary between the soldier piles for the lagging placement. The prompt and careful installation of lagging is important, particularly in loose or caving soil, to maintain the integrity of the excavation and provide safer working conditions. Additionally, care must be taken by the excavator to remove no more soil between the soldier piles than is necessary to install the lagging. Caving or overexcavation during lagging placement could result in loss of ground on neighboring properties. Timber lagging should be designed for an applied lateral pressure of 30 percent of the design wall pressure, if the pile spacing is less than three pile diameters. For larger pile spacings, the lagging should be designed for 50 percent of the design load.

### ***Soldier Pile Wall Design***

Temporary soldier pile shoring that is cantilevered and that has a level backslope should be designed for an active soil pressure equal to that pressure exerted by an equivalent fluid with a unit weight of 30 pounds per cubic foot (pcf). It is important that the shoring design provides sufficient working room to drill and install the soldier piles, without needing to make unsafe, excessively steep temporary cuts. Cut slopes should be planned to intersect the backside of the drilled holes, not the back of the lagging.

Lateral movement of the soldier piles below the excavation level will be resisted by an ultimate passive soil pressure equal to that pressure exerted by a fluid with a density of 600 pcf. This soil pressure is valid only for a level excavation in front of the soldier pile; it acts on two times the grouted pile diameter. Cut slopes made in front of shoring walls significantly decrease the passive resistance. The minimum embedment below the floor of the excavation for cantilever soldier piles should be equal to the height of the "stick-up."

## **EXCAVATION AND SHORING MONITORING**

As with any shoring system, there is a potential risk of greater-than-anticipated movement of the shoring and the ground outside of the excavation. This can translate into noticeable damage of surrounding on-grade elements, such as foundations and slabs. Therefore, we recommend making an extensive photographic and visual survey of the project vicinity, prior to demolition activities, installing shoring or commencing excavation. This documents the condition of buildings, pavements, and utilities in the immediate vicinity of the site in order to avoid, and protect the owner from, unsubstantiated damage claims by surrounding property owners.

Additionally, the shoring walls should be monitored during construction to detect soil movements. To monitor their performance, we recommend establishing a series of survey reference points to measure any horizontal deflections of the shoring system. Control points should be established at a distance well away from the walls and slopes, and deflections from the reference points should be measured throughout construction by survey methods. At least at least 33 percent of the soldier piles should be monitored by taking readings at the top of the pile. Additionally, benchmarks installed on the surrounding buildings should be monitored for at least vertical movement. We suggest taking the readings at least once a week, until it is established that no deflections are occurring. The initial readings for this monitoring should be taken before starting any demolition or excavation on the site.

## **DRAINAGE CONSIDERATIONS**

It is possible that permanent foundation walls will be constructed against the shoring walls. Where this occurs, a plastic-backed drainage composite, such as Miradrain, Battledrain, or similar, should be placed against the entire surface of the shoring prior to pouring the foundation wall. Weep pipes located no more than 6 feet on-center should be connected to the drainage composite and poured into the foundation walls or the perimeter footing. A footing drain installed along the inside of the perimeter footing will be used to collect and carry the water discharged by the weep pipes to the storm system. Isolated zones of moisture or seepage can still reach the permanent wall where groundwater finds leaks or joints in the drainage composite. This is often an acceptable risk in unoccupied below-grade spaces, such as parking garages. However, formal waterproofing is typically necessary in areas where wet conditions at the face of the permanent wall will not be tolerable. If this is a concern, the permanent drainage and waterproofing system should be designed by a specialty consultant familiar with the expected subsurface conditions and proposed construction. A typical footing drain where shoring is used is shown on Plate 5.

Footing drains placed inside the building or behind backfilled walls should consist of 4-inch, perforated PVC pipe surrounded by at least 6 inches of 1-inch-minus, washed rock wrapped in a non-woven, geotextile filter fabric (Mirafi 140N, Supac 4NP, or similar material). At its highest point, a perforated pipe invert should be at least 6 inches below the level of a crawl space or the bottom of a floor slab, and it should be sloped slightly for drainage. All roof and surface water drains must be kept separate from the foundation drain system. A typical, non-shoring footing drain detail is attached to this report as Plate 6. For the best long-term performance, perforated PVC pipe is recommended for all subsurface drains.

If the structure includes an elevator, it may be necessary to provide special drainage or waterproofing measures for the elevator pit. If no seepage into the elevator pit is acceptable, it will be necessary to provide a footing drain and free-draining wall backfill, and the walls should be waterproofed. If the footing drain will be too low to connect to the storm drainage system, then it will

likely be necessary to install a pumped sump to discharge the collected water. Alternatively, the elevator pit could be designed to be entirely waterproof; this would include designing the pit structure to resist hydrostatic uplift pressures.

As a minimum, a vapor retarder, as defined in the **Slabs-On-Grade** section, should be provided in any crawl space area to limit the transmission of water vapor from the underlying soils. Crawl space grades are sometimes left near the elevation of the bottom of the footings. As a result, an outlet drain is recommended for all crawl spaces to prevent an accumulation of any water that may bypass the footing drains. Providing even a few inches of free draining gravel underneath the vapor retarder limits the potential for seepage to build up on top of the vapor retarder.

No groundwater was observed during our field work, but wet lenses were. If seepage is encountered in an excavation, it should be drained from the site by directing it through drainage ditches, perforated pipe, or French drains, or by pumping it from sumps interconnected by shallow connector trenches at the bottom of the excavation.

The excavation and site should be graded so that surface water is directed off the site and away from the tops of slopes. Water should not be allowed to stand in any area where foundations, slabs, or pavements are to be constructed. Final site grading in areas adjacent to buildings should slope away at least 2 percent, except where the area is paved. Surface drains should be provided where necessary to prevent ponding of water behind foundation or retaining walls. A discussion of grading and drainage related to pervious surfaces near walls and structures is contained in the **Foundation and Retaining Walls** section

## **GENERAL EARTHWORK AND STRUCTURAL FILL**

All building and pavement areas should be stripped of surface vegetation, topsoil, organic soil, and other deleterious material. The stripped or removed materials should not be mixed with any materials to be used as structural fill, but they could be used in non-structural areas, such as landscape beds.

Structural fill is defined as any fill, including utility backfill, placed under, or close to, a building, behind permanent retaining or foundation walls, or in other areas where the underlying soil needs to support loads. All structural fill should be placed in horizontal lifts with a moisture content at, or near, the optimum moisture content. The optimum moisture content is that moisture content that results in the greatest compacted dry density. The moisture content of fill is very important and must be closely controlled during the filling and compaction process.

The allowable thickness of the fill lift will depend on the material type selected, the compaction equipment used, and the number of passes made to compact the lift. The loose lift thickness should not exceed 12 inches. We recommend testing the fill as it is placed. If the fill is not sufficiently compacted, it can be recompacted before another lift is placed. This eliminates the need to remove the fill to achieve the required compaction.

The following table presents recommended relative compactions for structural fill:

<b>LOCATION OF FILL PLACEMENT</b>	<b>MINIMUM RELATIVE COMPACTION</b>
Beneath footings, slabs or walkways	95%
Filled slopes and behind retaining walls	90%
Beneath pavements	95% for upper 12 inches of subgrade; 90% below that level

Where: Minimum Relative Compaction is the ratio, expressed in percentages, of the compacted dry density to the maximum dry density, as determined in accordance with ASTM Test Designation D 1557-91 (Modified Proctor).

Structural fill that will be placed in wet weather should consist of a coarse, granular soil with a silt or clay content of no more than 5 percent. The percentage of particles passing the No. 200 sieve should be measured from that portion of soil passing the three-quarter-inch sieve.

### **LIMITATIONS**

The conclusions and recommendations contained in this report are based on site conditions as they existed at the time of our exploration and assume that the soil and groundwater conditions encountered in the test borings are representative of subsurface conditions on the site. If the subsurface conditions encountered during construction are significantly different from those observed in our explorations, we should be advised at once so that we can review these conditions and reconsider our recommendations where necessary. Unanticipated conditions are commonly encountered on construction sites and cannot be fully anticipated by merely taking samples in test pits borings. Subsurface conditions can also vary between exploration locations. Such unexpected conditions frequently require making additional expenditures to attain a properly constructed project. It is recommended that the owner consider providing a contingency fund to accommodate such potential extra costs and risks. This is a standard recommendation for all projects.

This report has been prepared for the exclusive use of Capitol Hill Housing and its representatives for specific application to this project and site. Our conclusions and recommendations are professional opinions derived in accordance with our understanding of current local standards of practice, and within the scope of our services. No warranty is expressed or implied. The scope of our services does not include services related to construction safety precautions, and our recommendations are not intended to direct the contractor's methods, techniques, sequences, or procedures, except as specifically described in our report for consideration in design. Our services also do not include assessing or minimizing the potential for biological hazards, such as mold, bacteria, mildew and fungi in either the existing or proposed site development.

### **ADDITIONAL SERVICES**

Geotech Consultants, Inc. should be retained to provide geotechnical consultation, testing, and observation services during construction. This is to confirm that subsurface conditions are consistent with those indicated by our exploration, to evaluate whether earthwork and foundation construction activities comply with the general intent of the recommendations presented in this report, and to provide suggestions for design changes in the event subsurface conditions differ from those anticipated prior to the start of construction. However, our work would not include the supervision or direction of the actual work of the contractor and its employees or agents. Also, job and site safety, and dimensional measurements, will be the responsibility of the contractor.

During the construction phase, we will provide geotechnical observation and testing services when requested by you or your representatives. Please be aware that we can only document site work we actually observe. It is still the responsibility of your contractor or on-site construction team to verify that our recommendations are being followed, whether we are present at the site or not.


The following plates are attached to complete this report:

Plate 1	Vicinity Map
Plate 2	Site Exploration Plan
Plates 3 - 4	Test Boring Logs
Plate 5	Shoring Drain Detail
Plate 6	Typical Footing Drain Detail

We appreciate the opportunity to be of service on this project. Please contact us if you have any questions, or if we can be of further assistance.

Respectfully submitted,



GEOTECH CONSULTANTS, INC.

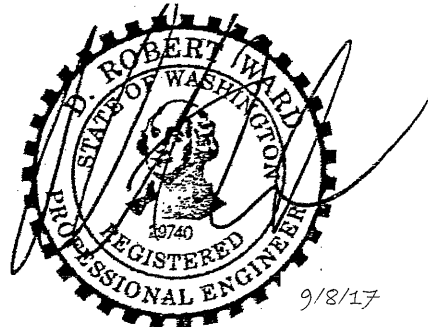

D. Robert Ward, P.E.  
Principal

DRW:mw

NORTH

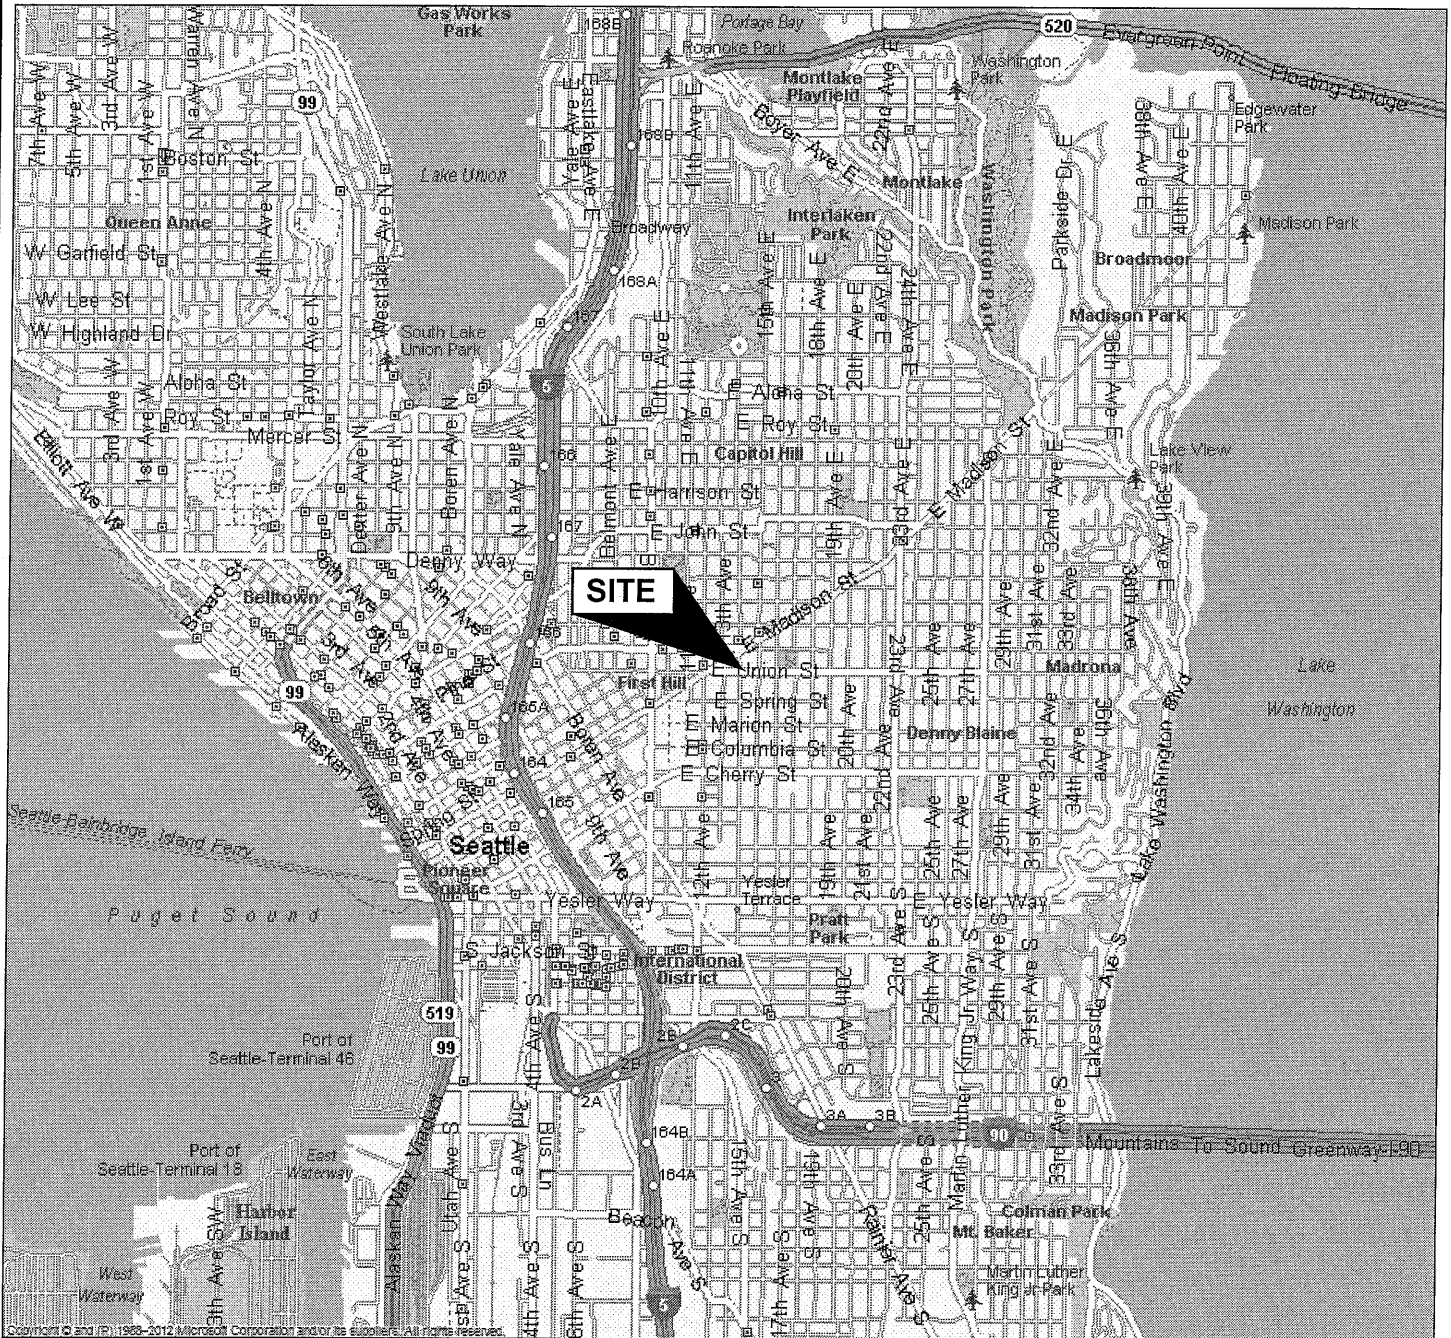

(Source: Microsoft MapPoint, 2013)



**GEOTECH**  
CONSULTANTS, INC.


## VICINITY MAP

East Union Street  
Seattle, Washington

Job No: 17422	Date: Sep. 2017	Plate: 1
------------------	--------------------	-------------

# BORING 1

Description

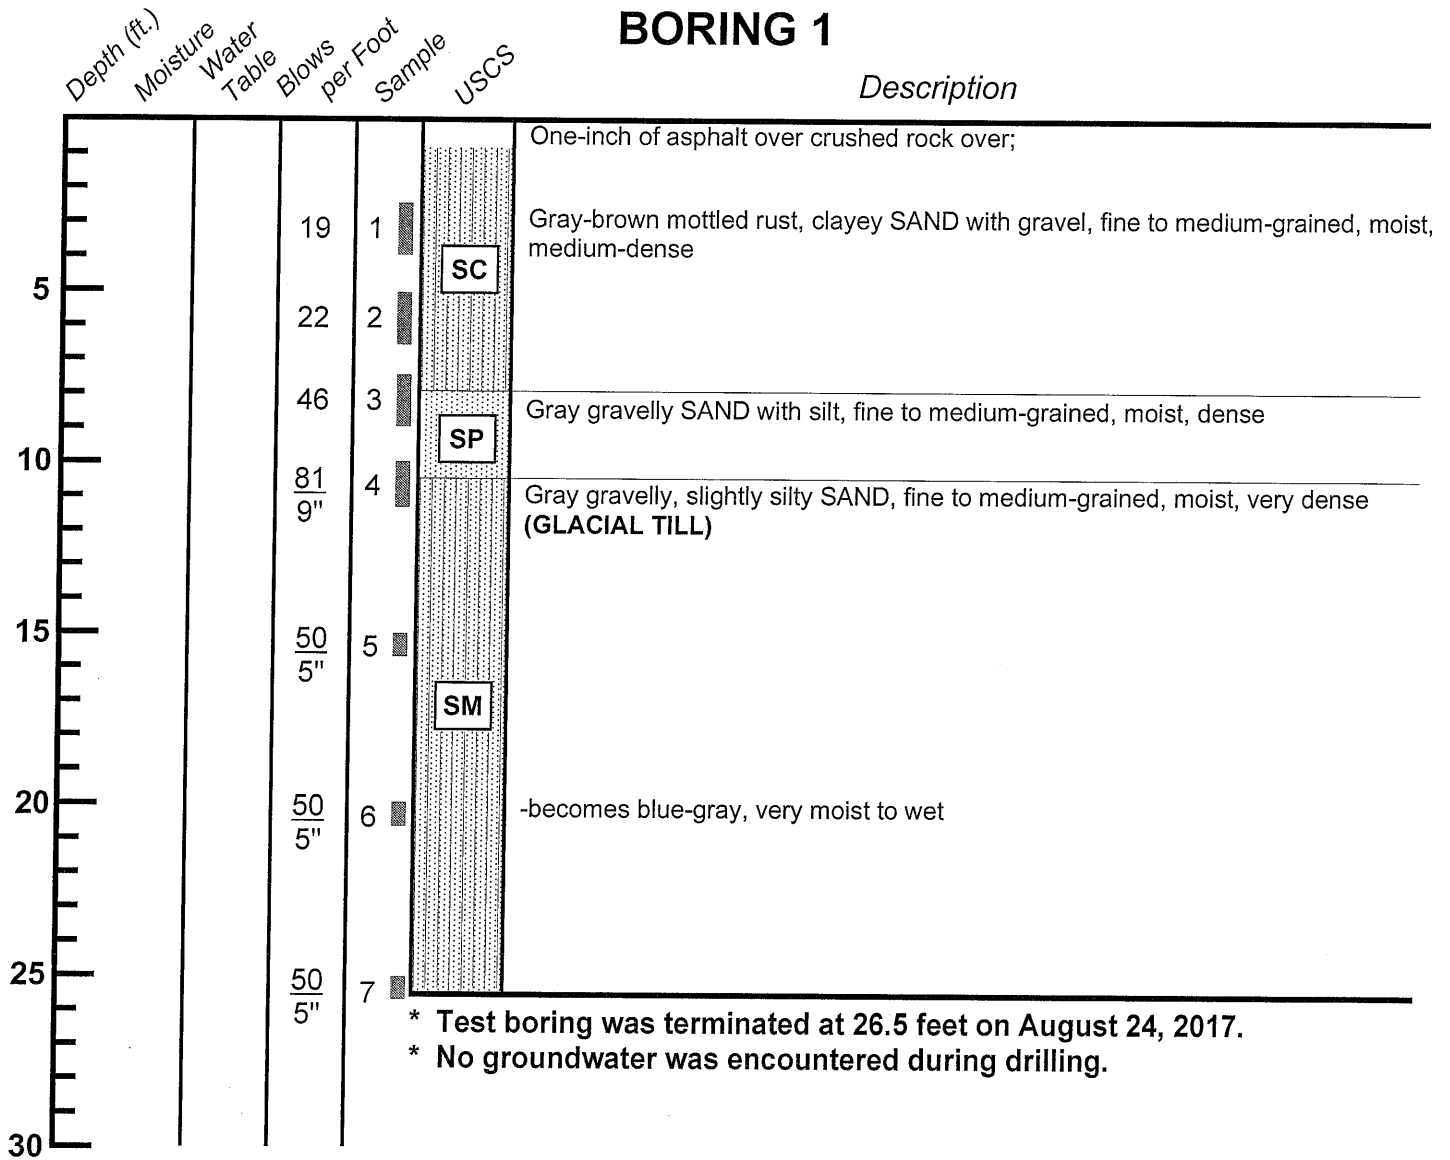

**GEOTECH**  
CONSULTANTS, INC.


## TEST BORING LOG

East Union Street  
Seattle, Washington

Job	Date:	Logged by:	Plate:
17422	Sep. 2017	ASM	3



# BORING 2

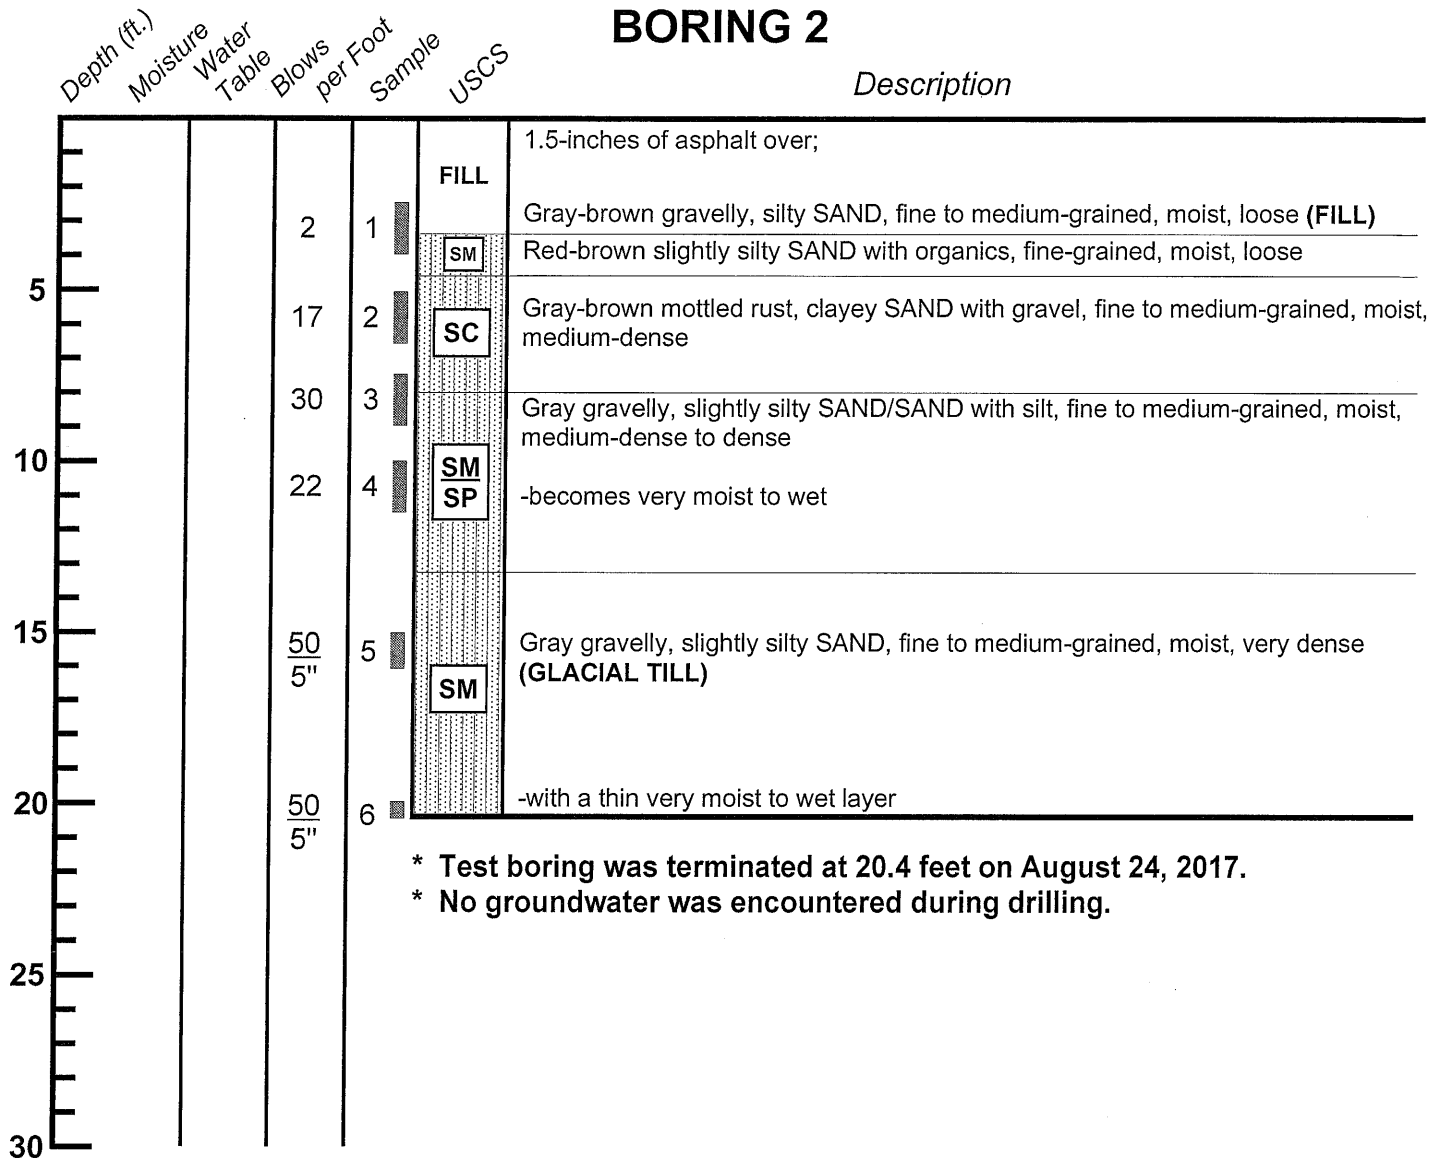

- \* Test boring was terminated at 20.4 feet on August 24, 2017.
- \* No groundwater was encountered during drilling.



**GEOTECH**  
CONSULTANTS, INC.

## TEST BORING LOG

East Union Street  
Seattle, Washington

Job

17422

Date:

Sep. 2017

Logged by:

ASM

Plate:

4